

The Village of Royal Palm Beach

Village Mayor and Council

Fred Pinto, Mayor
Jeff Hmara, Vice Mayor
Selena Samios, Councilwoman
Jan Rodusky, Councilwoman
Richard Valuntas, Councilman

Village Manager

Raymond C. Liggins, Jr., P.E.

Village Engineer

Christopher Marsh, P.E.

Village of Royal Palm Beach ADA Transition Plan

July 2024



1050 Royal Palm Beach Boulevard, Royal Palm Beach, FL 33411
(561) 790-5100 ☎ 790-5174 📧 clerk@royalpalmbeachfl.gov ✉

INDEX

TITLE	PAGE #
COVER	1
INDEX	2
INTRODUCTION	3 – 5
PROJECT DIRECTORY	6
EXECUTIVE SUMMARY	7
BUILDING COST ESTIMATE	8
BUILDING INDEX	9
BUILDING ASSESSMENTS	10 – 42
RIGHT OF WAY & PARKS MAP	43
RIGHT OF WAY ESTIMATE	44 – 45
RIGHT OF WAY ASSESSMENTS	46 – 108
PARKS ESTIMATE	109 – 111
PARKS ASSESSMENTS	112 – 161

BACKGROUND

The Americans with Disabilities Act (ADA) of 1990 is a civil rights statute (hereinafter referred to as the Act) that prohibits discrimination against people who have disabilities. There are five separate Titles (sections) of the Act relating to different aspects of potential discrimination. Title II of the Act specifically addresses the subject of making public services and public transportation accessible to those with disabilities. With the advent of the Act, designing and constructing facilities for public use that are not accessible by people with disabilities constitutes discrimination. The Act applies to all facilities, including both facilities built before and after 1990. As a necessary step to a program access plan to provide accessibility under the ADA, state and local government, public entities or agencies are required to perform self-evaluations of their current facilities, relative the accessibility requirements of the ADA. The agencies are then required to develop a Program Access Plan, which can be called a Transition Plan, to address any deficiencies. The Plan is intended to achieve the following: (1) identify physical obstacles that limit the accessibility of facilities to individuals with disabilities, (2) describe the methods to be used to make the facilities accessible, (3) provide a schedule for making the access modifications, and (4) identify the public officials responsible for implementation of the Transition Plan. The Plan is required to be updated periodically until all accessibility barriers are removed.

PURPOSE

Training staff on the ADA, conducting periodic self-evaluations of the accessibility of the public entity's policies, programs and facilities, and developing a transition plan to remove barriers.

ADA Coordinator

The ADA Coordinator is responsible for coordinating the efforts of the government entity to comply with Title II and investigating any complaints that the entity has violated Title II. Contact information for the ADA coordinator is as follows:

Christopher Marsh, P.E.
1050 Royal Palm Beach Blvd.
Royal Palm Beach, FL 33411
(561) 790-5161
ADAcomplaint@royalpalmbeachfl.gov

Grievance Procedures

Village of Royal Palm Beach
Grievance Procedure under
The Americans with Disabilities Act

This Grievance Procedure is established to meet the requirements of the Americans with Disabilities Act of 1990 ("ADA"). It may be used by anyone who wishes to file a complaint alleging discrimination on the basis of disability in the provision of services, activities, programs, or benefits by the Village of Royal Palm Beach. The Village's Personnel Policy governs employment-related complaints of disability discrimination. The complaint should be in writing and contain information about the alleged discrimination such as name, address, phone number of complainant and location, date, and description of the problem. Alternative means of filing complaints, such as personal interviews or a tape recording of the complaint, will be made available for persons with disabilities upon request. The complaint should be submitted by the grievant and/or his/her designee as soon as possible but no later than 60 calendar days after the alleged violation to:

Christopher Marsh, P.E.
1050 Royal Palm Beach Blvd.
Royal Palm Beach, FL 33411
(561) 790-5165
ADAcomplaint@royalpalmbeachfl.gov

Within 15 calendar days after receipt of the complaint, *Christopher Marsh* or *his* designee will meet with the complainant to discuss the complaint and the possible resolutions. Within 15 calendar days of the meeting, *Christopher Marsh* or *his* designee will respond in writing, and where appropriate, in a format accessible to the complainant, such as large print, Braille, or audio tape. The response will explain the position of the **Village of Royal Palm Beach** and offer options for substantive resolution of the complaint.

If the response by *Christopher Marsh* or *his* designee does not satisfactorily resolve the issue, the complainant and/or his/her designee may appeal the decision within 15 calendar days after receipt of the response to the **Village Manager** or his designee. Within 15 calendar days after receipt of the appeal, the **Village Manager** or *his* designee will meet with the complainant to discuss the complaint and possible resolutions. Within 15 calendar days after the meeting, the **Village Manager** or his designee will respond in writing, and, where appropriate, in a format accessible to the complainant, with a final resolution of the complaint.

All written complaints received by *Christopher Marsh* or *his* designee, appeals to the **Village Manager** or *his* designee, and responses from these two offices will be retained by the **Village of Royal Palm Beach** for at least three years.

Public Outreach

The opportunity for the disabled community and other interested parties to participate in developing the Transition Plan is an integral part of the process. The plan may be viewed on the village's website, www.royalpalmbeachfl.gov. Stakeholders are encouraged to comment on the proposed plan within the next 45 days, please address questions or comments to the Village Engineer.

Christopher Marsh, P.E.
Village Engineer

1050 Royal Palm Beach Blvd.
Royal Palm Beach, FL 33411
(561) 790-5165
cmarsh@royalpalmbeachfl.gov

VILLAGE OF ROYAL PALM BEACH – ADA TRANSITION PLAN

PROJECT DIRECTORY

ARCHITECT: DHGA Design-FL.
225 Southern Blvd. Ste 202
West Palm Beach, Florida 33405
Robert E. Hill, RA
561-290-5843
rhill@dhgadesign.com

ENGINEER: Village of Royal Palm Beach
1050 Royal Palm Beach Blvd.
Royal Palm Beach, Florida 33411
Christopher A. Marsh, PE
561-790-5161
cmarsh@royalpalmbeachfl.gov

*Please note: DHGA is no longer updating this report. The removal of completed items and the updates to cost estimates are provided by Adamo DiSisto, PE, Project Engineer of the Village of Royal Palm Beach. Costs are updated based on an average percent increase of common construction items as listed in FDOT Historic Item Average Cost Reports.



Village of Royal Palm Beach, Florida

1050 Royal Palm Beach Boulevard Royal Palm Beach, Florida 33411
Telephone (561) 790-5161 Fax (561) 790-5174 E-mail: cmarsh@royalpalmbeachfl.gov

Christopher Marsh, P.E.
Village Engineer

July 2024

The Village of Royal Palm Beach achieved 56% of total compliance of the ADA Transition Plan since the previous report in 2019, including improvements to Buildings, Curb Ramps, and Park Pathways. The table below summarizes the achievements of each component of the ADA Transition Plan.

Category	Total Estimated Cost of ADA Transition as of Previous Report	Cost of ADA Transition Elements Completed This Phase	Percentage of ADA Transition Completed This Phase
Buildings	\$ 1,150,300.00	\$ 930,550.00	81%
Curb Ramps	\$ 227,500.00	\$ 19,500.00	9%
Parks	\$ 405,121.00	\$ 60,000.00	15%
TOTAL	\$ 1,782,921.00	\$ 1,010,050.00	57%

Village Hall was fully reconstructed and the Cultural Center was heavily renovated, both designed and built to current ADA standards. These two locations required the most extensive and expensive transitions on the 2019 report. Their completion during this phase completed a significant portion of both the Building Transition Plan and overall ADA Transition Plan.

Six intersections, all with four curb ramps each, were reconstructed to current ADA standards as part of the Crestwood Boulevard North road resurfacing project.

Almost all of the hardscape of Todd A. Robiner Park was reconstructed from asphalt to concrete. The parking lot and all of the pathways were brought up to current ADA standards, and the switch to concrete will ensure that these surfaces remain ADA compliant for many years beyond what simply resurfacing the asphalt would achieve.

Sincerely,

Chris Marsh, P.E.
Village Engineer

ADA TRANSITION PLAN - BUILDINGS

SUMMARY Estimated Construction Cost (without fees)

Rev Date: 7/2024

	LOW	HIGH	Estimated Completion Date
4 - RECREATION CENTER	\$7,696	\$13,413	2026
5 - PBSO	\$2,035	\$37,925	2025
6.1 - VETERAN'S PARK Mess Hall	\$1,850	\$2,775	2025
6.3 - VETERAN'S PARK Restroom Building	\$1,110	\$1,480	2024
6.4 - VETERAN'S PARK Performance Pavilion	\$925	\$13,320	2027
7.2 - BOB MARCELLO Small Concessions & Press Box	\$2,775	\$4,440	2024
7.3 - BOB MARCELLO Restroom Building	\$4,810	\$7,400	2024
7.4 - BOB MARCELLO Large Concessions & Press Box	\$555	\$4,070	2024
8 - KATZ PARK Restrooms & Concessions	\$82,695	\$114,700	2028
10 - TODD ROBINER PARK Restrooms & Storage Building	\$21,275	\$32,560	2026
11 - CAMELIA PARK Convert to single occupancy	\$33,300	\$49,950	2025
12 - CHALLENGER PARK	\$21,275	\$32,560	2027
13 - LINDSAY EWING PARK RESTROOMS	\$74,185	\$89,540	2026
14 - DAVID B. FARBER TRAINING CENTER	\$13,875	\$18,500	2025
17 - CYPRESS HALL	\$60,633	\$89,508	2028
TOTAL	\$328,994	\$512,141	

NOTE: These costs are for modifications for ADA compliant issues and not for building upgrades and renovations.

Building ADA Assessment

Buildings included in the survey:

- 1 Village Hall
- 2 Public Works Office Building
- 3 Cultural Center
- 4 Recreation Center
- 5 PBSO District #9 Building
- 6 Veteran's Park (4 Buildings):
 - .1 Mess Hall
 - .2 Market Building
 - .3 Restroom Building
 - .4 Performance Pavilion
- 7 Bob Marcello Baseball Complex (4 Buildings):
 - .1 Restroom/Concession Building
 - .2 Concession/Storage Building/Press Box (2 Story)
 - .3 Restroom Building
 - .4 Concession/Storage Building/Press Box (2 Story)
- 8 Katz Soccer Complex: Restroom/Concession
- 9 Ferrin Park Restroom/Concession/Storage Building
- 10 Todd Robiner Park: Restroom/Storage Building
- 11 Camellia Park Restroom/Office/Storage Building
- 12 Lake Side Challenger Park Restroom/Storage Building
- 13 Lindsay Ewing Park Restroom Building
- 14 David B. Farber Training Center
- 15 Commons Park
 - .1 Driving Range Restroom Building
 - .2 Sporting Center
 - .3 Restroom Building South Lawn
 - .4 Maintenance Building 'A'
- 16 Crestwood North Park Restroom Building
- 17 Cypress Hall

Buildings ADA Compliance Survey

1 - VILLAGE HALL

Constructed: 2024

STATUS: Compliant; Certified by REG (Architect) in 2023

Revised: 2024

Village Hall was completely demolished and a new building was constructed to current ADA standards, as of 2023.

2 - PUBLIC WORKS FIELD OPERATIONS OFFICE BUILDING

Constructed: 1999

STATUS: Compliant; Confirmed by Paul Webster (Public Works Director)

Revised: 2024

All Non-Compliant conditions from the 2017 report have been corrected.

3 - CULTURAL CENTER

Constructed: 1993

Renovated: 2019

STATUS: Compliant; Certified by DHGA (Architect)

Revised 2018

The Cultural Center was expanded and renovated in 2018. The Non-Compliant conditions from the 2017 report were addressed as part of the renovations. The expansions were constructed to meet ADA standards at that time.

4 - RECREATION CENTER

Constructed: 1991

STATUS: In Progress; The proposed 2026 renovation project will address the issues from the 2017 report.


Revised: 2024

Existing Non-Compliant Condition:	Recommendations:
Inaccessible restrooms.	Install signage with directions to an accessible facilities: rooms 148, 149, 164, 165. Or, modify as described below.
Women’s Room 132 - Exposed pipes under vanity. No grab bar at back of WC.	Add apron to cover exposed piping or pipe wrap. Install grab bar at back of stalls.
Men’s Room 133 - Exposed pipes under vanity. No grab bar at back of WC.	Add apron to cover exposed piping or pipe wrap. Install grab bar at back of stalls.
Door 120 – Push side 12”, Pull side 18”.	Pull side requires 18” – not feasible to modify. Remove door frame, reinstall so that door is tight to the side wall at the hinge side.
Kitchen Service Counter @ 36” above finished floor.	Kitchenette – Requires minimum a 34” high by 36” long section accessible to employees with disabilities.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Toilet Room Accessories	\$2,775	\$3,700
Signage	\$296	\$463
Kitchen Counter Top	\$4,625	\$9,250
ESTIMATED CONSTRUCTION COST	\$7,696	\$13,413

4 - RECREATION CENTER

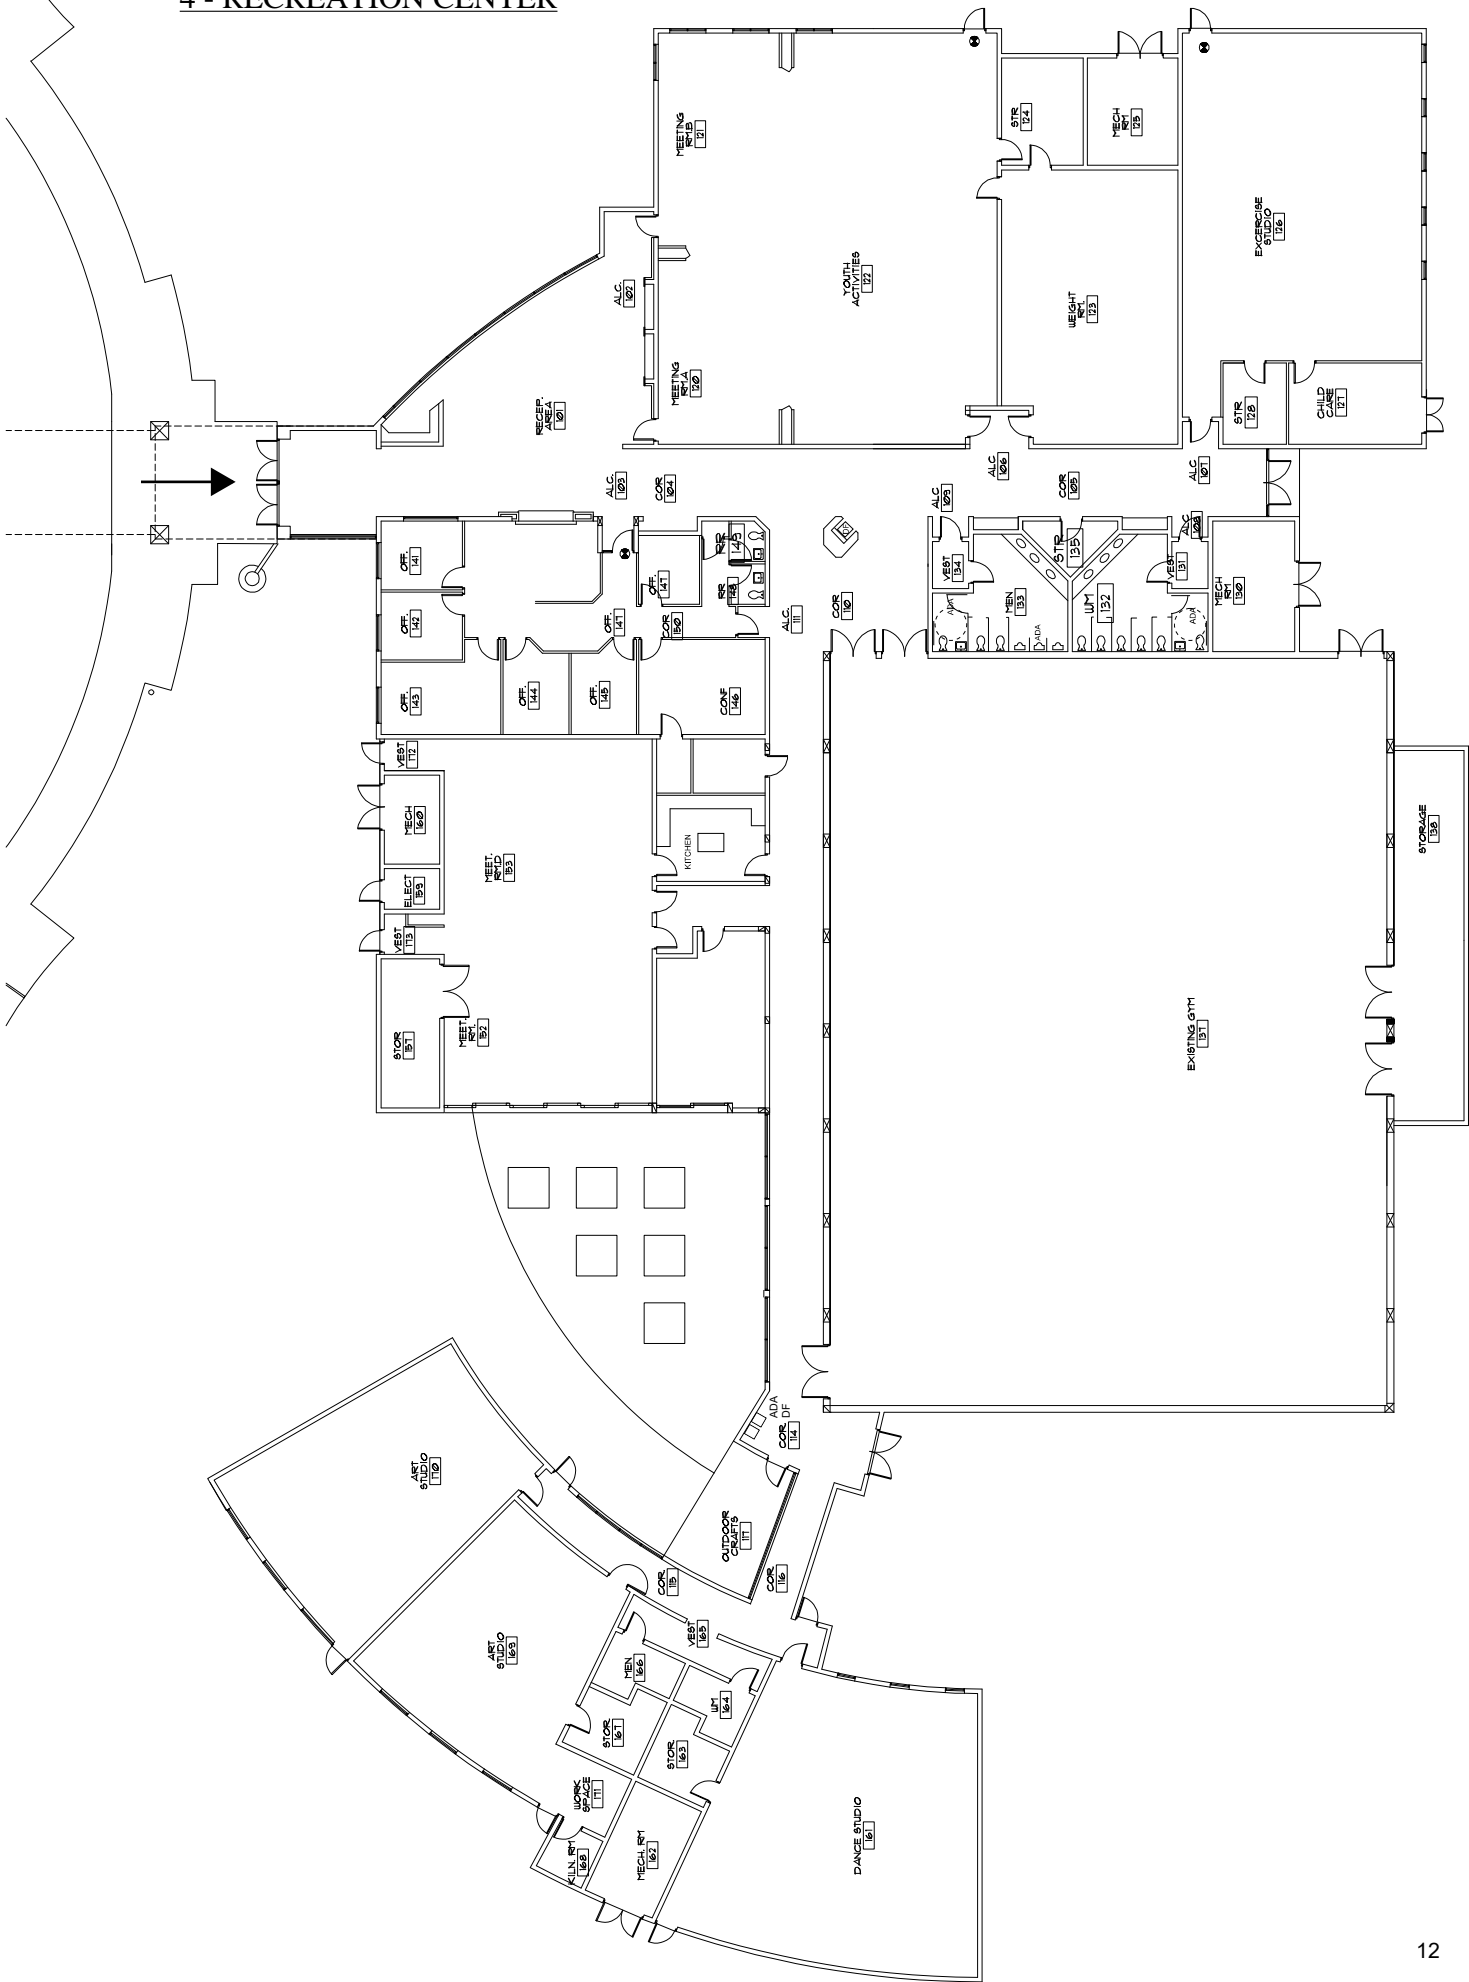

5 - PALM BEACH COUNTY SHERIFF, DISTRICT 9 OFFICE

Constructed: 1988


STATUS: In Progress; Updates confirmed by Paul Webster (Public Works Director)

Revised: 2024

Existing Non-Compliant Condition:	Recommendations:
Record Unit Room 112 – Service Counter 42” above finished floor.	Provide counter/writing surface @ lower level 36” high by 36” long.
Women’s Room 105 & Men’s Room 106 - Water closet 36” wide with grab bars.	Add signage for accessible wheelchair toilet room location. Or convert by omitting a fixture at each to allow for 5’ x 5’ ADA stall with toilet and lavatory.
Women’s Room 128 & Men’s Room 130 - Staff showers are not accessible. Toilet fixtures not accessible.	Shower not feasible to modify. Provide signage with directions to accessible toilets, room 129. Replace existing sign indicating it is currently accessible.
AED equipment in Corridor 143, adjacent to the accessible restroom protrudes more than 4”.	The equipment should be relocated or recessed in the wall to a 4” max protrusion into the corridor.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Lower portions or all of counter tops at Records Room	\$1,110	\$6,475
Signage	\$463	\$648
Restrooms 105 & 106	\$463	\$30,803
ESTIMATED CONSTRUCTION COST	\$2,035	\$37,925

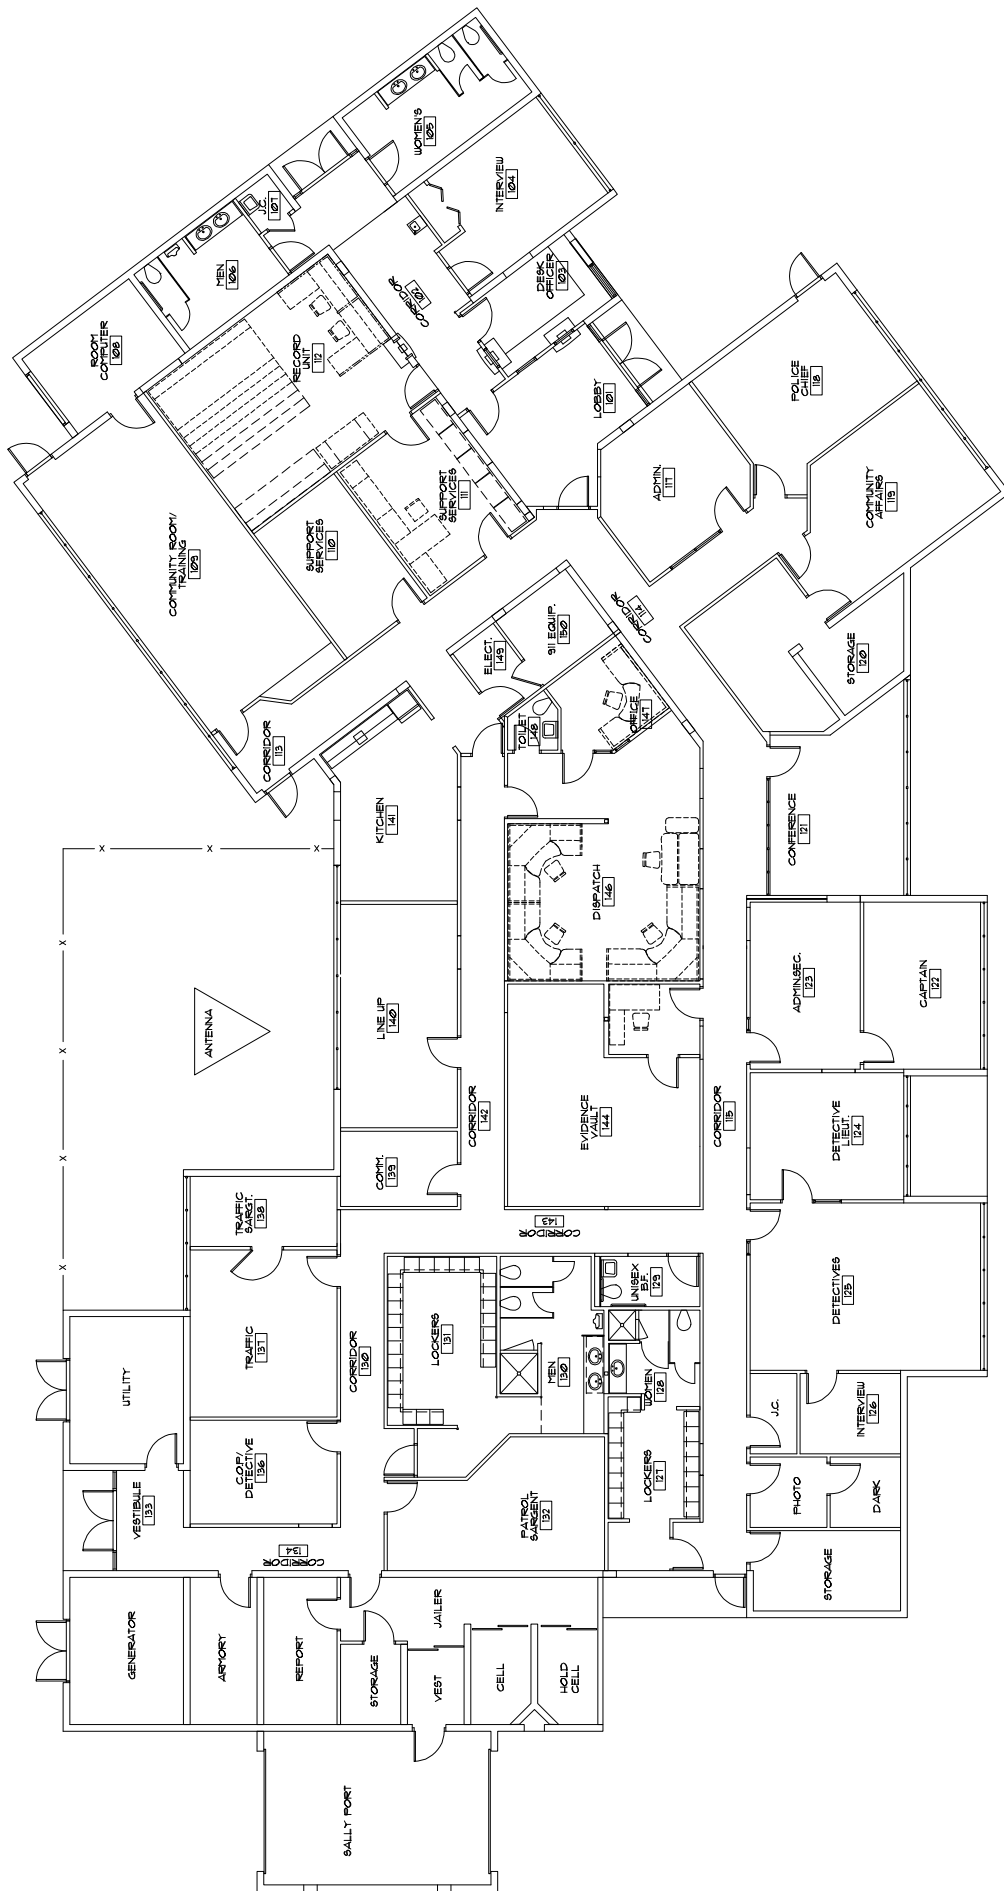

5 - PBSO DISTRICT #9 OFFICE

SCALE: 1/8" = 1'-0"

6.1 – VETERAN’S PARK MESS HALL

Constructed: 2002

STATUS: In Progress; Updates confirmed by Mark Pawlowski (Parks & Recreation Director)


Revised: 2024

Existing Non-Compliant Condition:	Recommendations:
Service Counter @ 42” above finished floor	Lower counter top to 36” above finished floor. Or lower a section 36” long to 36” high.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Modify Service Counter	\$1,850	\$2,775
ESTIMATED CONSTRUCTION COST	\$1,850	\$2,775

6.1 - MESS HALL - VETERANS PARK

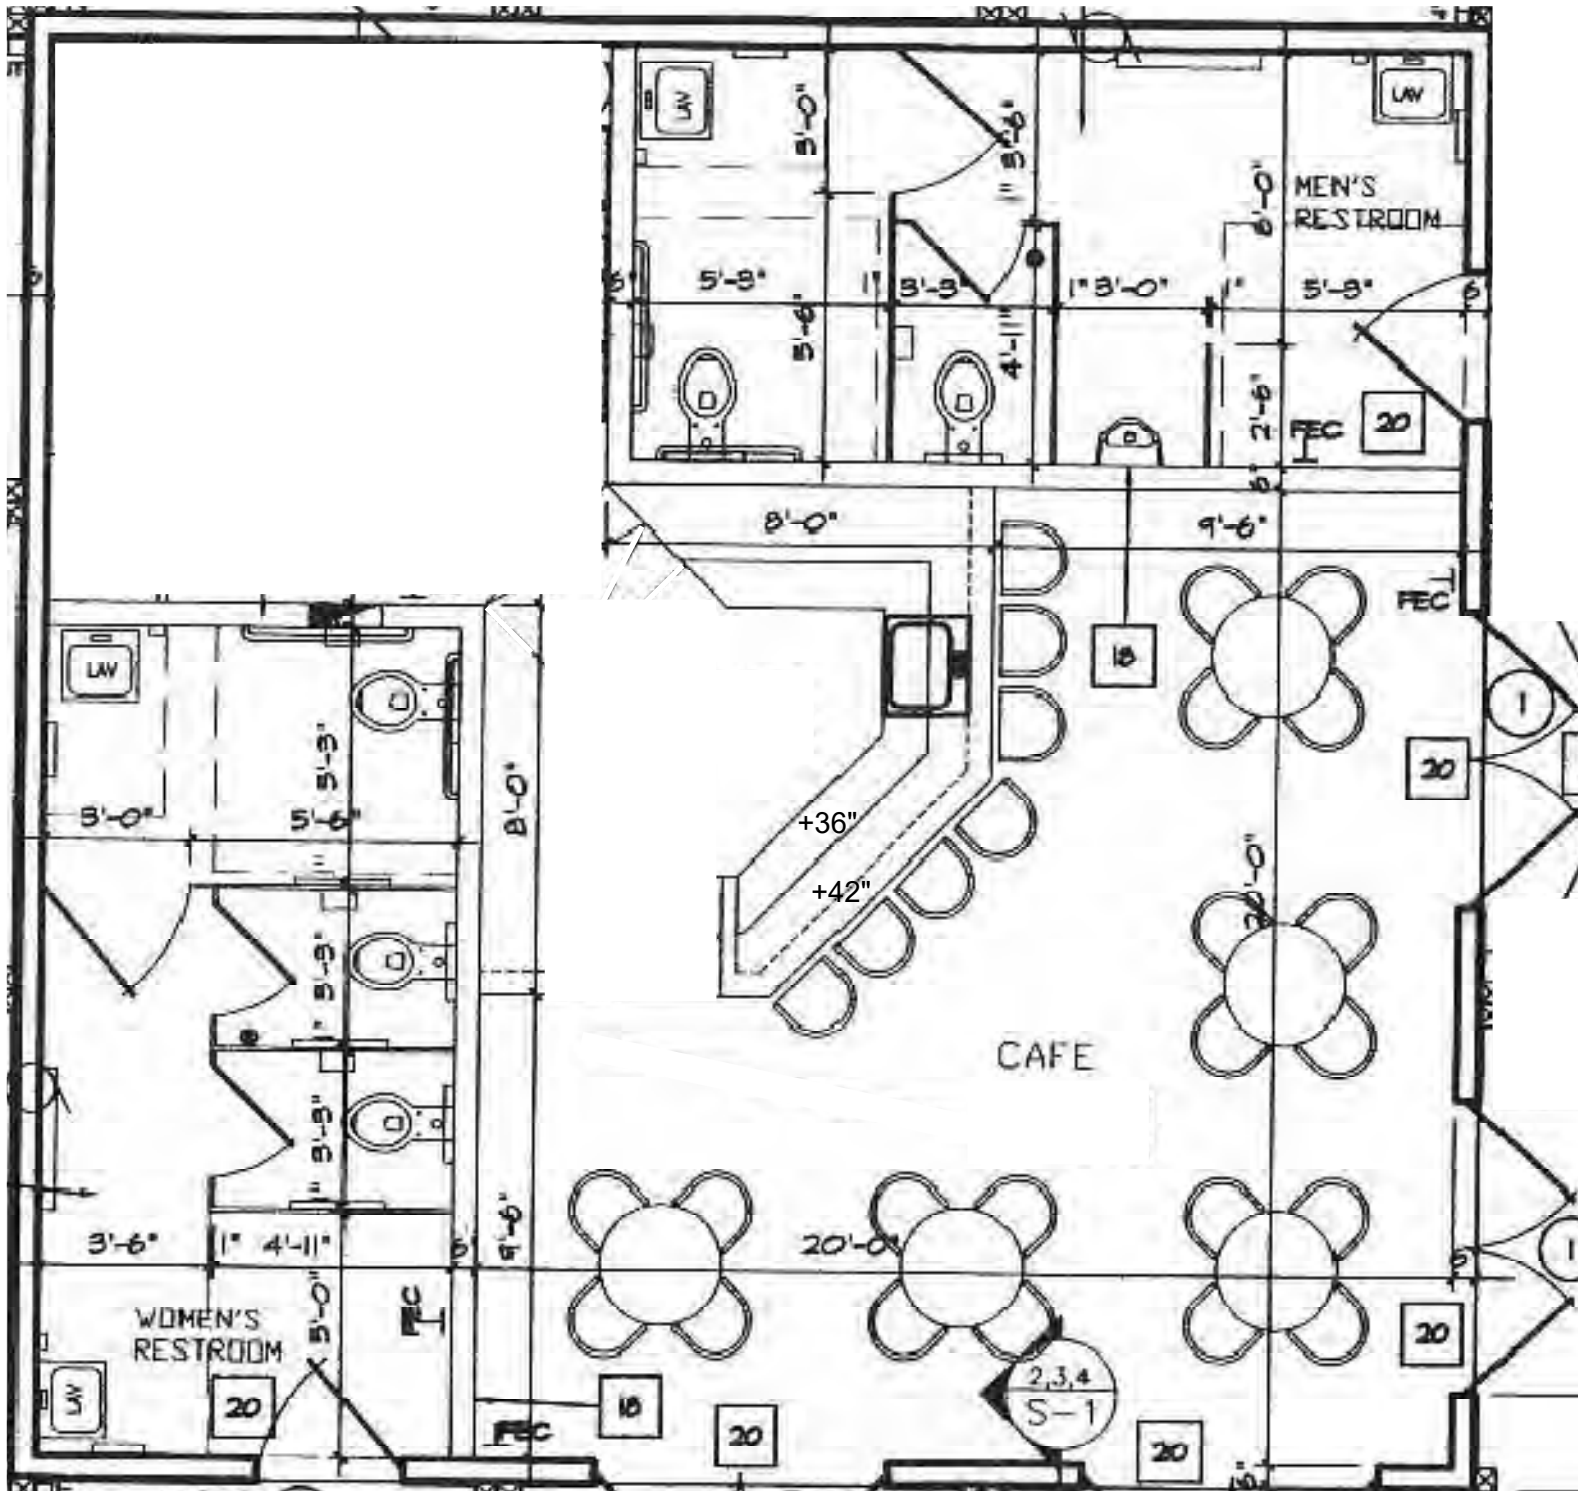

6.2 – VETERAN’S PARK MARKET BUILDING

STATUS: Compliant; Certified by DHGA (Architect) in 2017
Constructed: 2002

No non-compliant conditions were noted in the original 2017 report.

6.3 – VETERAN’S PARK RESTROOM BUILDING


STATUS: In Progress; Updates confirmed by Mark Pawlowski (Parks & Recreation Director)
Revised: 2024

Existing Non-Compliant Condition:	Recommendations:
Drinking fountain is closed below, cutting the wheelchair toe clearance.	Remove the enclosed area under drinking fountain to allow for proper floor space clearance for a wheelchair.
Men’s Restroom entrance threshold has cracked concrete slab.	Repair slab to prevent a tripping hazard.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Modify drinking fountain for proper toe clearance below	\$555	\$740
Repair concrete at Men’s restroom entrance	\$555	\$740
ESTIMATED CONSTRUCTION COST	\$1,110	\$1,480

6.3 - RESTROOM BUILDING - VETERANS PARK

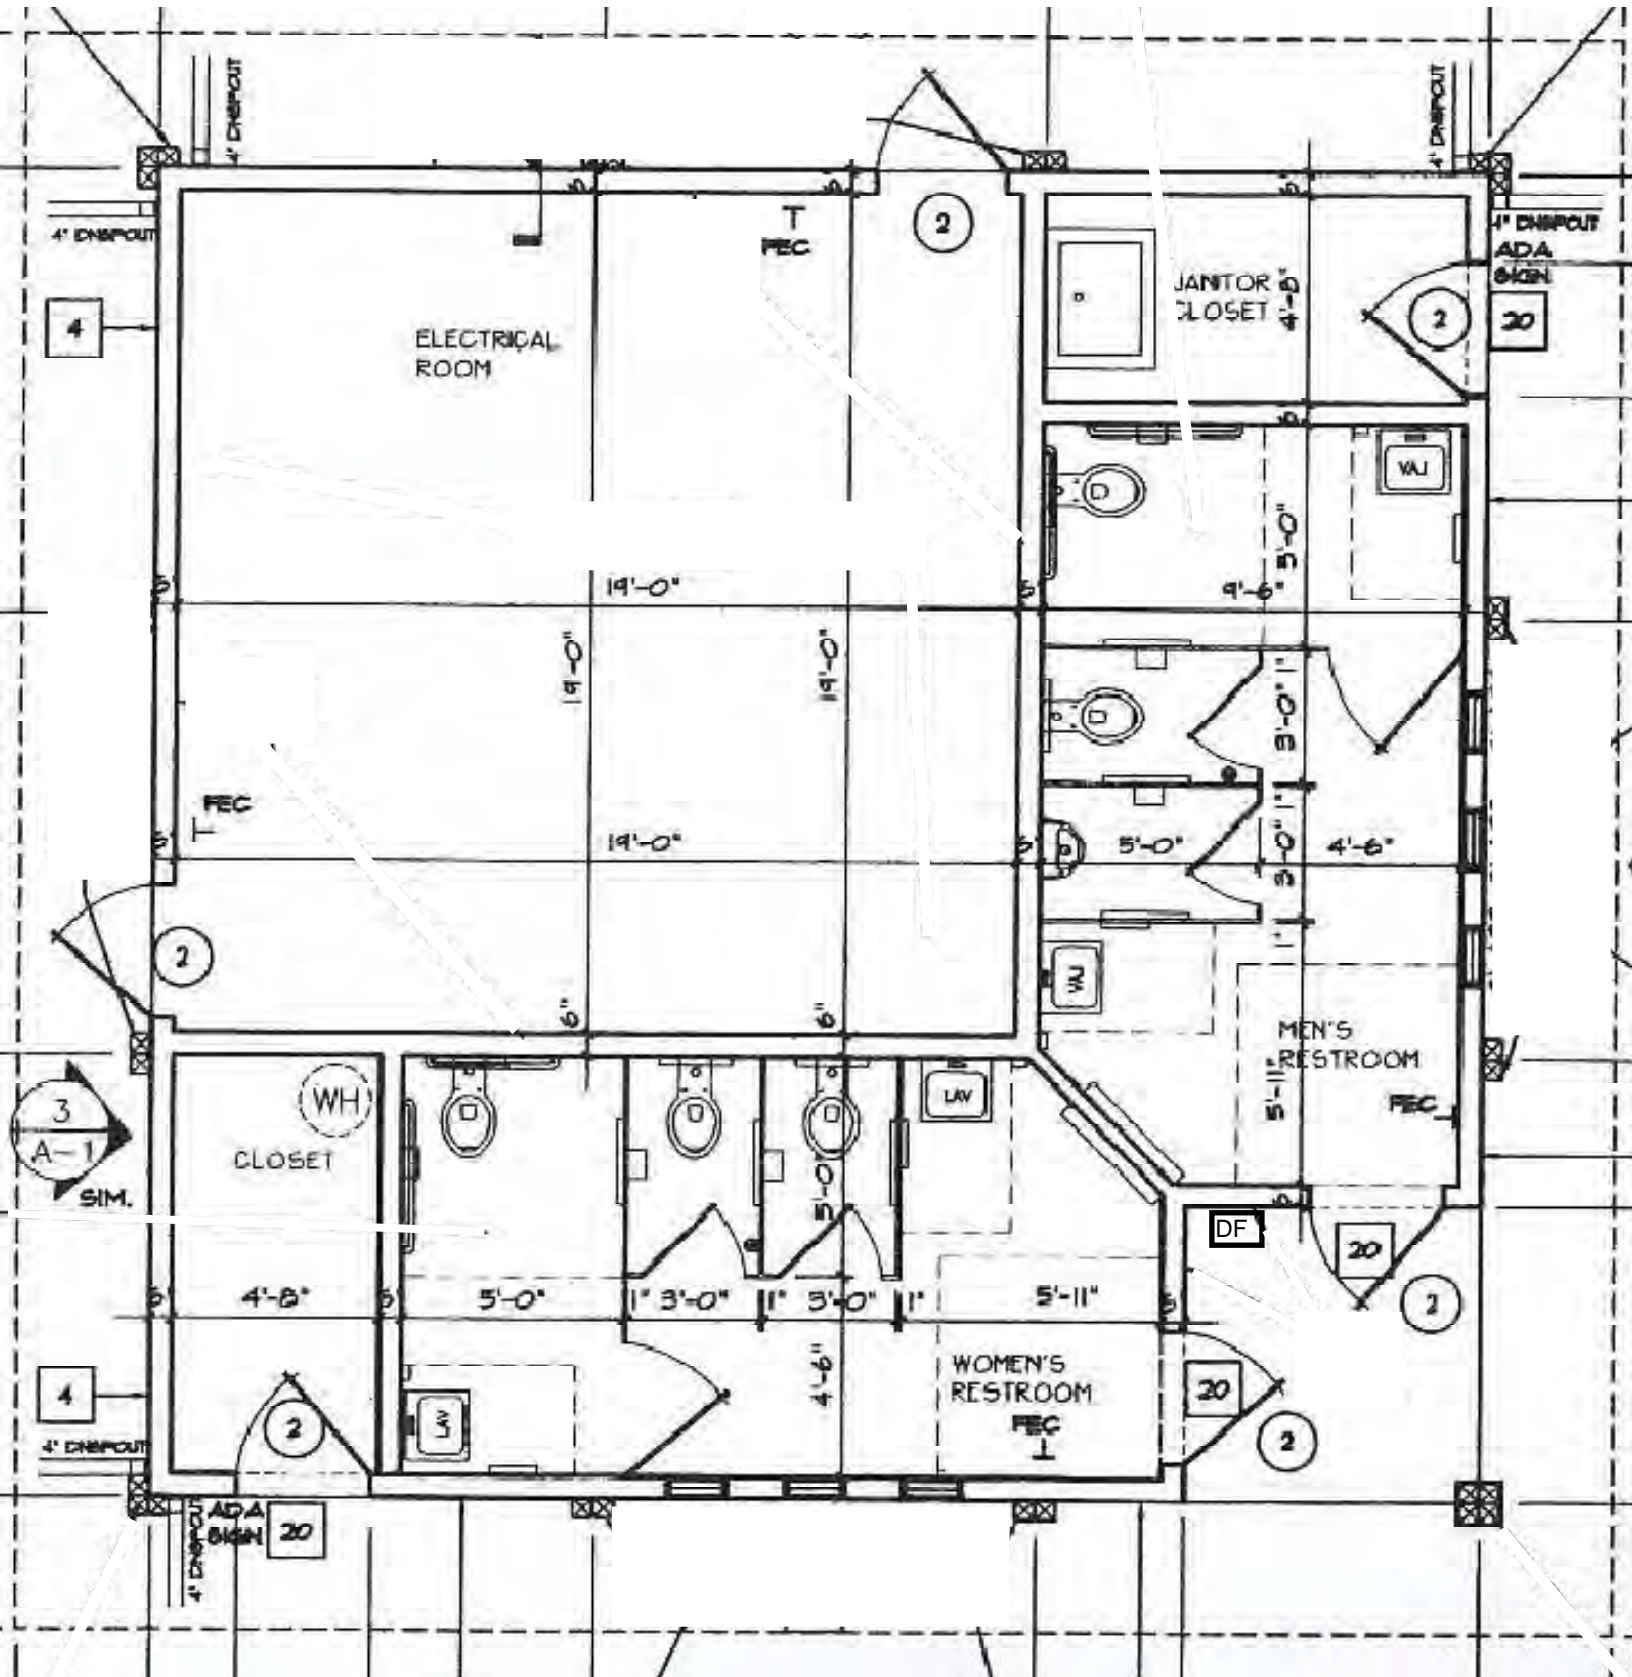

6.4 – VETERAN’S PARK PERFORMANCE PAVILION

Constructed: 2002


STATUS: In Progress

Existing Non-Compliant Condition:	Recommendations:
Restrooms – The gang lavatories are at 34” above finished floor and 24” clear from apron to floor.	29” clearance below is required for ADA. The apron will require trimming to meet the clearance. However, the ADA stall is in compliance.
Secure exposed pipes under lavatories.	Install new or secure existing pipe wrap for proper protection.
Doors to the Locker area have 17” side clearance on the pull side. 18” required.	Verify clearance. If needed the doors can be flipped to provide the required side clearance.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Restroom exposed piping lav. Optional vanity clearance below.	\$370	\$6,845
Locker area modify existing doors for clearance	\$555	\$6,475
ESTIMATED CONSTRUCTION COST	\$925	\$13,320

6.4 - PERFORMANCE PAVILION - VETERANS PARK

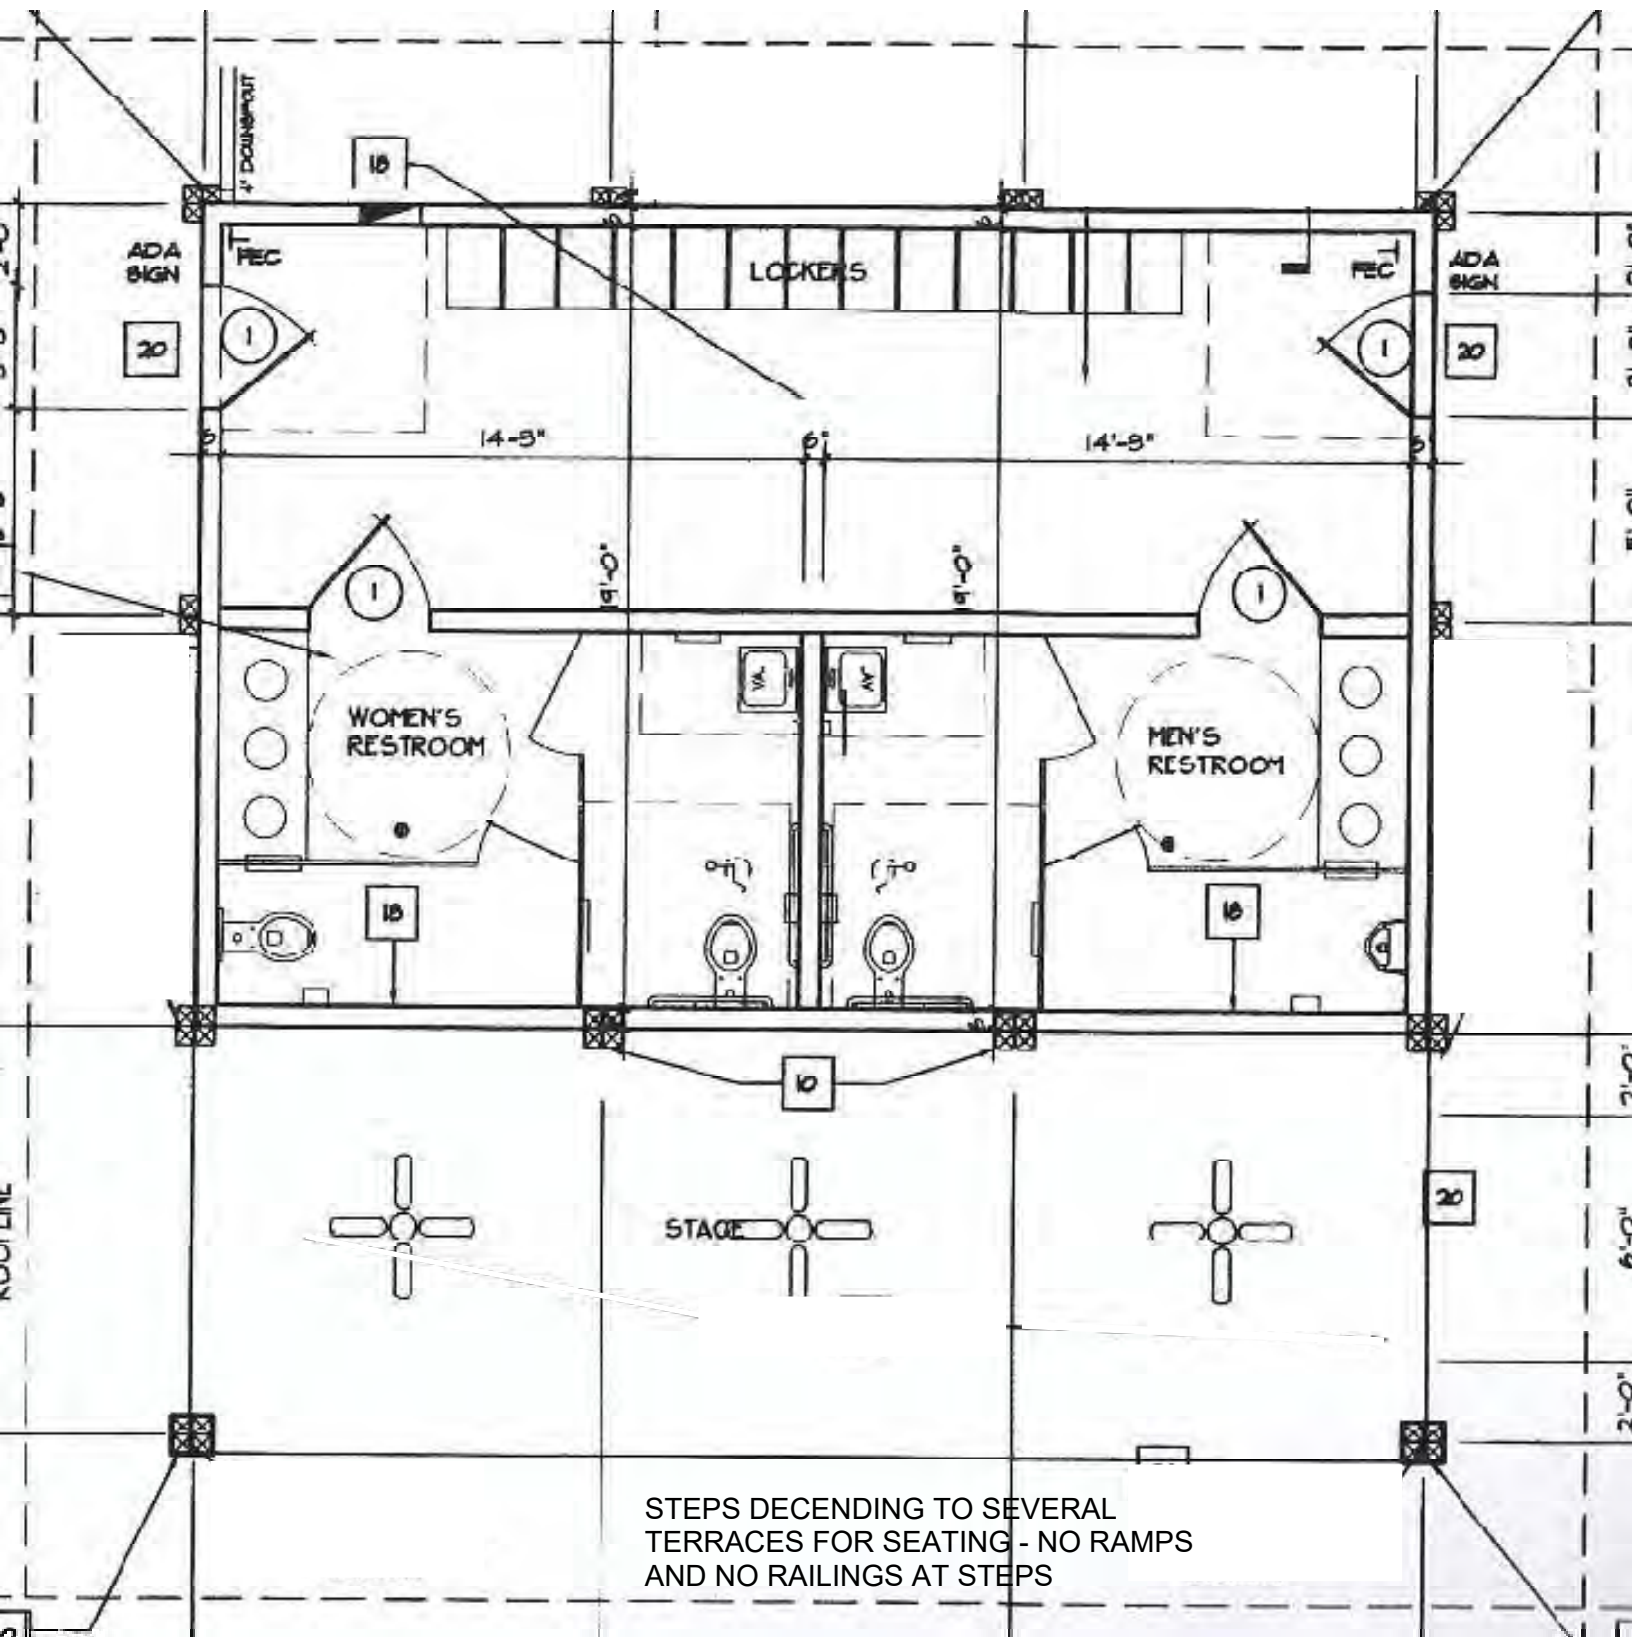

STEPS DECENDING TO SEVERAL
TERRACES FOR SEATING - NO RAMPS
AND NO RAILINGS AT STEPS

7.1 - BOB MARCELLO BASEBALL COMPLEX - RESTROOM / CONCESSION

Constructed: 2001

STATUS: Compliant; Confirmed by Mark Pawlowski (Parks & Recreation Director)

Revised: 2024

7.2 - BOB MARCELLO BASEBALL COMPLEX - CONCESSION / STORAGE / PRESS BOX

(2 Story)

Constructed: 1989

STATUS: In Progress; Updates confirmed by Mark Pawlowski (Parks & Recreation Director)


Revised: 2024

Existing Non-Compliant Condition:	Recommendations:
Serving counters at the Snack Bar are 44” above finished floor.	Lower counter to 36” above the public access level
Concrete walk in front of serving counter is 48” wide.	Widen concrete walk at counters to 60” for wheelchair accessibility.
The 1 st Floor is 2” – 3” above the concrete walks which limits access to the non-public spaces.	Raise the concrete walkways at the building entrances. However, these are non-public areas which do not require accessibility.
2 nd Story Press Box is not accessible.	2 nd Story Press Box is not required to be accessible.

ESTIMATED COSTS:


Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Modify paved apron at serving counter to be 36” maximum and minimum 5’ wide approach clearance.	\$2,775	\$4,440
ESTIMATED CONSTRUCTION COST	\$2,775	\$4,440

7.2 - SMALL CONCESSION / PRESS BOX

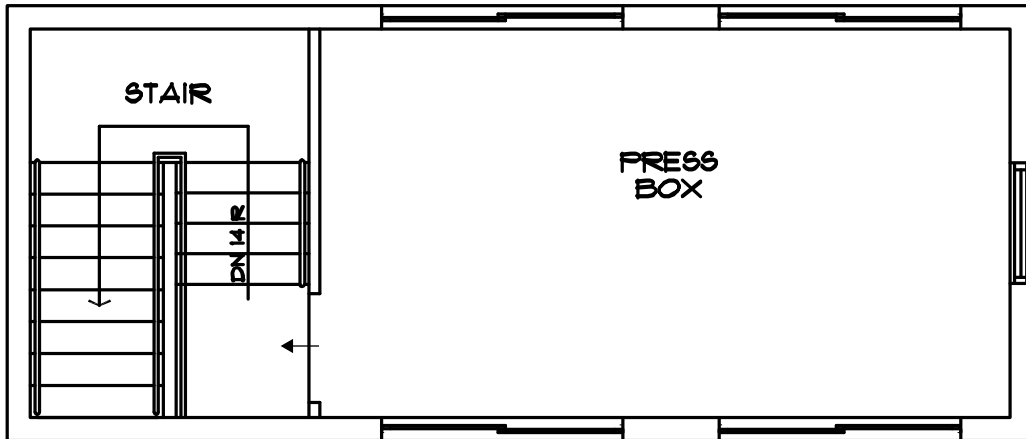


2ND FLOOR PLAN

SCALE: 1/4"=1'-0"

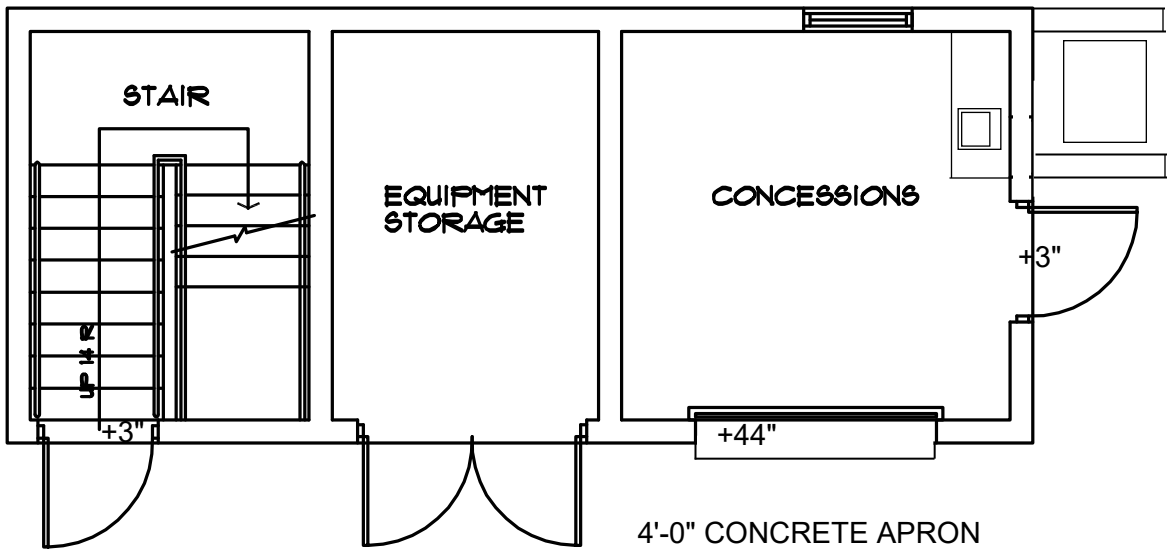

1ST FLOOR PLAN

 SCALE: 1/4"=1'-0"



GRAPHIC SCALE:

7.3 - BOB MARCELLO BASEBALL COMPLEX - RESTROOM BUILDING

Constructed: 2003


STATUS: In Progress

Existing Non-Compliant Condition:	Recommendations:
The vanity in the open area is a closed cabinet which does not allow for wheelchair access.	The cabinet must be removed and open vanity installed with the proper clearances.
The signage at the doors do not indicate that the facility is ADA accessible.	Change the signage to include the ADA accessible symbol.
Drinking fountain spout at 43" above finished floor	Required height 36" maximum.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Modify vanity in open area for proper clearance below. Remove the cabinet.	\$2,775	\$4,440
Modify signage at restroom doors.	\$555	\$740
Lower drinking fountain.	\$1,480	\$2,220
ESTIMATED CONSTRUCTION COST	\$4,810	\$7,400

7.3 - RESTROOM BLDG. - MARCELLO COMPLEX

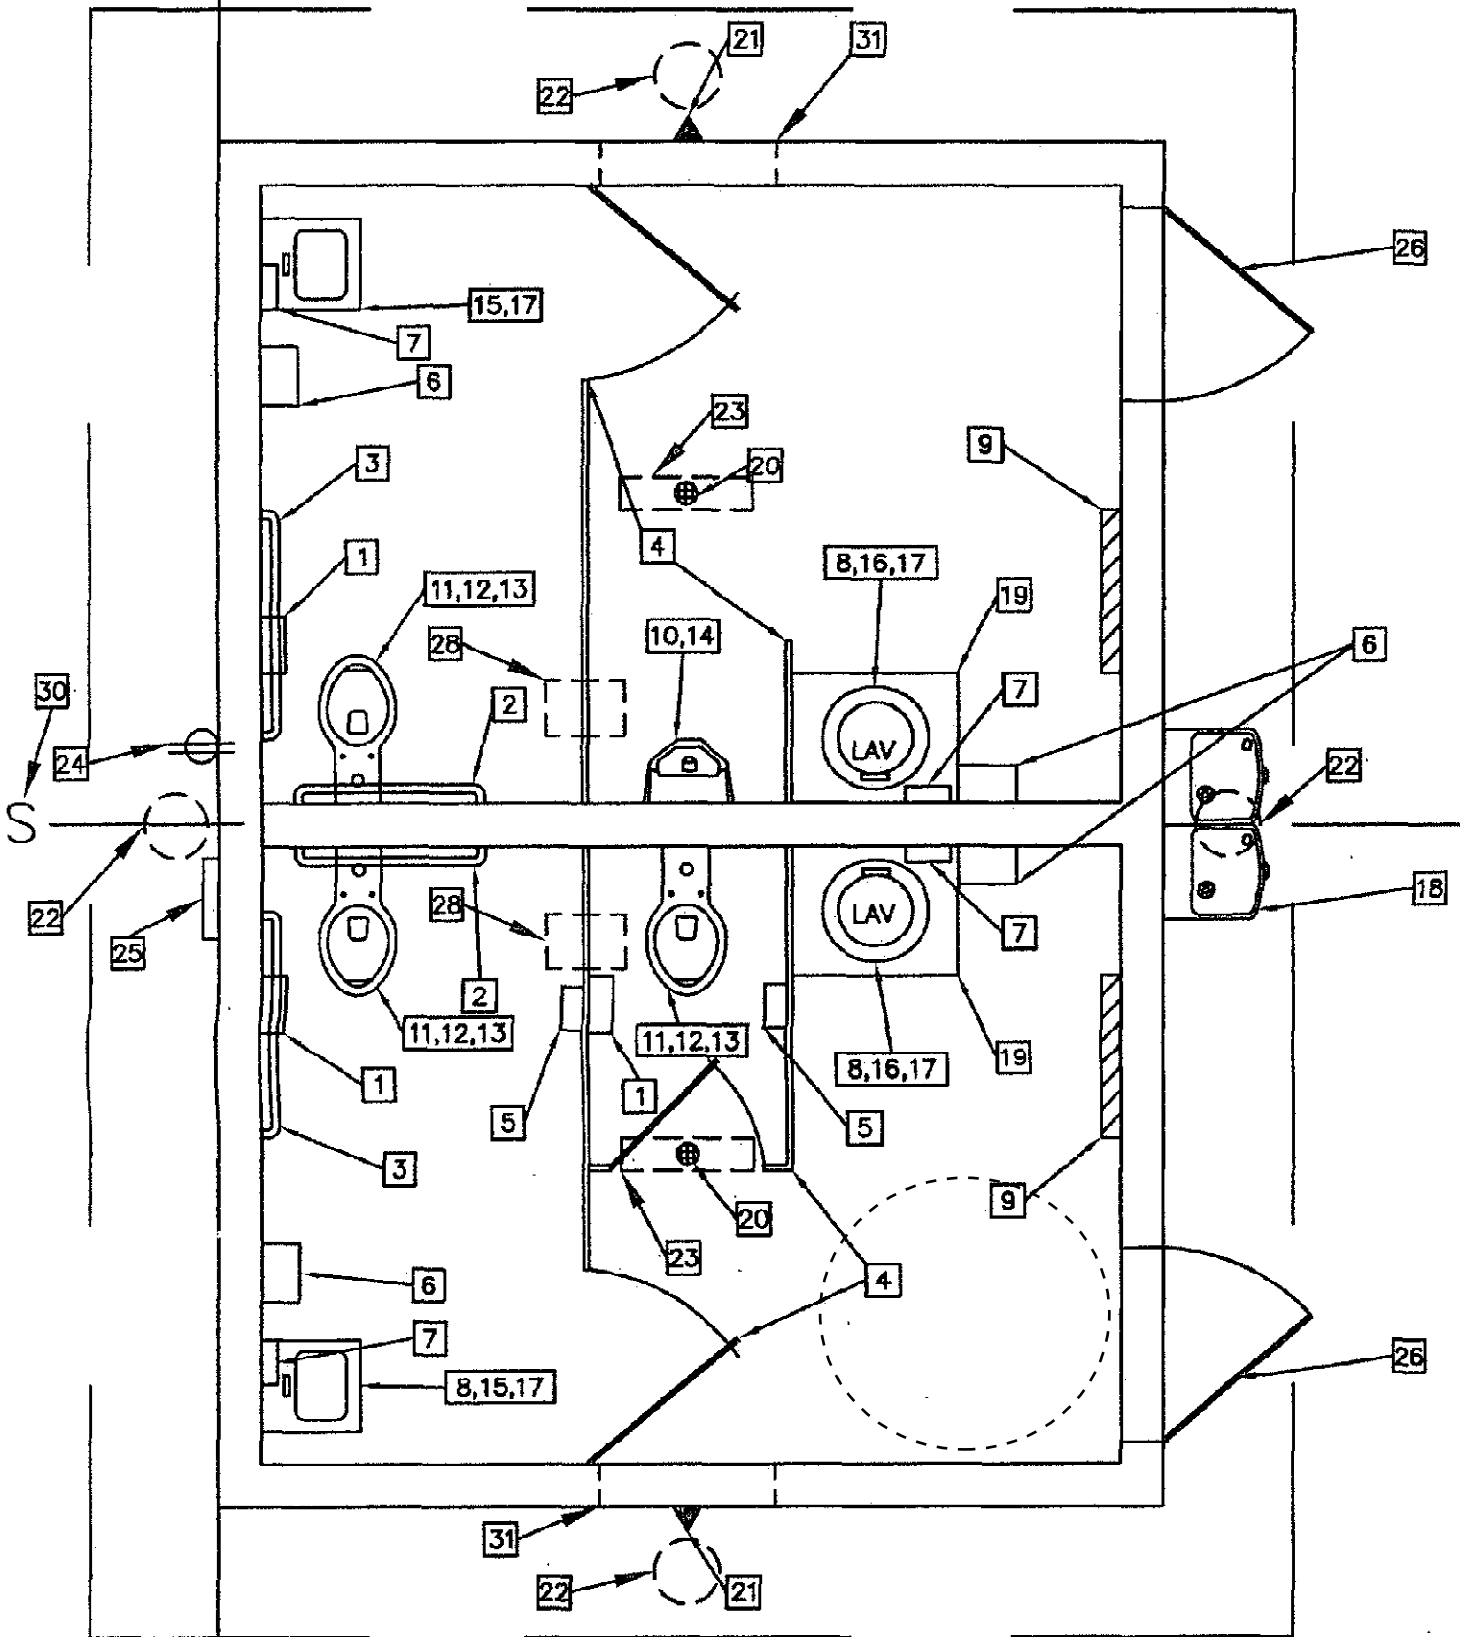

7.4 - BOB MARCELLO BASEBALL COMPLEX – RESTROOMS / CONCESSION / PRESS BOX (2 Story)

Constructed: 1989

STATUS: In Progress; Updates confirmed by Mark Pawlowski (Parks & Recreation Director)


Revised 2024

Existing Non-Compliant Condition:	Recommendations:
Bathroom Facilities are not ADA compliant.	Leave as is and post a sign with directions to an accessible restroom. Alternative option is to remove fixtures and convert to a single occupancy restroom.
2 nd Story Press Box is not accessible.	2 nd Story Press Box is not required to be accessible.
Existing signage is 65” to center.	Center of sign should be 60” above finished floor


ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Signage	\$555	\$740
Remodel bathroom facility as a single occupancy that meets ADA compliance	\$0	\$3,330
ESTIMATED CONSTRUCTION COST	\$555	\$4,070

7.4 - LARGE CONCESSION/PRESS BOX/RESTROOMS

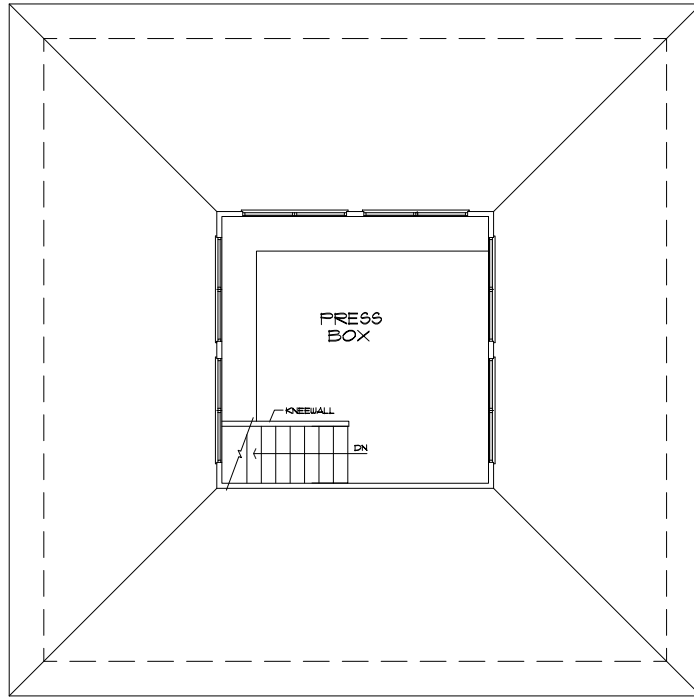


2ND FLOOR PLAN

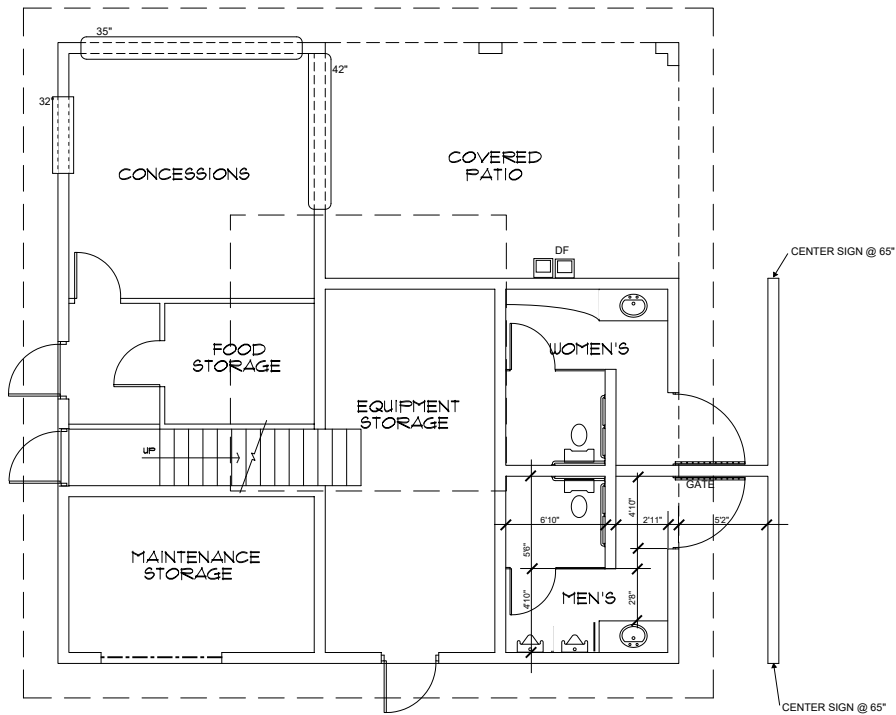


1ST FLOOR PLAN

 SCALE: 1/4"=1'-0"



GRAPHIC SCALE:

 

8 - KATZ SOCCER COMPLEX - RESTROOM / CONCESSIONS


Constructed 1991

STATUS: In Progress

Existing Non-Compliant Condition:	Recommendations:
Existing paved access walkways are greater than 1:12 slopes.	Rebuild east walkway as a ramp with railings and landings.
Restrooms – All lavatories are @ 36” above finished floor.	Lower to 34” above finished floor.
Restrooms – Exposed piping under lavatories.	Restrooms – Secure the pipe wrap under the lavatories.
Concessions – Service counter is 38” above finished floor	Modify to 36” above finished floor as required.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Rebuild east walkway as an ADA ramp	\$74,000	\$92,500
Modify restrooms	\$6,475	\$11,100
Modify service counter	\$2,220	\$11,100
ESTIMATED CONSTRUCTION COST	\$82,695	\$114,700

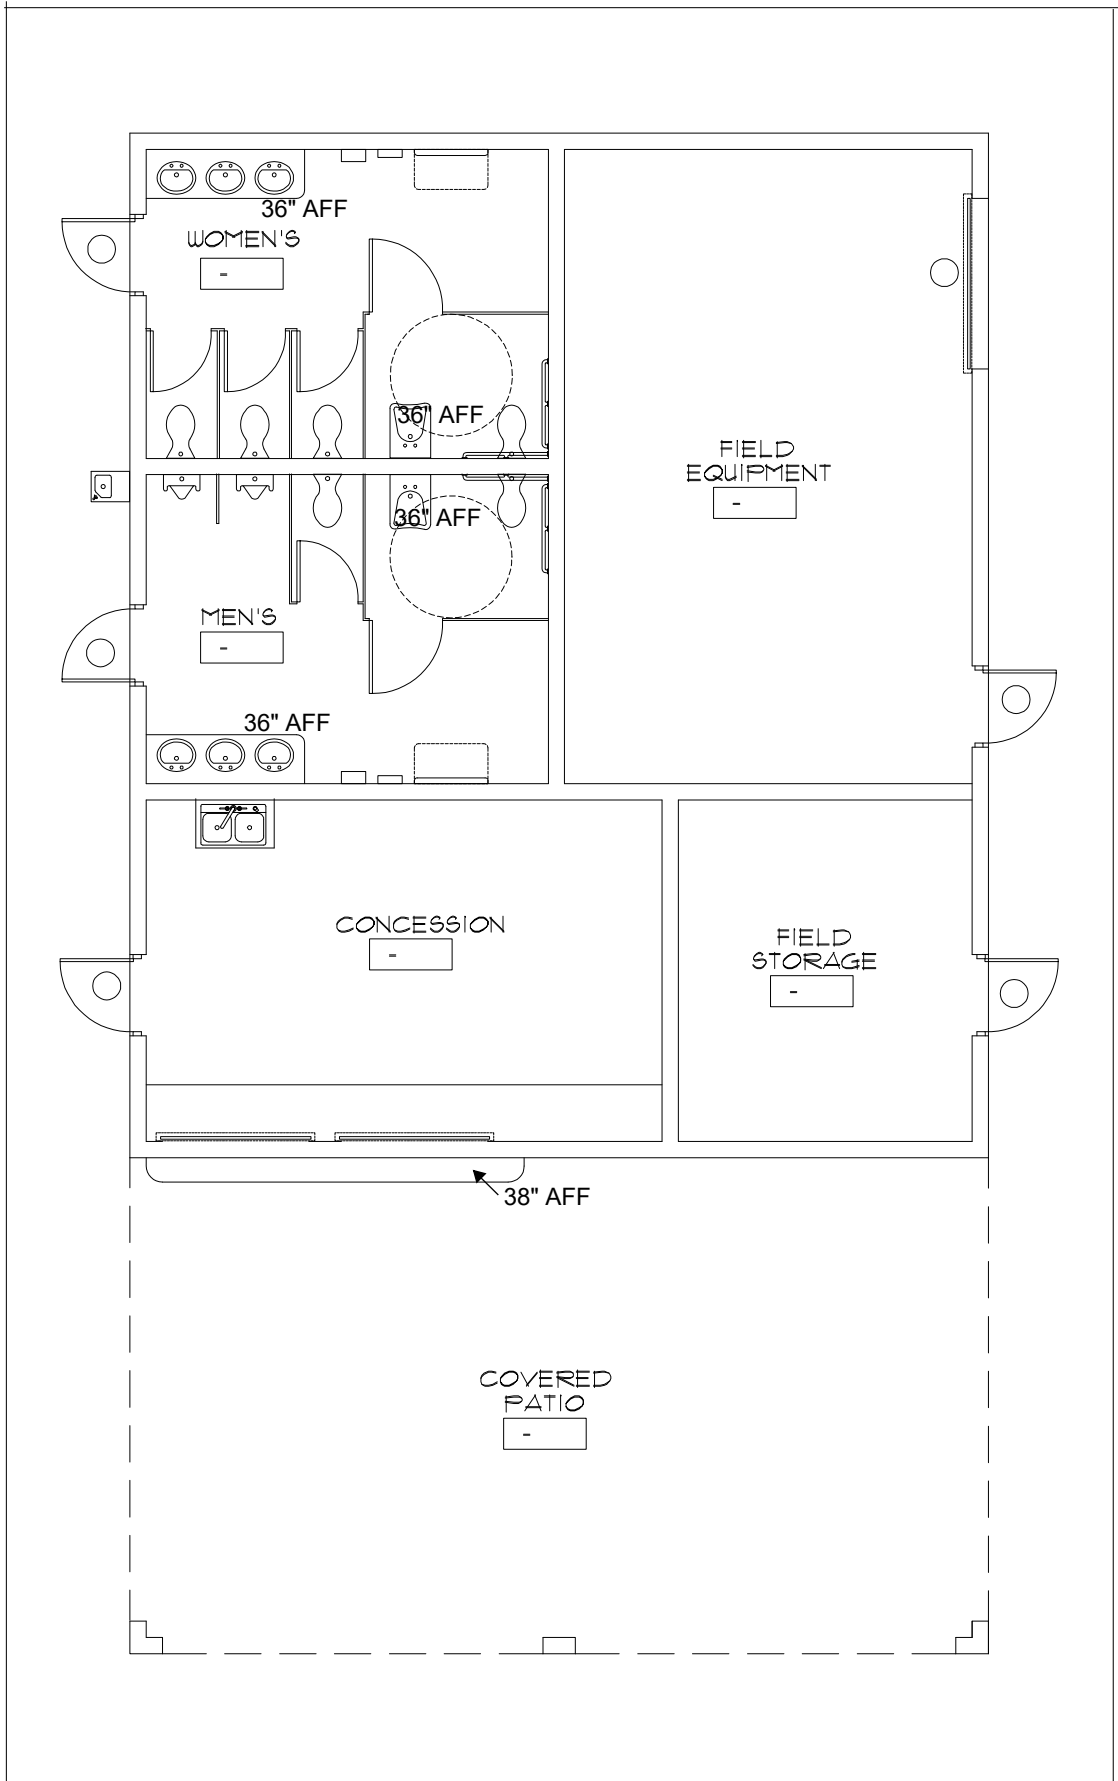

8 - KATZ SOCCER COMPLEX RESTROOM BUILDING



9 - FERRIN PARK - RESTROOM & CONCESSIONS BUILDING

Constructed 2001

STATUS: Compliant; Confirmed by Mark Pawlowski (Parks & Recreation Director)
Revised 2024

All Non-Compliant conditions from the 2017 report have been corrected.

10 - TODD ROBINER PARK RESTROOMS / STORAGE BUILDING


Constructed 2002

STATUS: In Progress; Updates confirmed by Mark Pawlowski (Parks & Recreation Director)
Revised 2024

Existing Non-Compliant Condition:	Recommendations:
Women’s Restroom – Exiting door does not have the required 48” clearance between wall and stall.	Relocate door towards vanity to clear stall.
Verify height at bottom of mirrors not greater than 40” above finished floor.	Mirrors at 48” above finished floor to be lowered to comply.
27” clearance required under vanity top, the existing is 25” at the open area. The lavatory in the stall does comply.	Modify to comply for wheelchair clearance.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Relocate entrance door as required for approach clearance of 48” minimum.	\$16,650	\$20,350
Modify vanity and mirror heights	\$4,625	\$12,210
ESTIMATED CONSTRUCTION COST	\$21,275	\$32,560

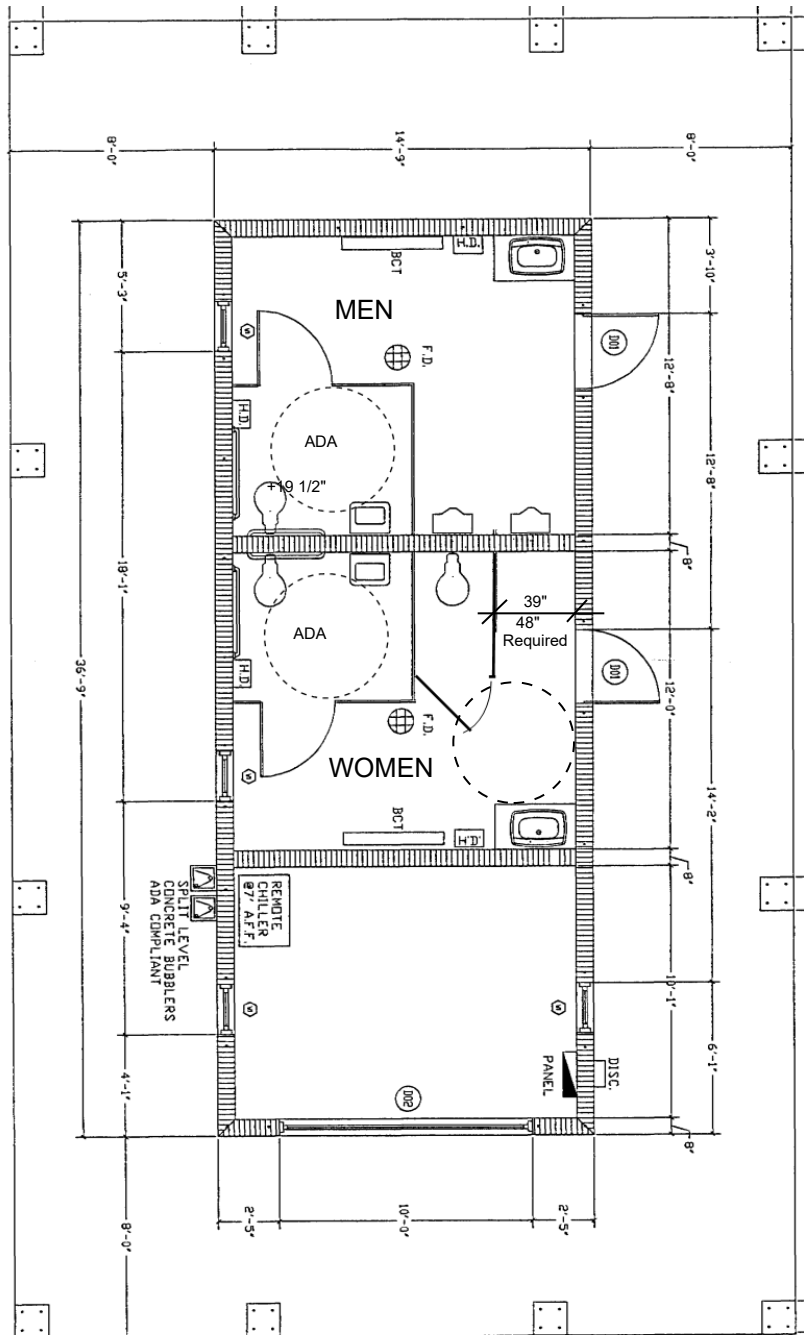

10- TODD ROBINER PARK RESTROOM BLDG.

SCALE:



11 - CAMELLIA PARK RESTROOM / OFFICE BUILDING

Constructed 2001

STATUS: In Progress; Updates confirmed by Mark Pawlowski (Parks & Recreation Director)
Revised 2024

Existing Non-Compliant Condition:	Recommendations:
Women’s & Men’s Restrooms - Not wheelchair accessible.	Convert to a single occupant toilet without toilet partition. Relocate fixtures for proper clearances.
Restroom Signage located approximately 7’-0” AFF.	Signage required to have centerline at 5’-0” maximum. Lower to appropriate height.

NOTE:


1. Per the age and condition of the entire building it may be more feasible to demolish the existing and replace with a new facility that meets the current needs for restrooms, storage and office.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Option 1 – Convert to single occupancy Men and Women restrooms that will comply.	\$33,300	\$49,950
Option 2 – Demolish the existing and rebuild a new building of similar size. Restrooms – 350 sf, Office – 168 sf, Storage – 150 sf, Covered Patio 350 sf Miscellaneous Site Work ESTIMATED CONSTRUCTION COST	\$19,795	\$373,700

NOTE:

1. The values used in Estimated Cost summaries will be for Option 1.

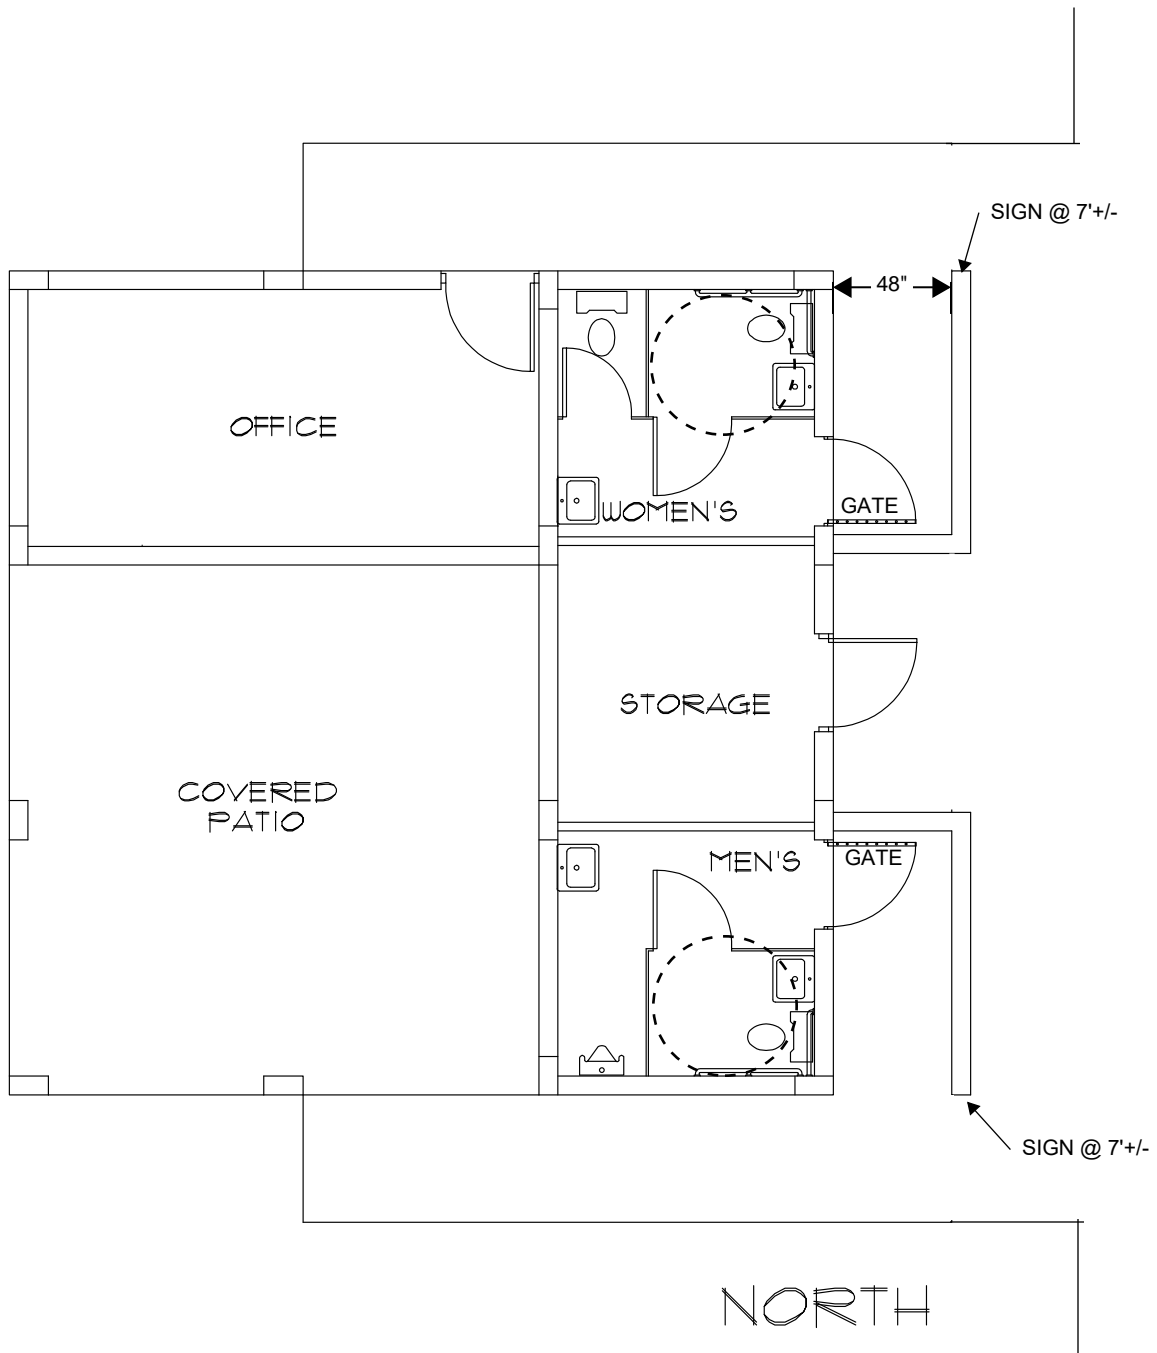


NORTH


FLOOR PLAN



 SCALE: 1/4" = 1'-0"



GRAPHIC SCALE:

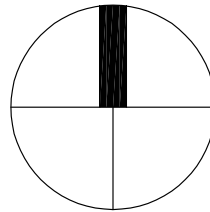

11 - CAMELLIA PARK RESTROOM

12 – LAKE SIDE CHALLENGER PARK RESTROOMS


Constructed 2001

STATUS: In Progress

Existing Non-Compliant Condition:	Recommendations:
Women’s Restroom – Exiting door does not have the required 48” clearance between wall and stall.	Relocate door towards vanity to clear stall.
Verify height at bottom of mirrors not greater than 40” above finished floor.	Mirrors at 48” above finished floor to be lowered to comply.
27” clearance required under vanity top, the existing is 25” at the open area. The lavatory in the stall does comply.	Modify to comply for wheelchair clearance.
Exposed pipes under vanity.	Provide and secure pipe wrap at exposed pipes.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Relocate entrance door as requires for approach clearance of 48” minimum.	\$16,650	\$20,350
Modify heights of vanities and mirrors.	\$4,625	\$12,210
ESTIMATED CONSTRUCTION COST	\$21,275	\$32,560

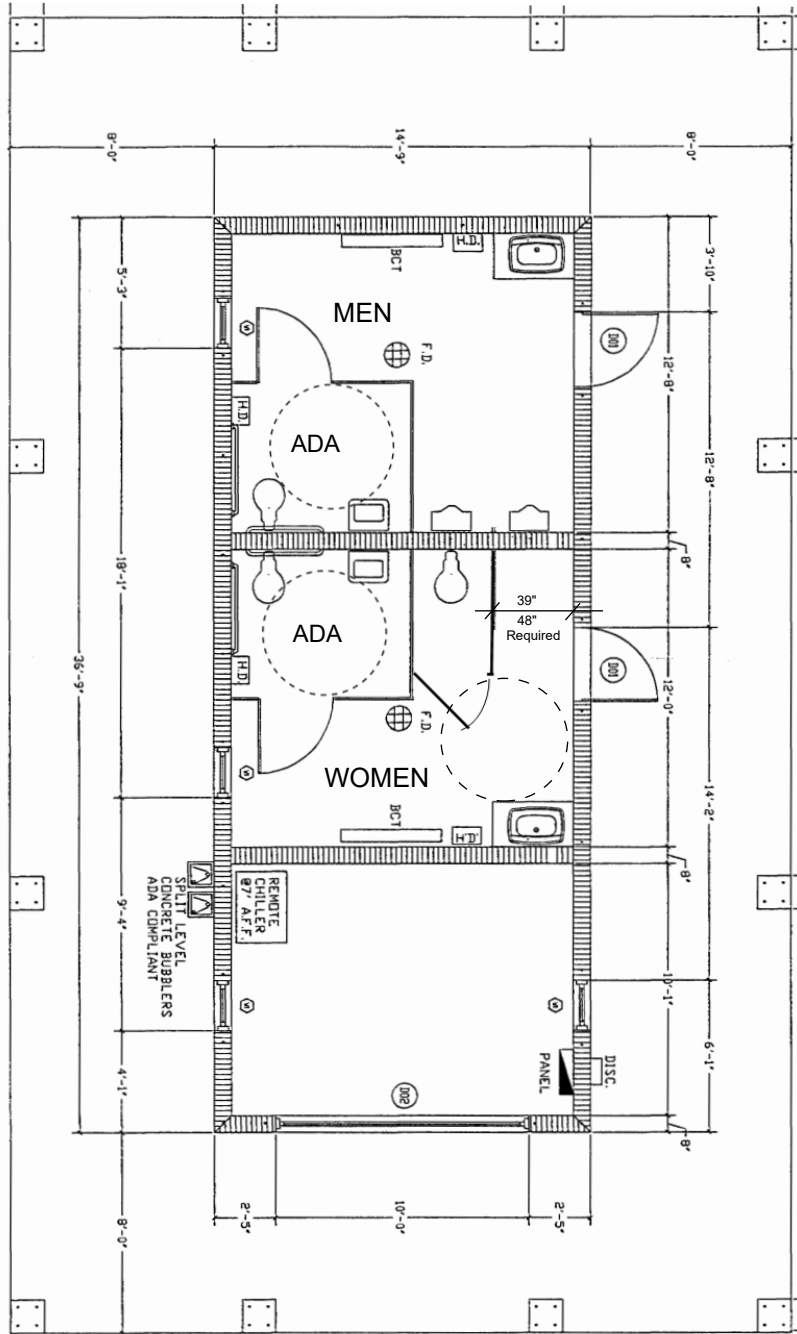

12 - CHALLENGER PARK RESTROOM BLDG.

SCALE:



13 – LINDSAY EWING PARK - RESTROOM BUILDING


Constructed 1998

STATUS: In Progress

Existing Non-Compliant Condition:	Recommendations:
Doors swings inward, not allowing for the wheelchair clearance.	Swing doors outward.
Restrooms – Exposed piping under lavatories at Men’s room.	Restrooms – Secure the pipe wrap under the lavatories.
No doors on women’s stalls. No urinal partitions.	Add doors and partitions.
ADA Stalls require 60”x59” floor space clearance around water closet. The lavatory encroaches on space. Minimum 7’-1” width for WC & Lav.	The existing 8” CMU partition walls would require replacing with narrower partitions to obtain the minimal 7’-1” width required. Relocate women’s wc, and relocate or remove (1) urinals to gain more room for ADA. Both lavatories in the Women’s & Men’s renovated ADA stalls will require moving to have the 5’-0” clearance around the water closets.
No mirrors in the restrooms.	Add mirrors above all lavatories.
No paper towel dispensers in the ADA stalls.	Install dispensers per ADA.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Install and secure pipe wrap as needed.	\$555	\$740
Swing entrance doors outward.	\$3,330	\$3,700
Modify restrooms to be ADA compliant.	\$70,300	\$85,100
ESTIMATED CONSTRUCTION COST	\$74,185	\$89,540

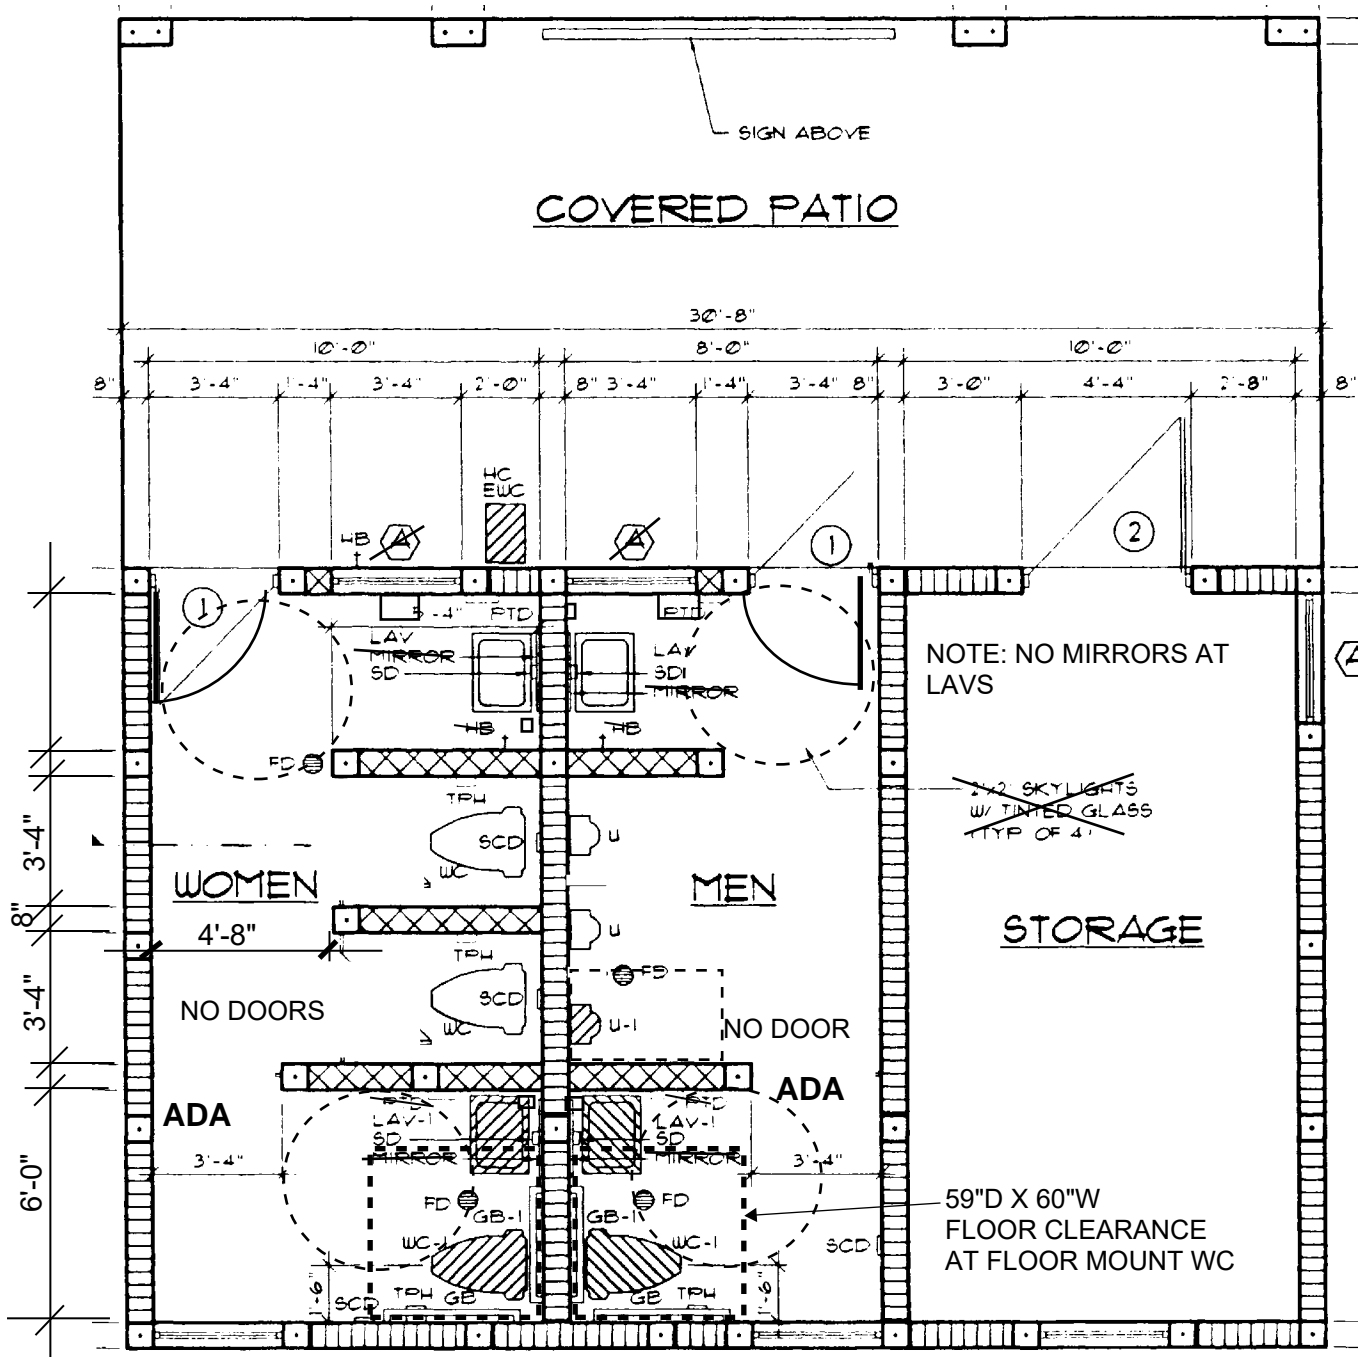

NOTE: NO TOWEL DISPENSERS
OR MIRRORS IN ADA STALLS

13 - EWING PARK RESTROOM BLDG.

SCALE:



14 – DAVID B. FARBER TRAINING CENTER BUILDING


Constructed 2009

STATUS: In Progress

Existing Non-Compliant Condition:	Recommendations:
The restrooms are side latch approach, pull-side with a closer, which requires 54” clear space in lieu of the provided 48”.	Install automatic door operator at each door.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Automatic Door Operators (2)	\$13,875	\$18,500
ESTIMATED CONSTRUCTION COST	\$13,875	\$18,500

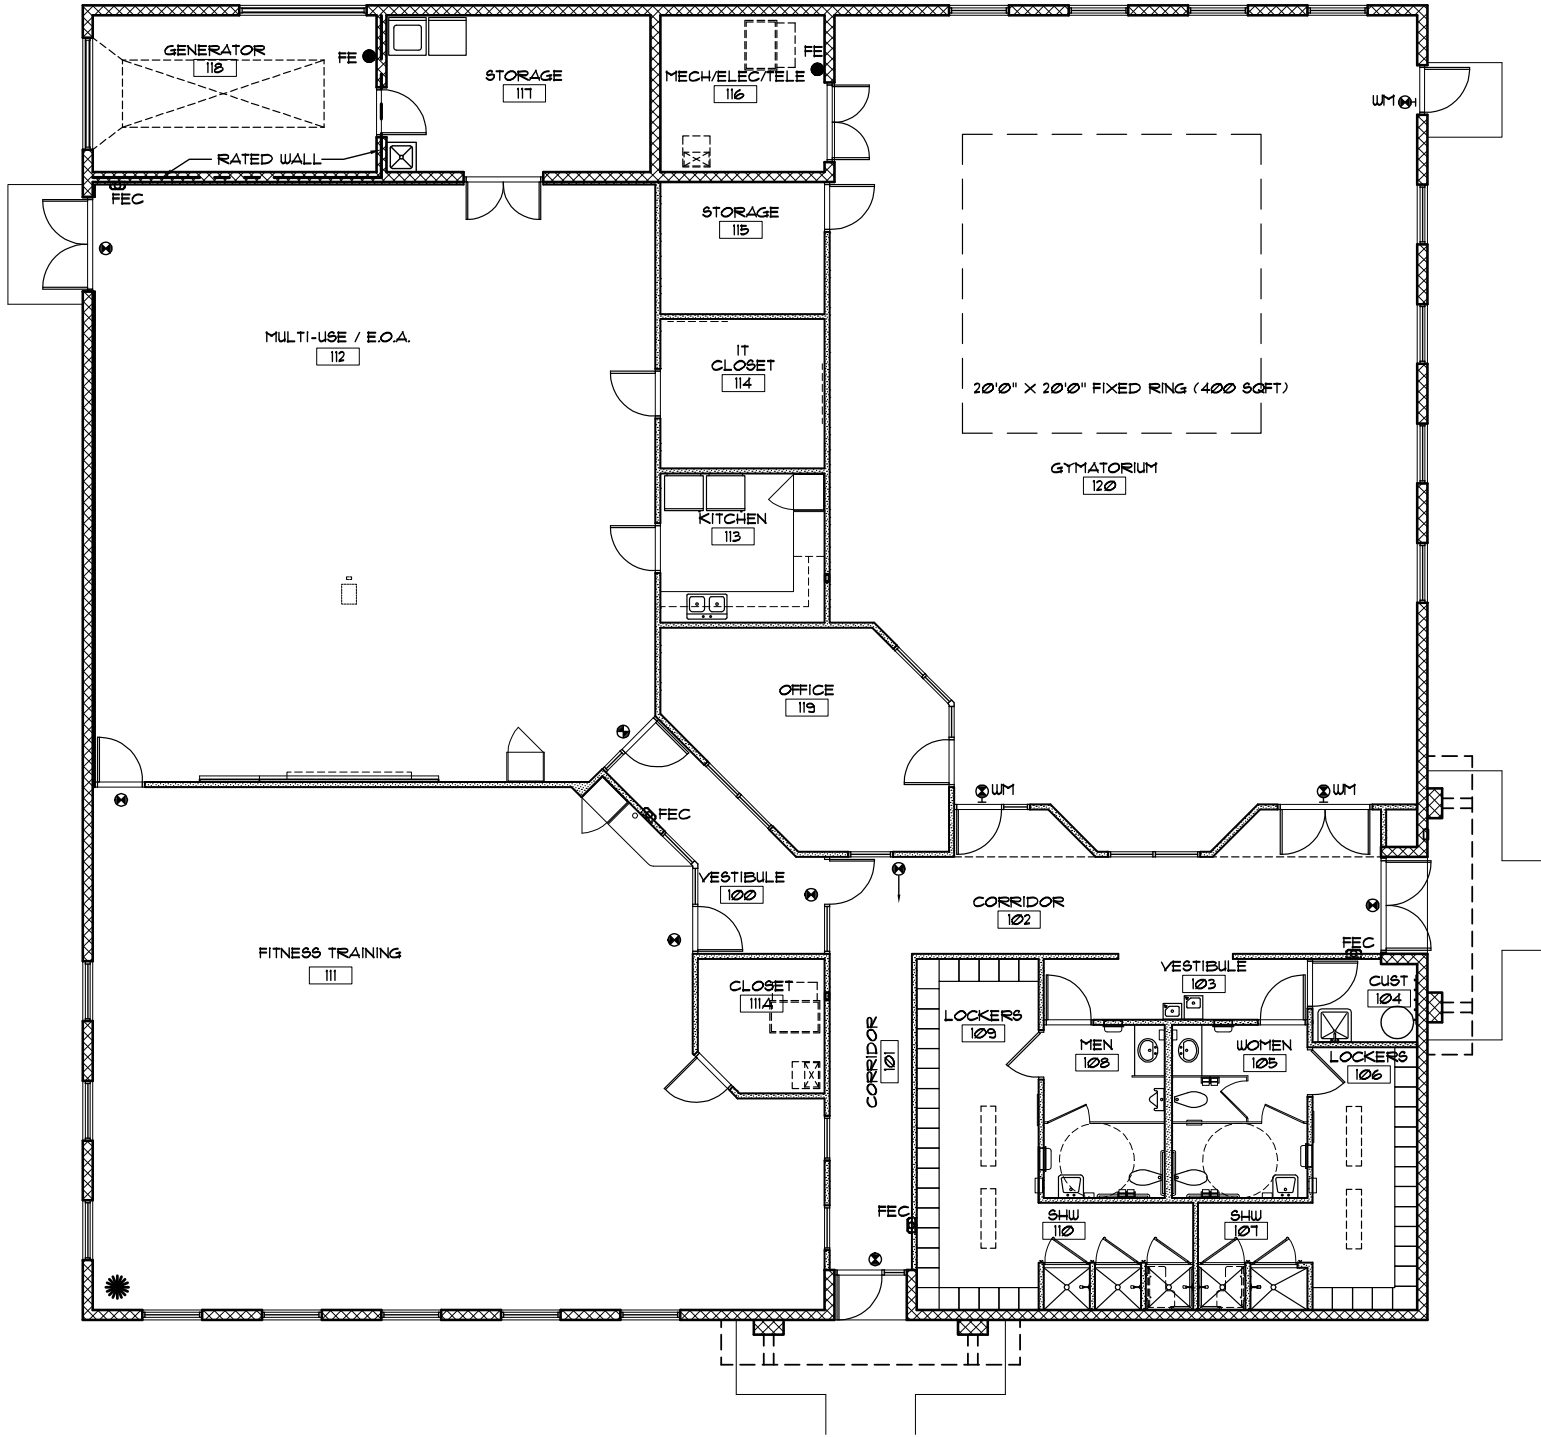

14 - DAVID B. FARBER TRAINING CENTER



15.1 – COMMONS PARK – SPORTING CENTER

Constructed 2009

STATUS: Compliant; Certified by DHGA (Architect) in 2011

No non-compliant conditions were noted in the original 2017 report.

15.2 – COMMONS PARK – MAINTENANCE BUILDING A

Constructed 2011

STATUS: Compliant; Certified by DHGA (Architect) in 2011

No non-compliant conditions were noted in the original 2017 report.

15.3 – COMMONS PARK – RESTROOM SOUTH LAWN (ADJACENT TO AMPHITHEATER)

Constructed 2009

STATUS: Compliant; Certified by DHGA (Architect) in 2011

No non-compliant conditions were noted in the original 2017 report.

15.4 – COMMONS PARK – DRIVING RANGE RESTROOM BUILDING

Constructed 2011

STATUS: Compliant; Certified by DHGA (Architect) in 2011

No non-compliant conditions were noted in the original 2017 report.

15.5 – COMMONS PARK – GREAT LAWN RESTROOMS
Constructed 2017

STATUS: Compliant; Certified by REG (Architect) in 2016

No non-compliant conditions were noted in the original 2017 report.

15.6 – COMMONS PARK – AMPHITHEATER
Constructed 2017

STATUS: Compliant; Certified by REG (Architect) in 2016

No non-compliant conditions were noted in the original 2017 report.

16 – CRESTWOOD NORTH PARK RESTROOM BUILDING
Constructed 2024

STATUS: Compliant; Certified by DHGA (Architect) in 2023

The restroom building was constructed to current ADA standards, as of 2023.

17 – CYPRESS HALL

Constructed 2002


STATUS: In Progress

Revised 2024


Existing Non-Compliant Condition:	Recommendations:
Meeting Room B – The alcove counter and sink are 36” above finished floor.	Lower the sink and countertop to 34”
Restrooms - ADA Lavatories encroach approx. 10" into ADA Toilet clear floor space width.	ADA Stall would need to be made wider to allow sink to shift 10" away from toilet. This would require all plumbing fixtures along wall to be relocated, not just this sink.
Restrooms - Grab bars installed 37" to top of gripping surface. Needs to be 36" max.	Lower grab bars by 1". Ensure that accessories located below grab bar are at least 1-1/2" minimum clear of the bottom of the grab bar, this may require lowering of accessories.
Restrooms - Toilet paper dispensers are installed more than 9" from front of toilet to center of accessory. Needs to be 7" - 9" max.	Shift toilet paper dispensers closer to toilets so that they are between 7” and 9” from front of toilet to center of accessory.
Restrooms - Signage located on hinge side of doors. Needs to be on latch side of doors.	Move signage to latch side of doors.
Women’s Restroom - ADA Lavatory is installed 14" from center of fixture to side wall/partition. It needs to be 15" min.	Shift sink by 1" away from partition.

ESTIMATED COSTS:

Description of Work	Estimated Cost w/out AE Fees	
	Low	High
Adjust alcove sink and countertop	\$9,250	\$14,800
Remodel ADA stall move and all plumbing fixtures	\$45,000	\$60,000
Adjust grab bars	\$925	\$1,203
Adjust toilet paper dispensers	\$555	\$740
Relocate signage	\$278	\$555
Move sink	\$4,625	\$12,210
ESTIMATED CONSTRUCTION COST	\$60,633	\$89,508

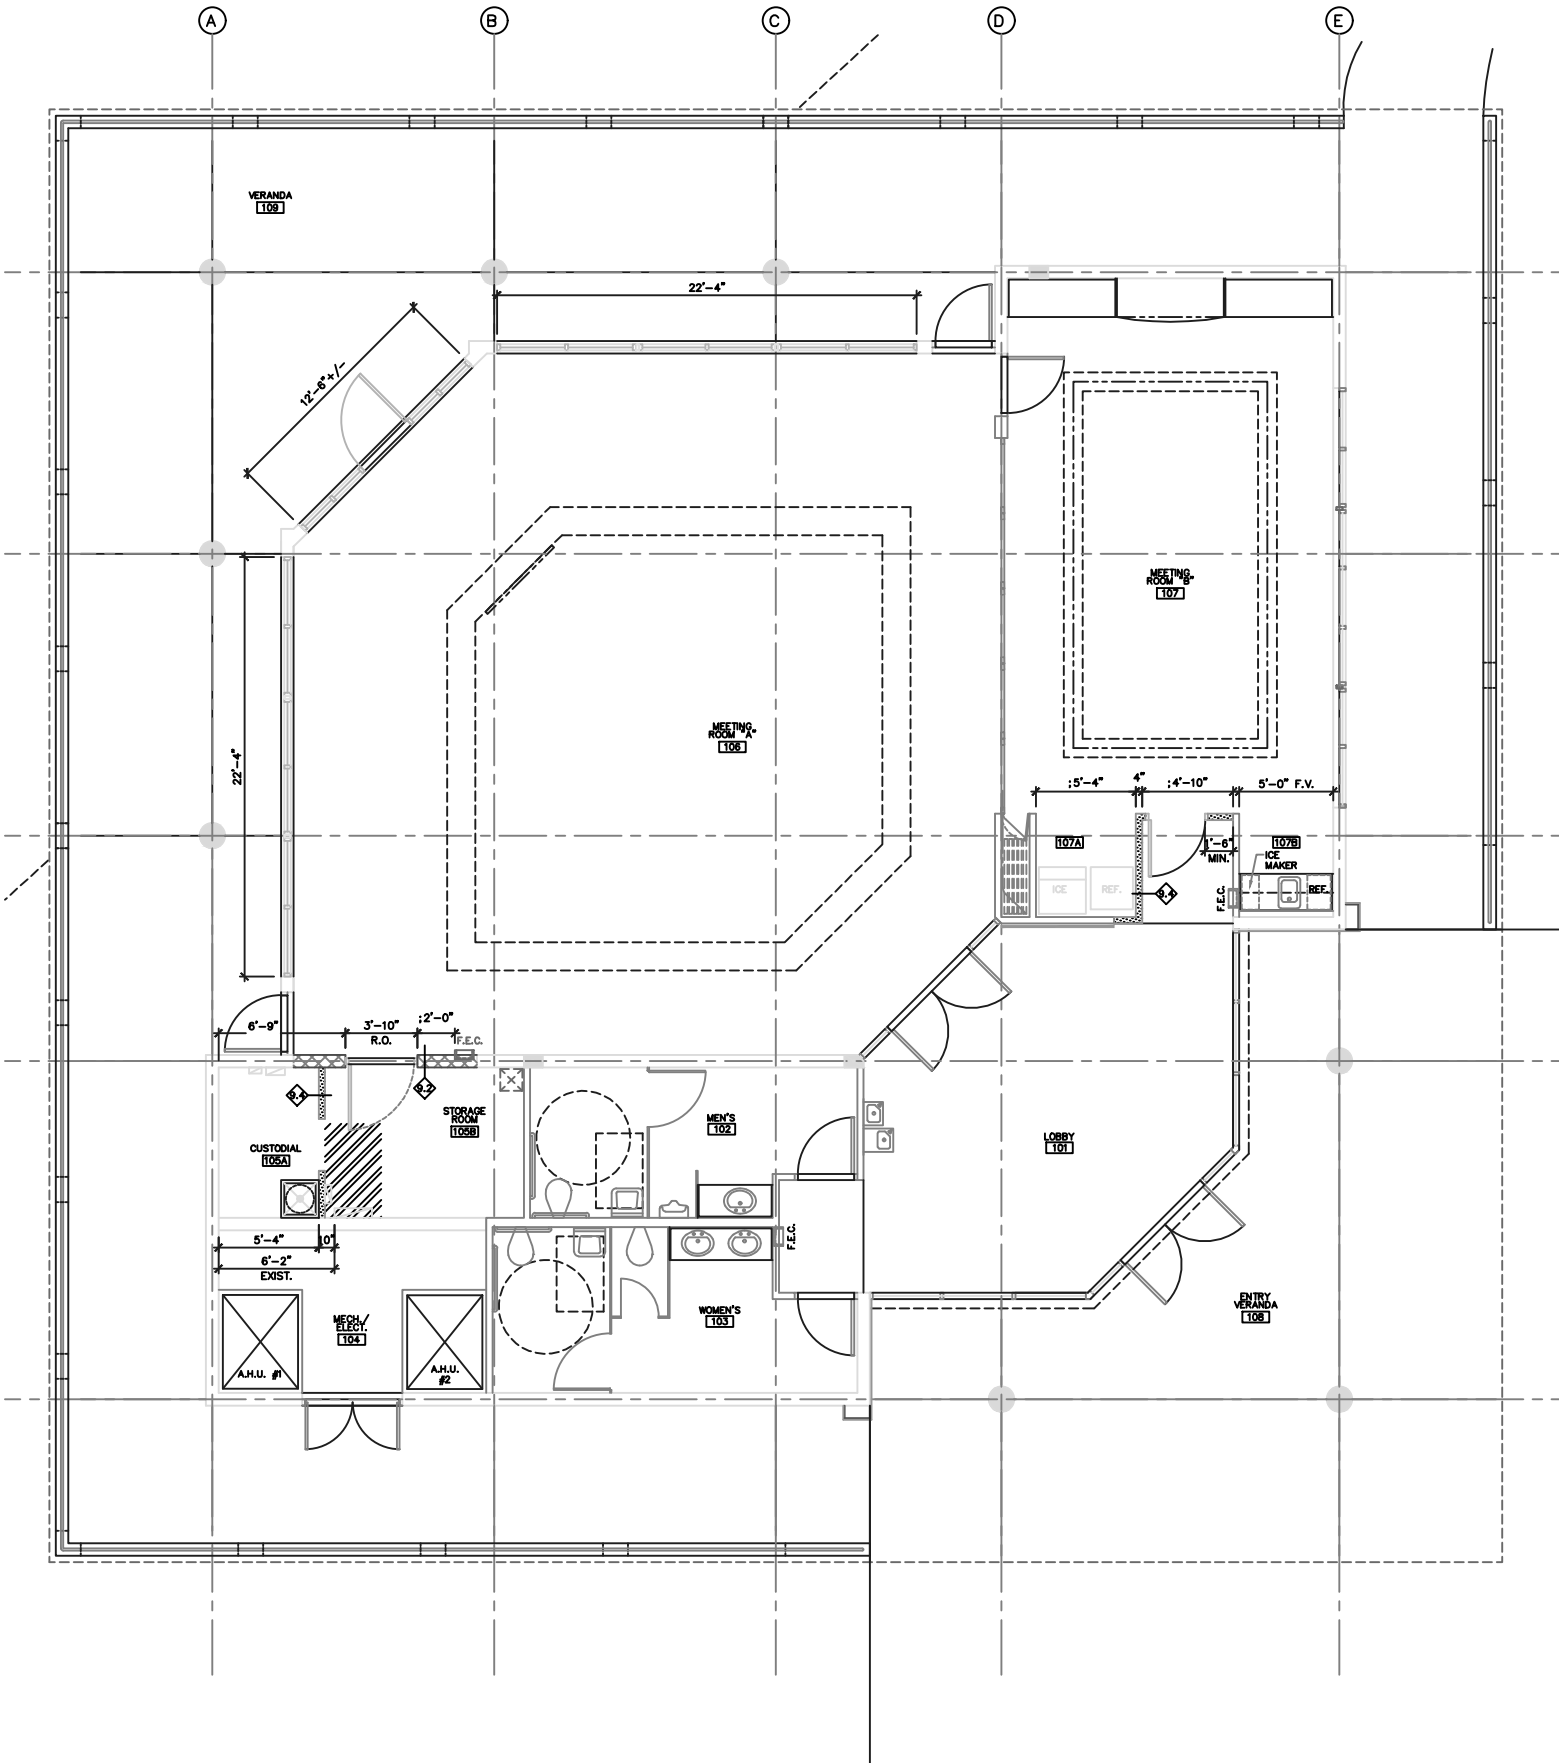

THE VILLAGE OF ROYAL PALM BEACH, FLORIDA

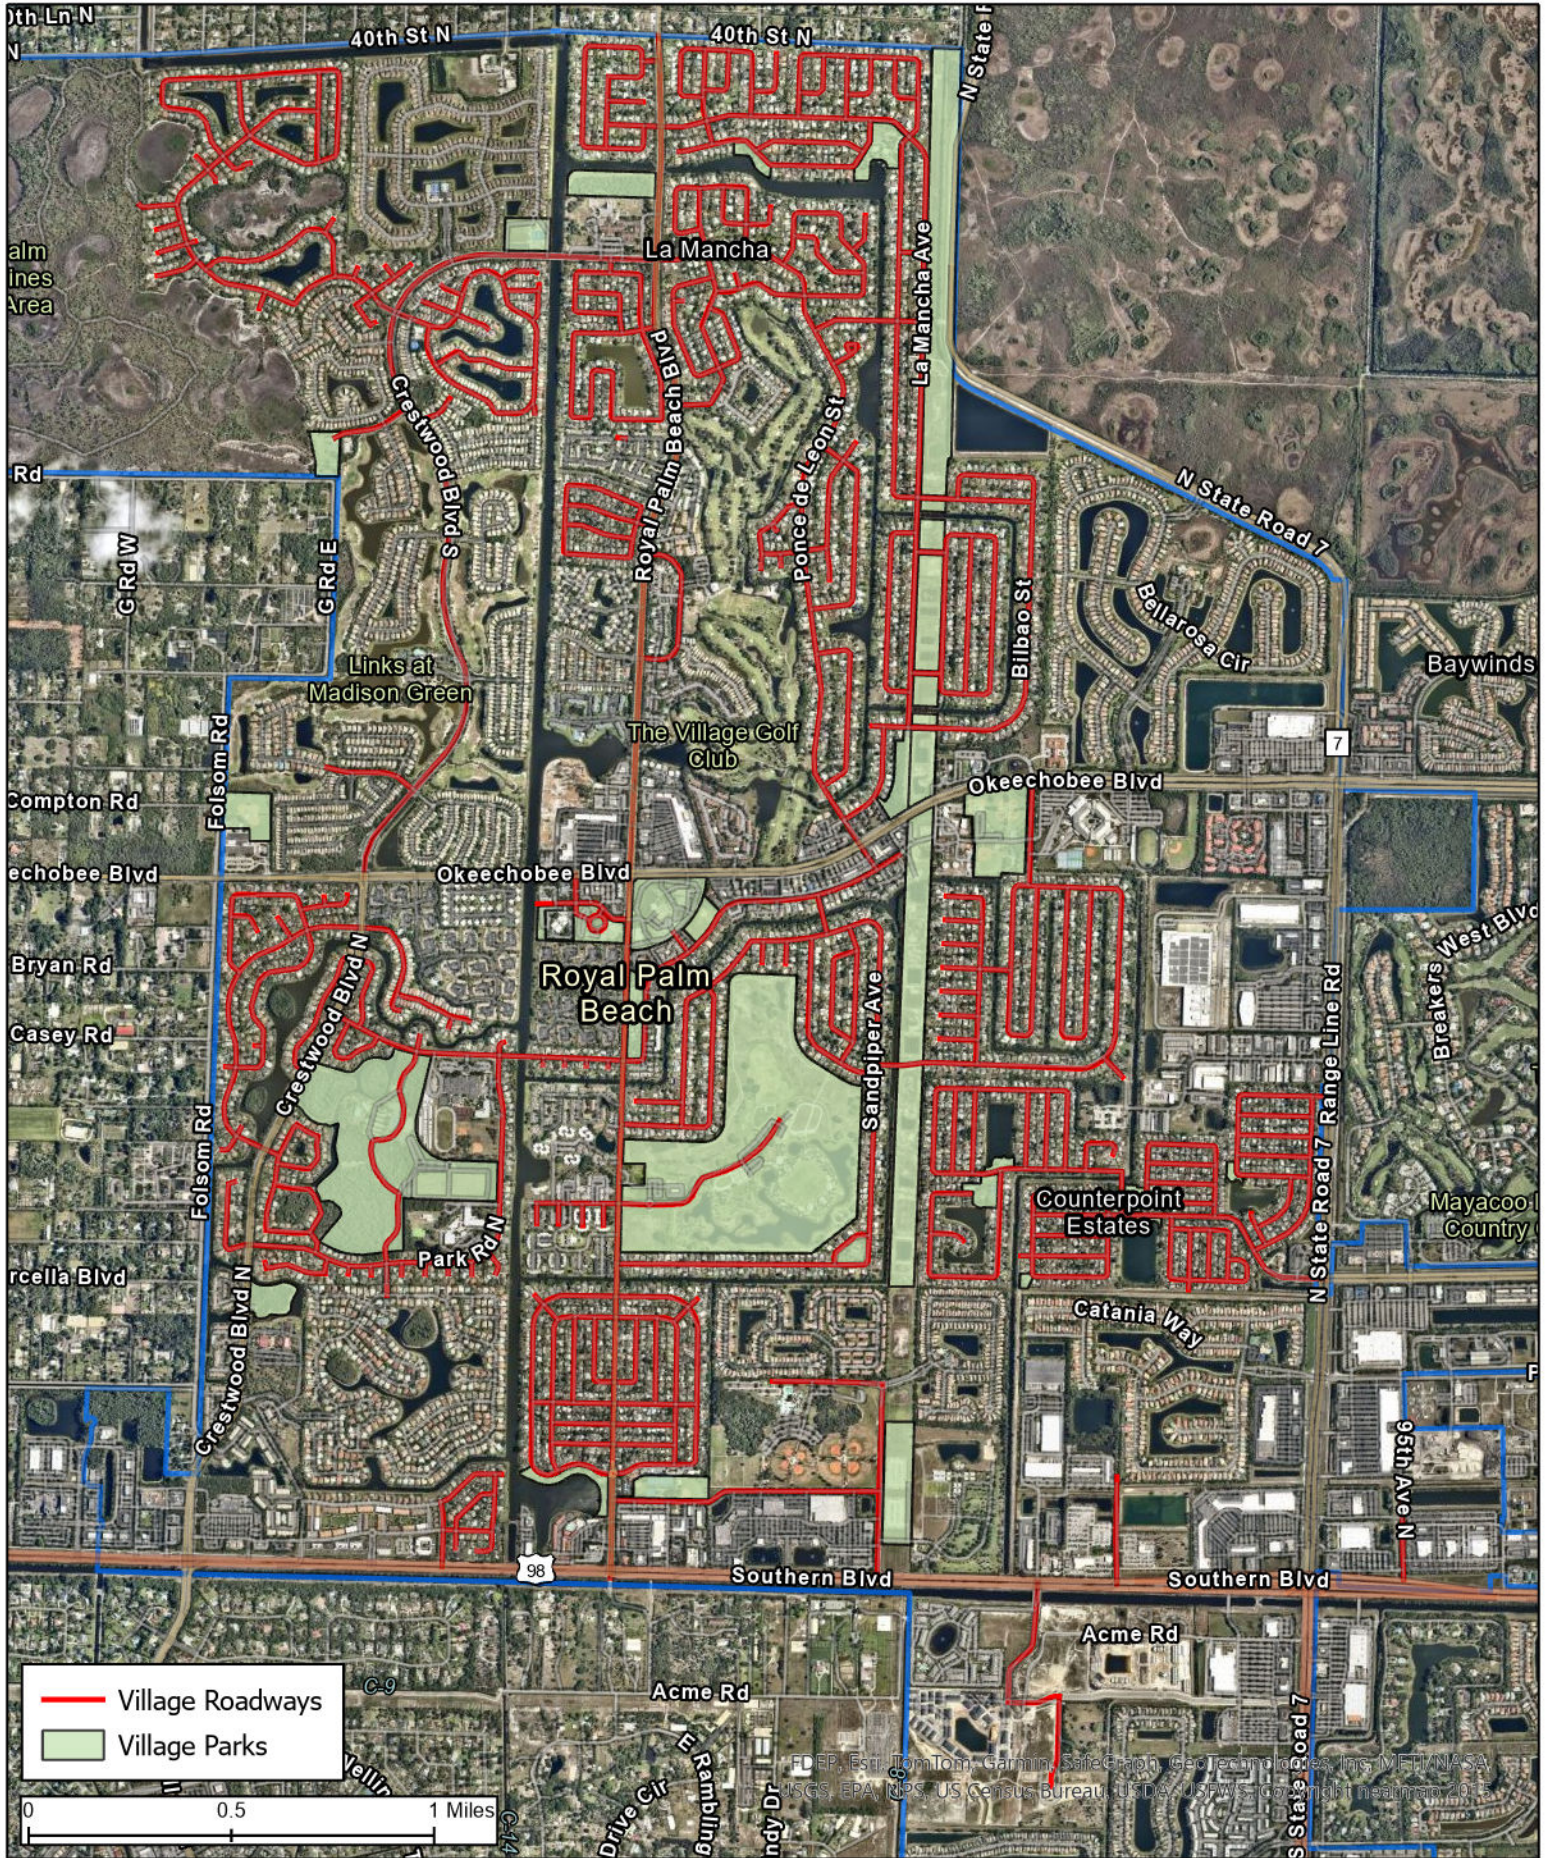

ADA RESPONSIBILITY - RIGHT-OF-WAY AND PARKS



ADA TRANSITION PLAN - RIGHT OF WAY

Estimated Completion Date	Intersection		Object ID	Estimated Cost
	Crossroad 2	Crossroad 1		
2025	Chestnut Cir	Mandeville Ln	3455	\$3,000.00
	Civic Center Way	Civic Center Way	3351	\$3,000.00
	Civic Center Way	Civic Center Way	3352	\$3,000.00
	Cocoplum Cir	Cocoplum Ln	3362	\$3,000.00
	Cocoplum Ln	Chestnut Cir	3287	\$3,000.00
	Cocoplum Ln	Chestnut Cir	3359	\$3,000.00
	Cocoplum Ln	Cocoplum Cir	3334	\$3,000.00
	Cocoplum Ln	Cocoplum Ln	3536	\$3,000.00
	Infanta Ave	Infanta Ct	3533	\$4,500.00
	Las Palmas St	Bilbao St	3299	\$1,500.00
	Monterey Way	Twin Lakes Way	3389	\$3,000.00
	Orchid Dr	Hibiscus Dr	3391	\$3,000.00
	Park Rd N	Cypress Trails Elem Dr	3346	\$3,000.00
	Park Rd N	Locust Ln	3375	\$3,000.00
	Park Rd N	Mandeville Ln	3244	\$3,000.00
	Park Rd N	Park Rd S	3276	\$3,000.00
	Park Rd N	Park Rd S	3437	\$3,000.00
	Park Rd N	Park Rd S	3497	\$3,000.00
	Park Rd N	Park Rd S	3498	\$3,000.00
	Park Rd N	Park Rd S	3499	\$3,000.00
	Park Rd N	Park Rd S	3535	\$3,000.00
	Park Rd N	Sweet Bay Ln	3436	\$3,000.00
	Park Rd N	Sycamore Dr	3522	\$3,000.00
	Royal Palm Beach Blvd	Balsam Dr	3329	\$4,500.00
	Royal Palm Beach Blvd	Camellia Dr	3454	\$3,000.00
	Royal Palm Beach Blvd	Camellia Dr	3526	\$3,000.00
	Royal Palm Beach Blvd	Civic Center Way	3379	\$17,000.00
	Royal Palm Beach Blvd	Dahlia Dr	3515	\$3,000.00
	Royal Palm Beach Blvd	Gardenia Dr	3369	\$3,000.00
	Royal Palm Beach Blvd	Lilac Dr	3383	\$3,000.00
	Royal Palm Beach Blvd	Oleander Dr	3505	\$3,000.00
	Saratoga Blvd W	Emerald Ct	3302	\$3,000.00
	Saratoga Blvd W	Habitat Ct	3273	\$3,000.00
	Saratoga Blvd W	Natures Way	3395	\$3,000.00
	Saratoga Blvd W	Rainforest Ct	3400	\$3,000.00
	Saratoga Blvd W	Twin Lakes Way	3406	\$3,000.00
	Sparrow Dr	Cambridge Ln	3286	\$3,000.00
	Sparrow Dr	Goldfinch Ln	3370	\$3,000.00
	Sparrow Dr	Morgate Cir	3308	\$3,000.00
	Sparrow Dr	Morgate Cir	3490	\$3,000.00
	Sunflower Cir	Sunflower Cir	3291	\$3,000.00
	Venetian Ln	Monterey Way	3301	\$3,000.00
	Venetian Ln	Monterey Way	3446	\$3,000.00
	Venetian Ln	Saratoga Blvd W	3304	\$3,000.00
2025 Total				\$147,500.00
2028	Country Club Dr	Bella Vita Dr	3415	\$4,500.00

		Intersection		
Estimated Completion Date	Crossroad 2	Crossroad 1	Object ID	Estimated Cost
2028	Country Club Dr	Country Club Way	3465	\$3,000.00
	Country Club Dr	Fairway Ln	3242	\$3,000.00
	Country Club Dr	Palm Beach Trace Dr	3243	\$3,000.00
	Country Club Dr	Prestige Dr	3365	\$3,000.00
	Lamstein Ln	Cape Ivy Pt	3271	\$3,000.00
	Pine Rd	Misty Oaks Cir	3500	\$3,000.00
	Rivera Ave	Salzedo St	3265	\$500.00
	Rivera Ave	Salzedo St	3525	\$4,500.00
	Seminole Lakes Dr	Lamstein Ln	3270	\$3,000.00
	Westside Way	Pippin Ln	3348	\$1,500.00
2028 Total				\$32,000.00
2031	Meadow Woode Dr	Brook Woode Ave	3431	\$3,000.00
	Mill Pond Ln	Brook Woode Ct	3461	\$3,000.00
	Mill Pond Ln	Meadow Woode Dr	3324	\$3,000.00
	Seminole Palms Dr	Royal Palm Beach Blvd	3501	\$3,000.00
	Seminole Palms Dr	Royal Plaza Rd	3502	\$3,000.00
	Waldorf Dr	Briar Oak Dr	3274	\$3,000.00
	Waldorf Dr	Grand Oaks Blvd	3275	\$3,000.00
	Waterview Way	Meadow Woode Dr	3422	\$1,500.00
2031 Total				\$22,500.00
Grand Total				\$202,000.00


CURB RAMP REPORT



ID 3243		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Palm Beach Trace Dr		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Country Club Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP


CURB RAMP REPORT

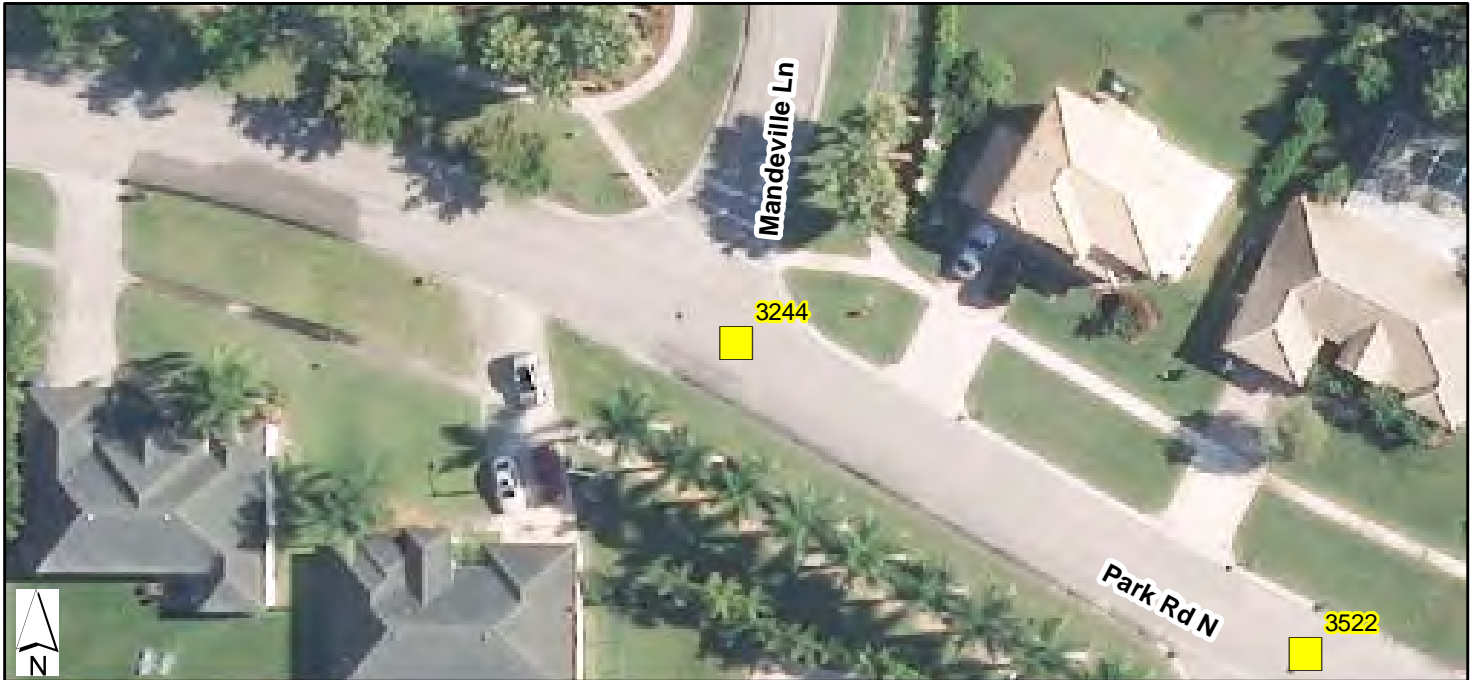

ID 3244		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Mandeville Ln		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Park Rd N		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT

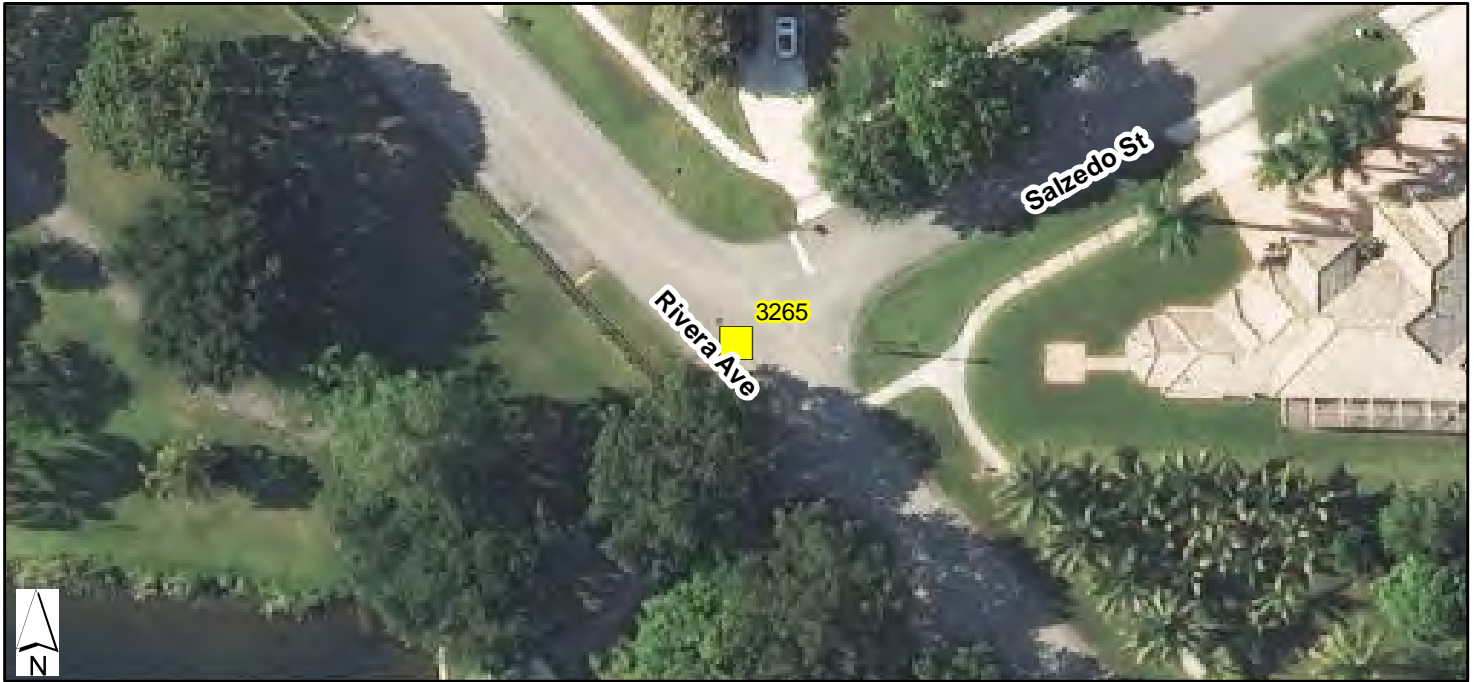

ID 3265		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Salzedo St		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Rivera Ave		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$500.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP



CURB RAMP REPORT



ID 3270		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Lamstein Ln		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Seminole Lakes Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3271		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Cape Ivy Pt		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Lamstein Ln		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3273		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Habitat Ct		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Saratoga Blvd W		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3276		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Park Rd S		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Park Rd N		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP

CURB RAMP REPORT



ID 3286		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Cambridge Ln		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Sparrow Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP

CURB RAMP REPORT



ID 3287		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Chestnut Cir		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Cocoplum Ln		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.

CURB_RAMP



CURB RAMP REPORT



ID 3288		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Hemingway Ct		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Queens Ln		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3291		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Sunflower Cir		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Sunflower Cir		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP

CURB RAMP REPORT



ID 3299		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Bilbao St		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Las Palmas St		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Deadend walkway needs to be extended to roadway Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$1,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3301		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Monterey Way		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Venetian Ln		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP


CURB RAMP REPORT



ID 3302		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Emerald Ct		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Saratoga Blvd W		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT

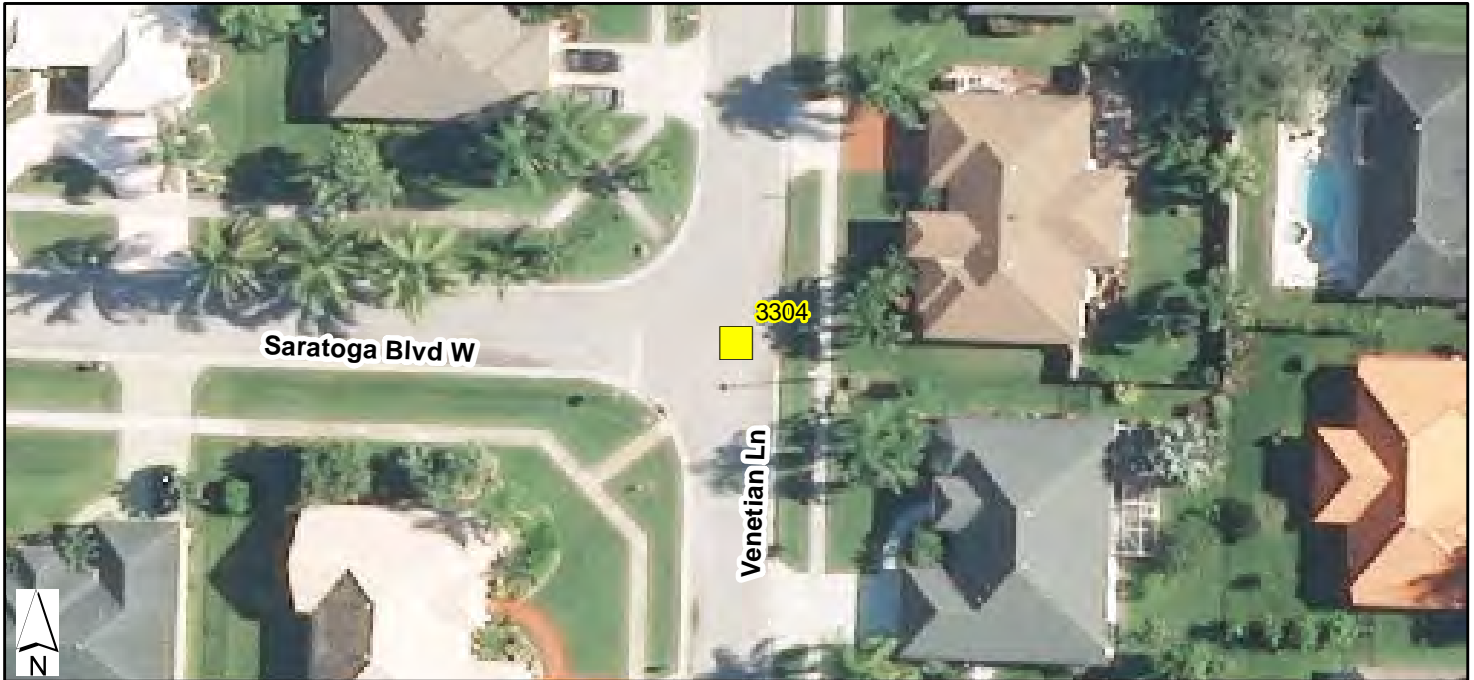

ID 3304		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Saratoga Blvd W		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Venetian Ln		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP


CURB RAMP REPORT



ID 3308		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Morgate Cir		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Sparrow Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP


CURB RAMP REPORT

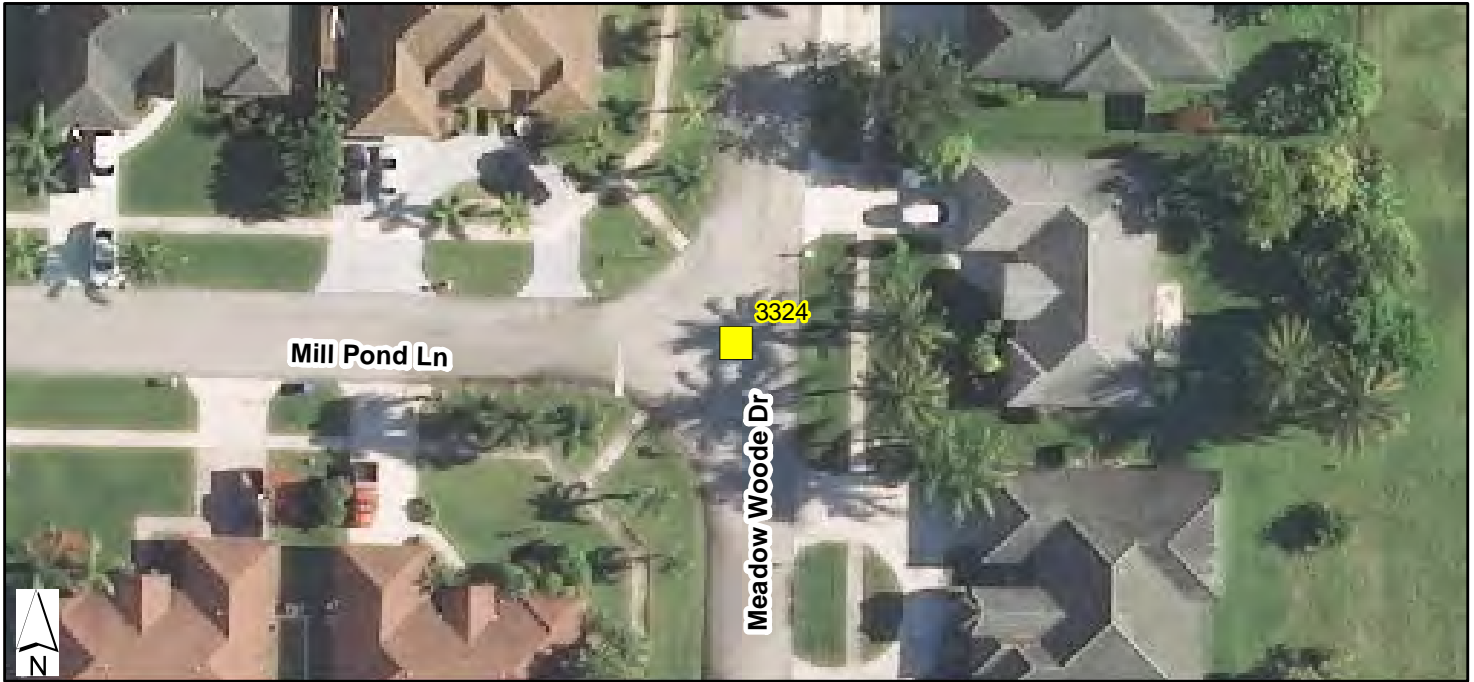

ID 3324		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Meadow Woode Dr		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Mill Pond Ln		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP


CURB RAMP REPORT

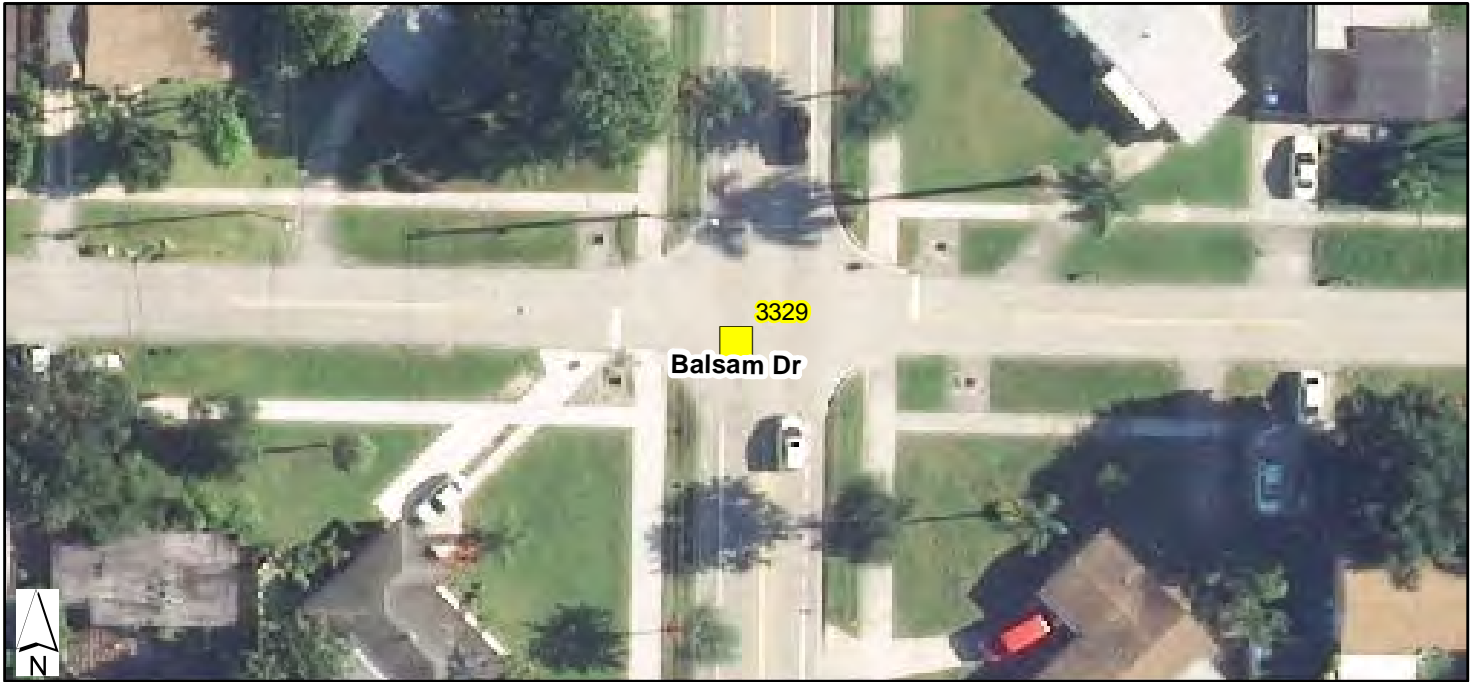

ID 3329		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Balsam Dr		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Royal Palm Beach Blvd		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$4,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP

CURB RAMP REPORT

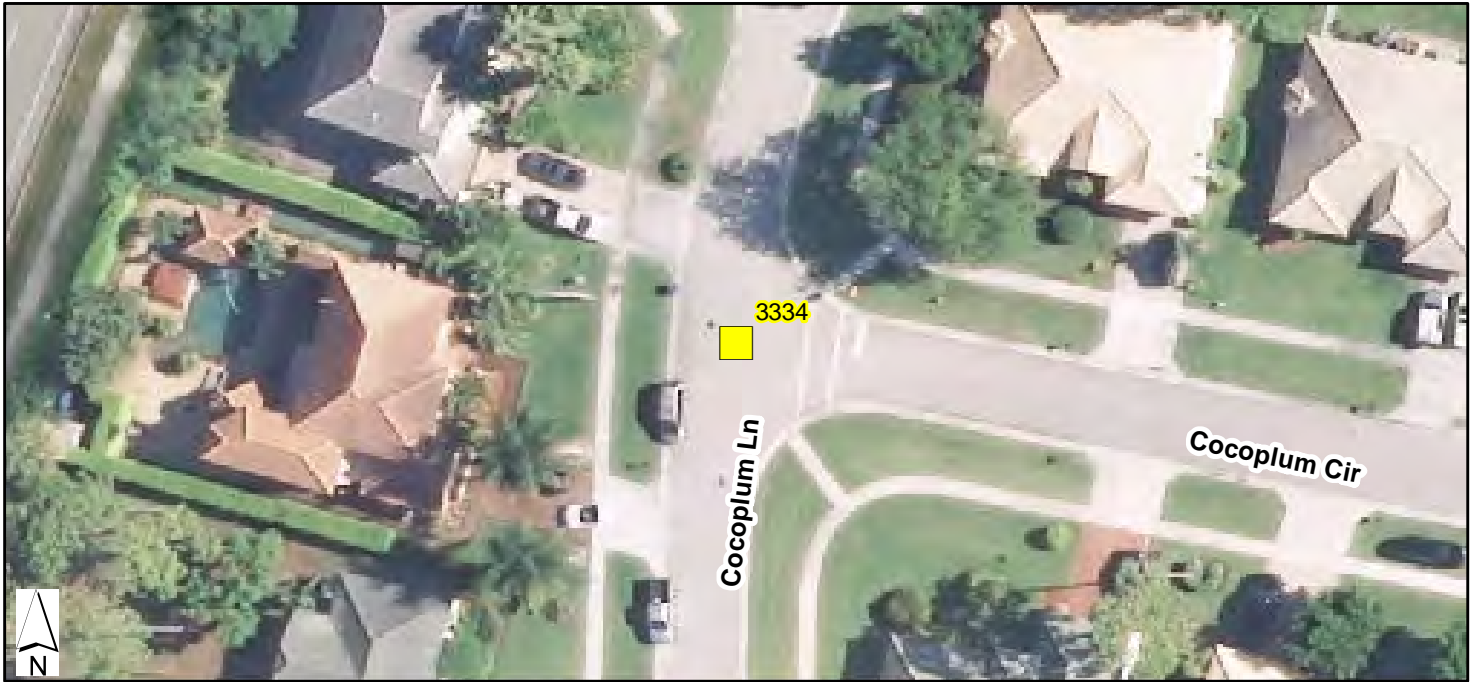


ID 3334		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Cocoplum Cir		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Cocoplum Ln		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.

CURB_RAMP



CURB RAMP REPORT

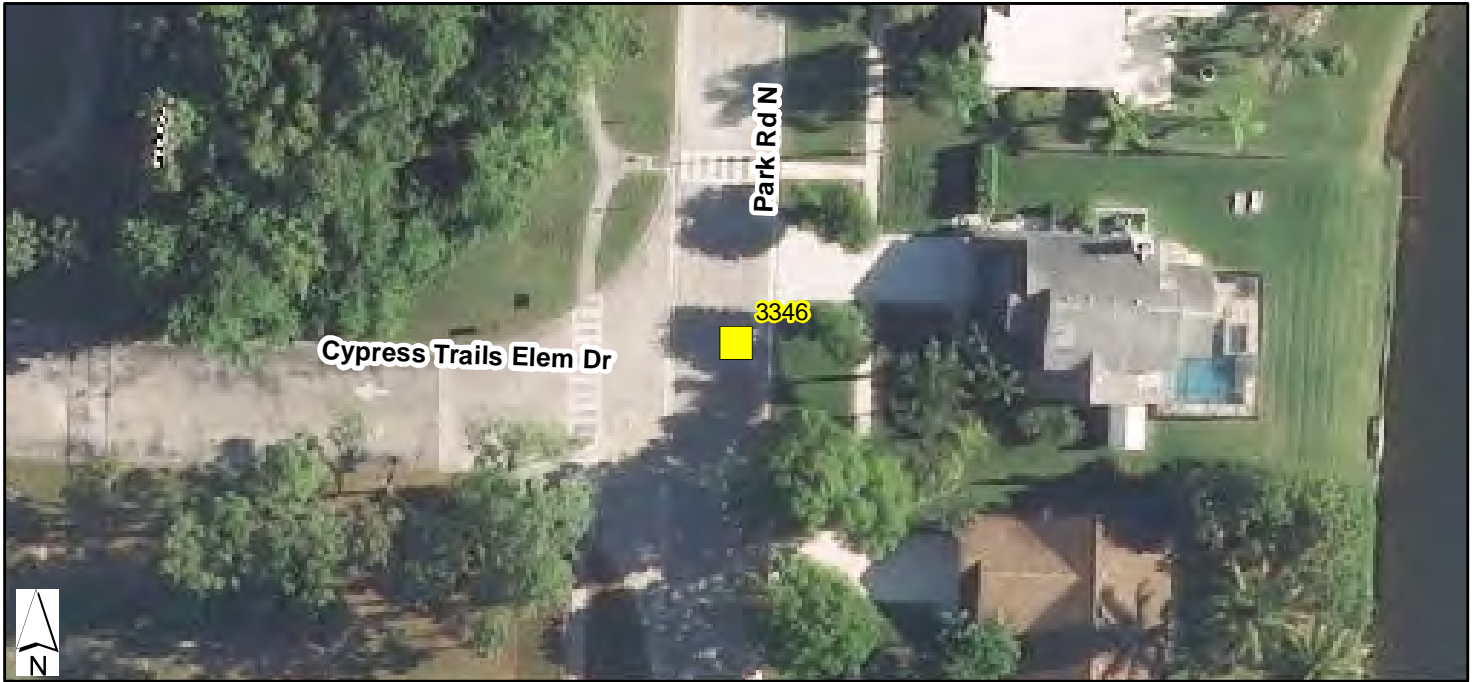

ID 3346		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Cypress Trails Elem Dr		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Park Rd N		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3348		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Pippin Ln		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Westside Way		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$1,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3351		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Civic Center Way		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Civic Center Way		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3352		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Civic Center Way		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Civic Center Way		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3359		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Chestnut Cir		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Cocoplum Ln		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3362		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Cocoplum Ln		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Cocoplum Cir		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3363		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 New Kent Ct		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Sparrow Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3365		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Prestige Dr		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Country Club Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP


CURB RAMP REPORT



ID 3369		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Gardenia Dr		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Royal Palm Beach Blvd		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT

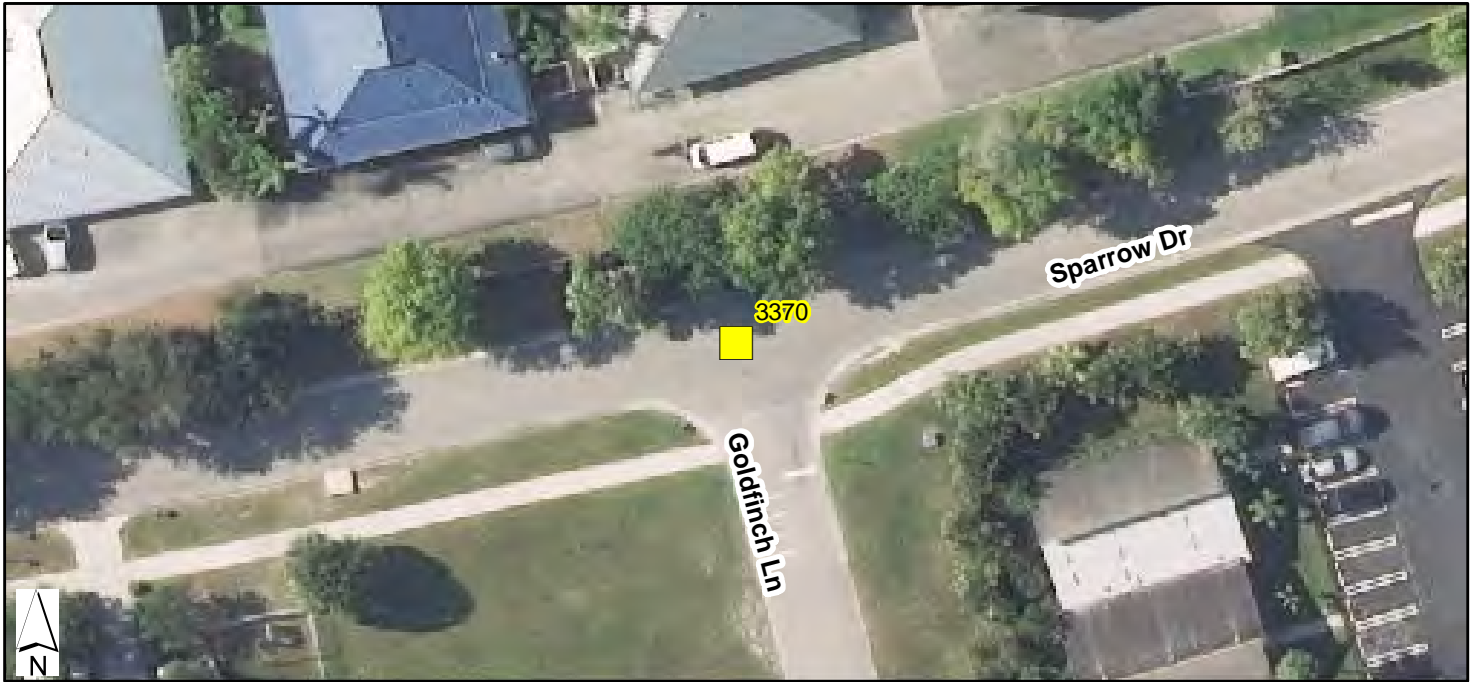

ID 3370		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Goldfinch Ln		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Sparrow Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP


CURB RAMP REPORT



ID 3375		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Locust Ln		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Park Rd N		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP


CURB RAMP REPORT

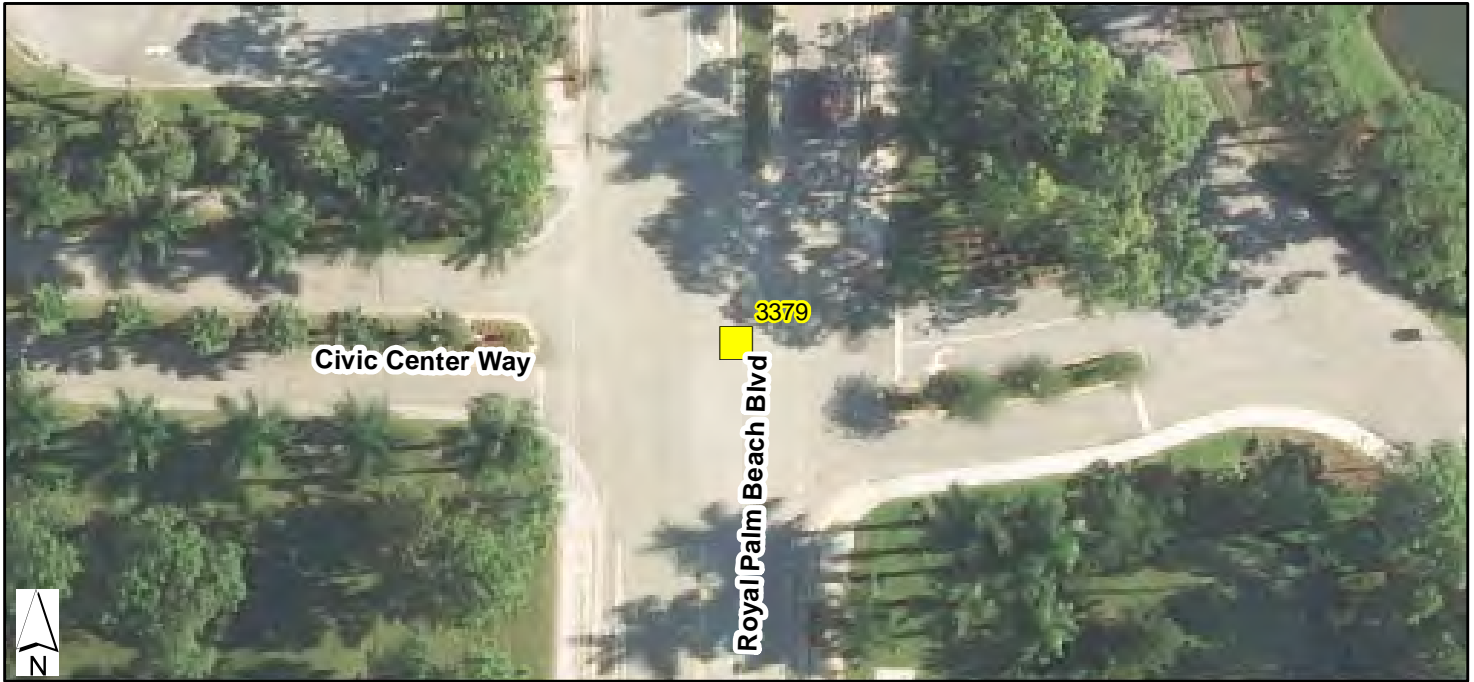

ID 3379		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Civic Center Way		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Royal Palm Beach Blvd		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Replace ramp & add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$10,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP

CURB RAMP REPORT

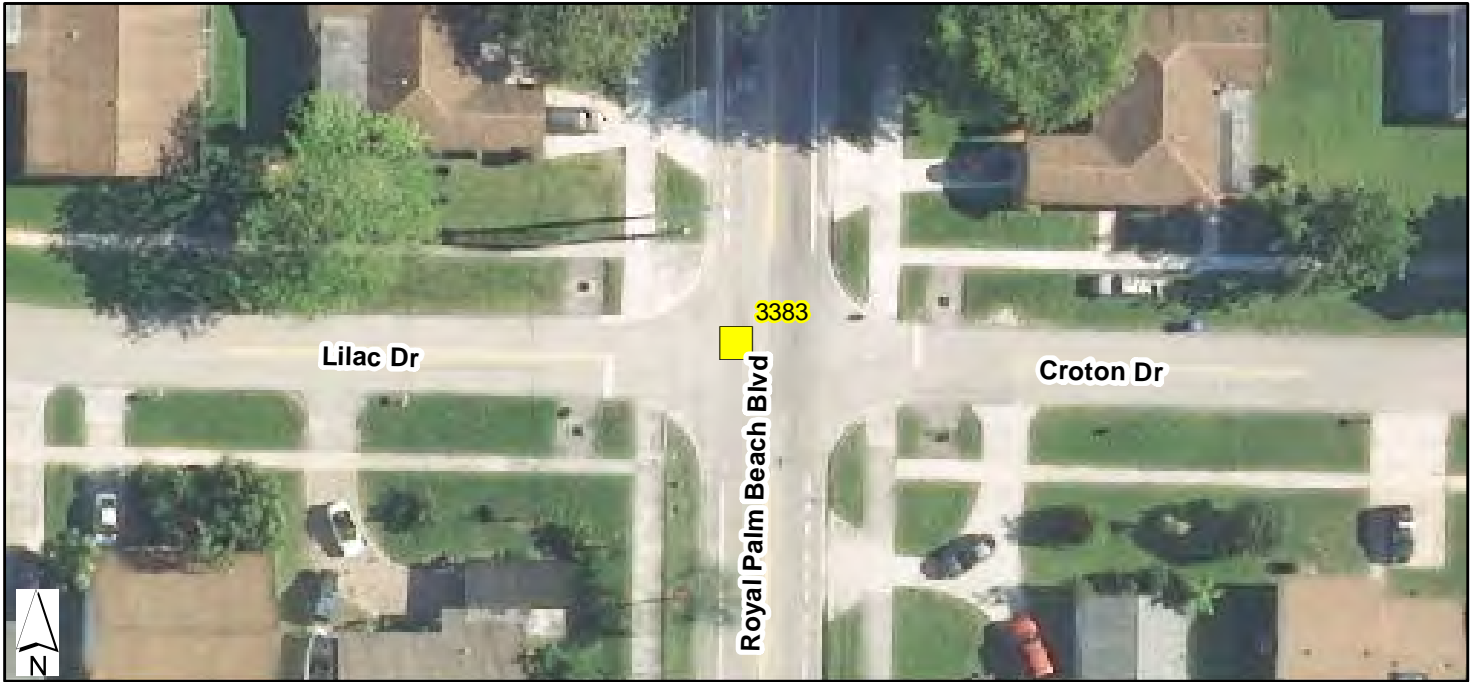

ID 3383		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Lilac Dr		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Royal Palm Beach Blvd		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP

CURB RAMP REPORT



ID 3389		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Twin Lakes Way		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Monterey Way		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP

CURB RAMP REPORT



ID 3391		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Hibiscus Dr		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Orchid Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3395		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Natures Way		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Saratoga Blvd W		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP


CURB RAMP REPORT



ID 3400		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Rainforest Ct		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Saratoga Blvd W		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT

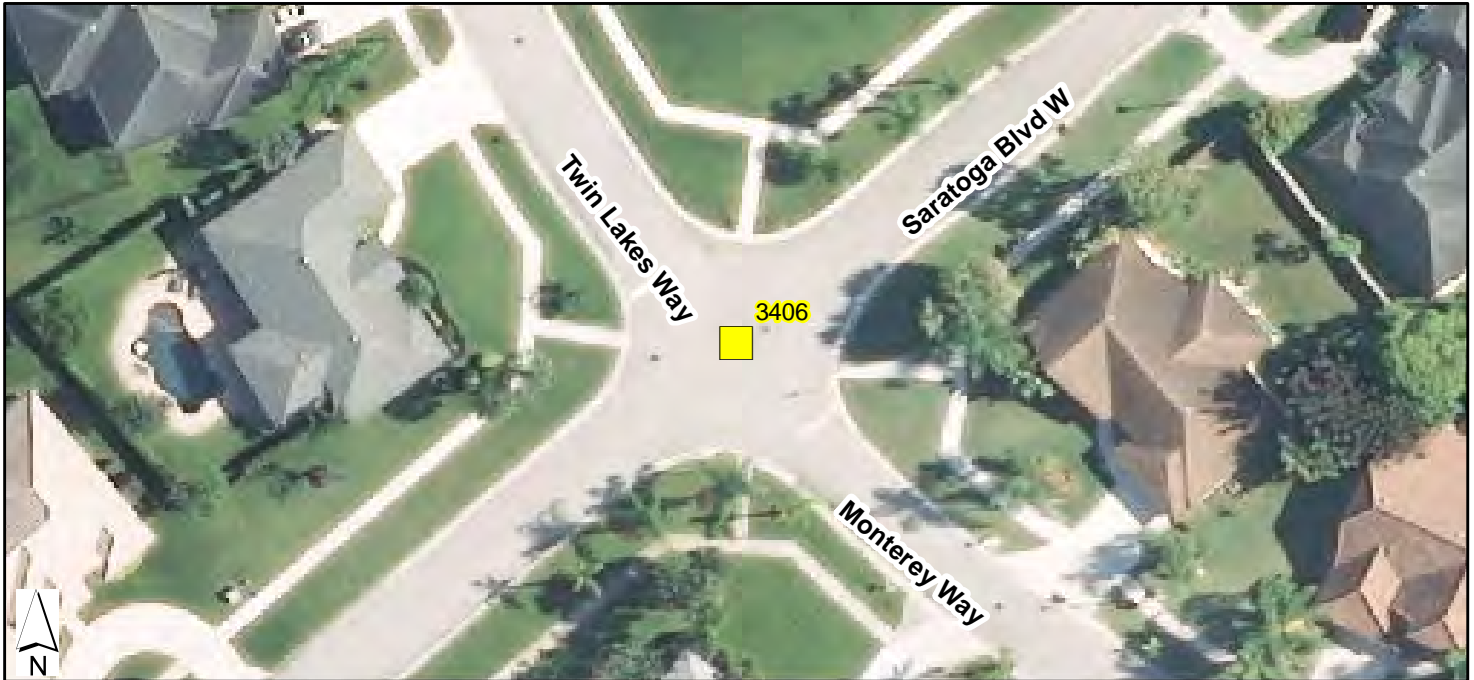

ID 3406		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Twin Lakes Way		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Saratoga Blvd W		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP


CURB RAMP REPORT



ID 3415		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Bella Vita Dr		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Country Club Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$4,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT

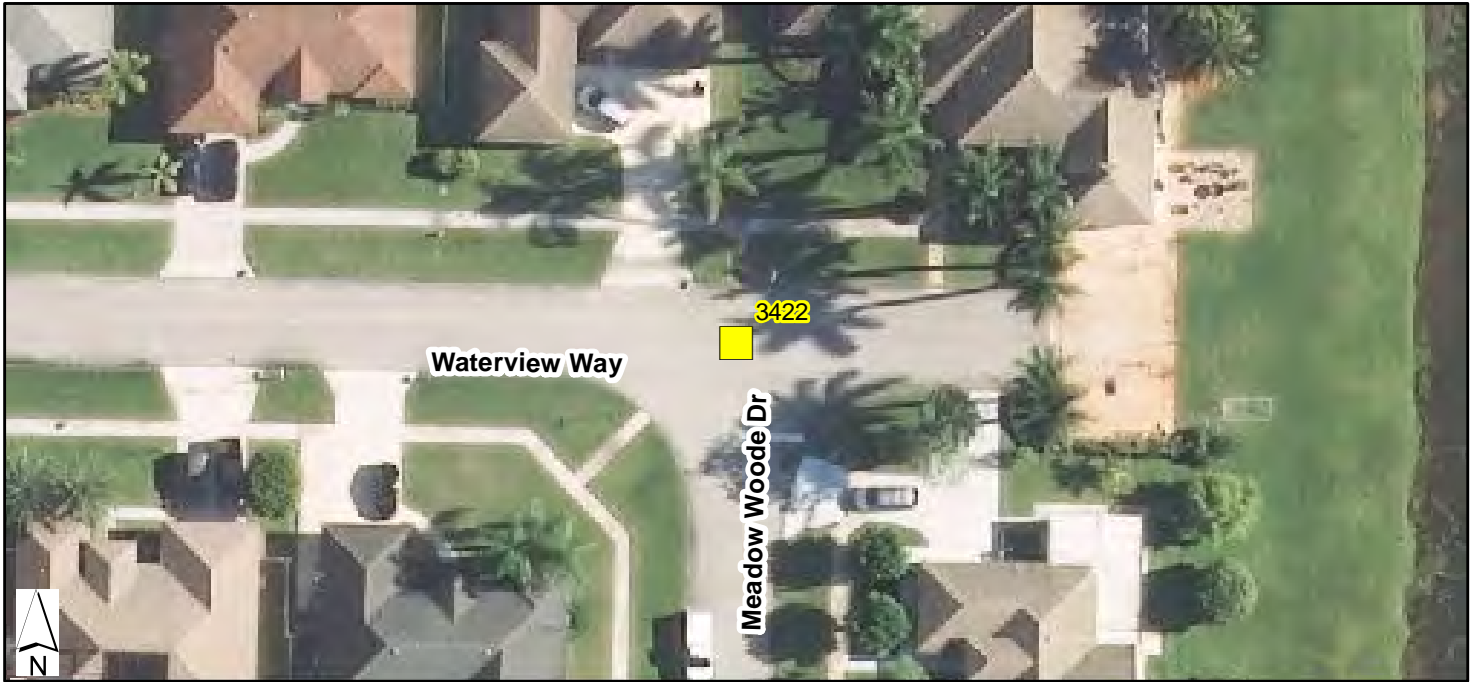

ID 3422		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Meadow Woode Dr		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Waterview Way		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning		COST(\$): \$1,000.00	ADA COMPLIANT? No	VERIFICATION Office

Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.

CURB_RAMP



CURB RAMP REPORT



ID 3431		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE
CROSSROAD 1 Brook Woode Ave		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE
CROSSROAD 2 Meadow Woode Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning		COST(\$): \$2,000.00	ADA COMPLIANT? No
		VERIFICATION Office	

Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.

CURB_RAMP



CURB RAMP REPORT



ID 3436		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Sweet Bay Ln		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Park Rd N		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP

CURB RAMP REPORT



ID 3437		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Park Rd S		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Park Rd N		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP

CURB RAMP REPORT




ID 3446		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Monterey Way		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Venetian Ln		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.

CURB_RAMP



CURB RAMP REPORT

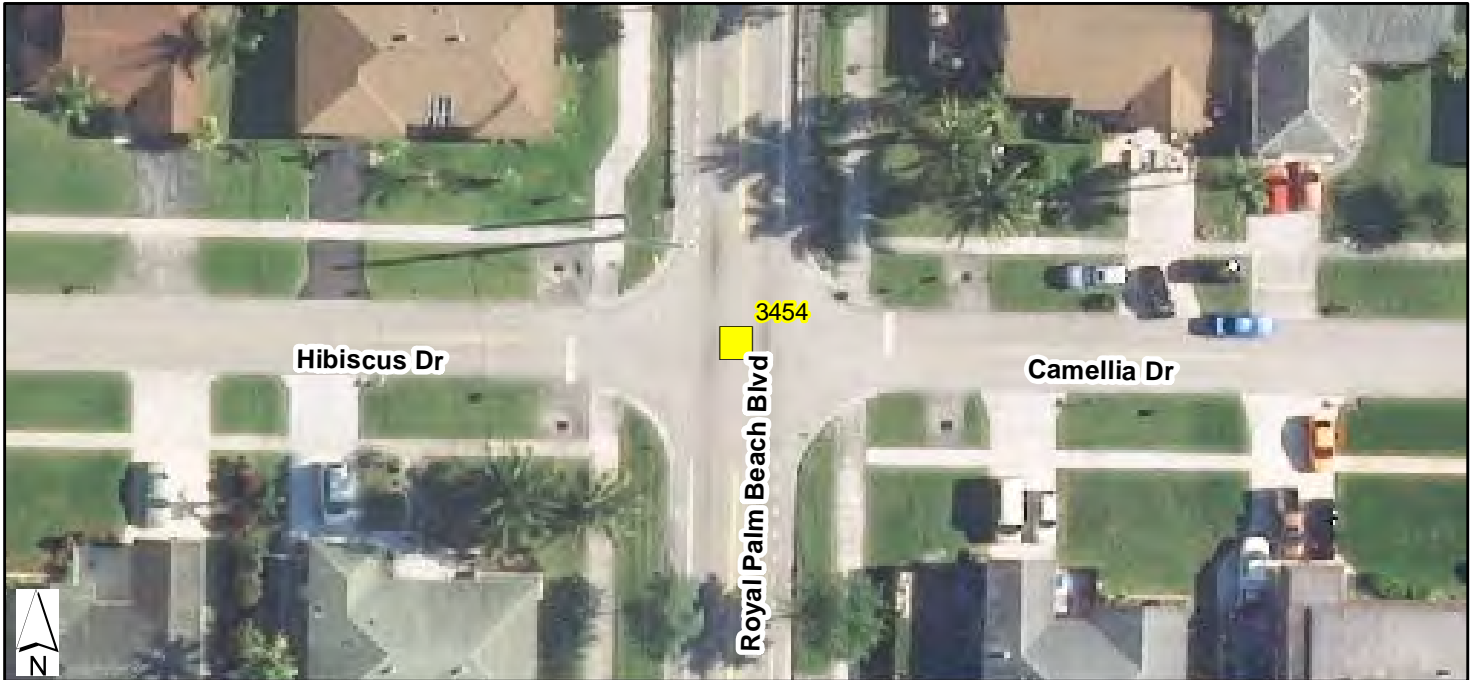

ID 3454		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Camellia Dr		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Royal Palm Beach Blvd		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP



CURB RAMP REPORT



ID 3455		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Mandeville Ln		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Chestnut Cir		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP

CURB RAMP REPORT



ID 3461		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Brook Woode Ct		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Mill Pond Ln		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3465		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Country Club Way		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Country Club Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP


CURB RAMP REPORT



ID 3485		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Oxford Ct		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Hemingway Ct		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP


CURB RAMP REPORT

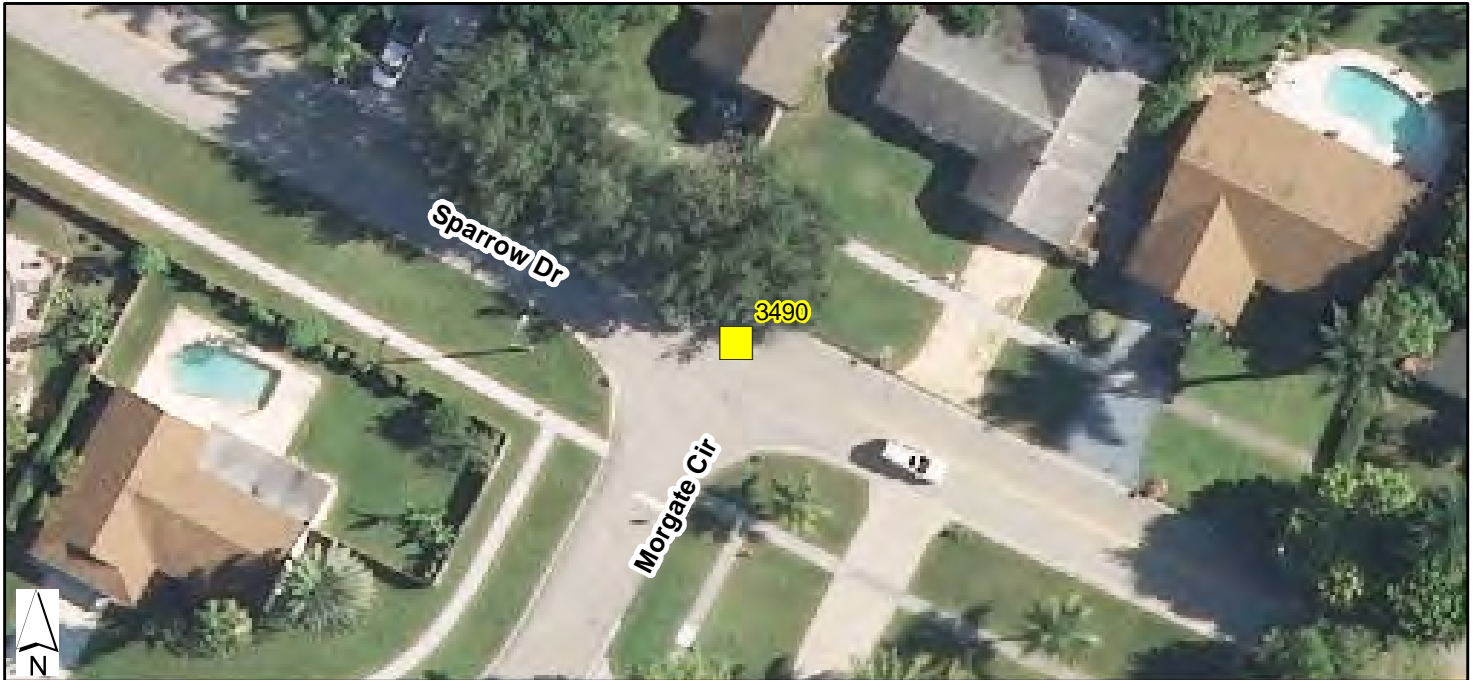

ID 3490	RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Morgate Cir	CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Sparrow Dr	GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017	TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.	COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT

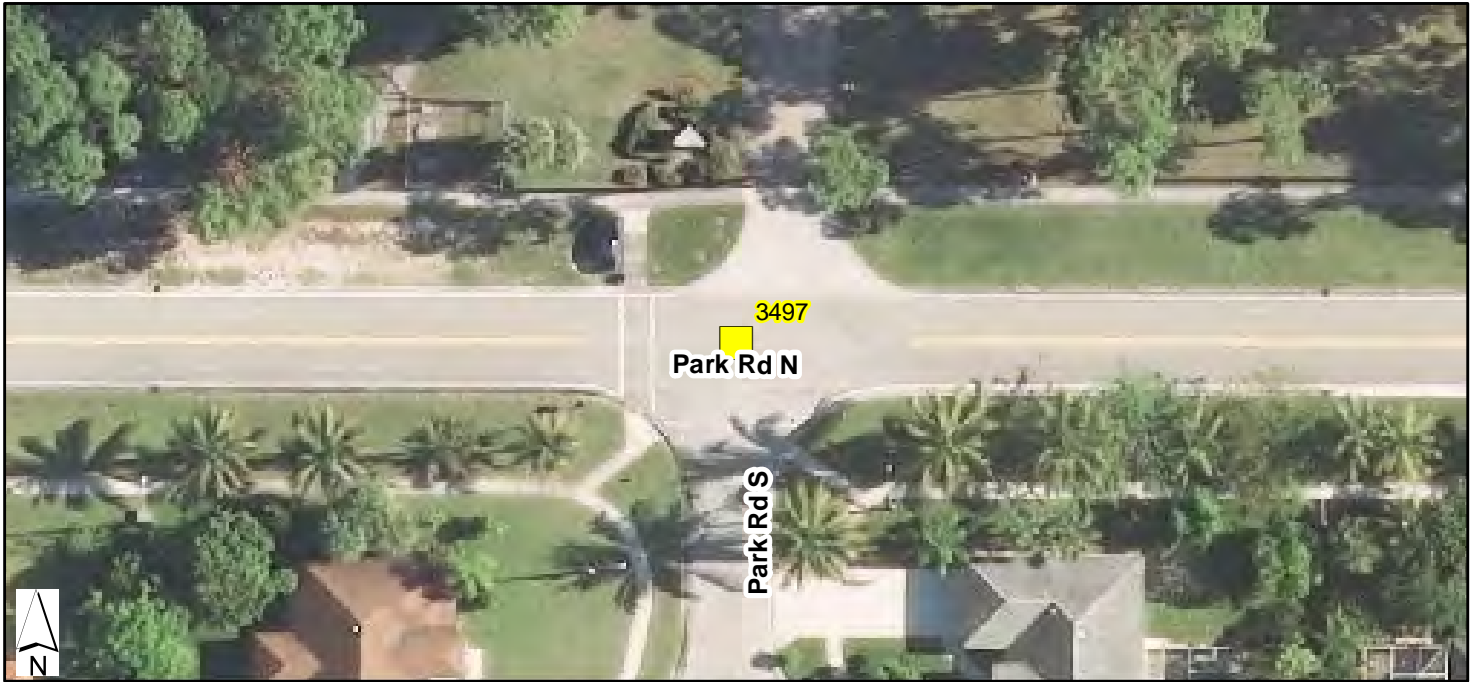

ID 3497	RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Park Rd S	CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Park Rd N	GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017	TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.	COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP



CURB RAMP REPORT



ID 3498		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Park Rd S		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Park Rd N		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP


CURB RAMP REPORT



ID 3499		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Park Rd S		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Park Rd N		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP


CURB RAMP REPORT

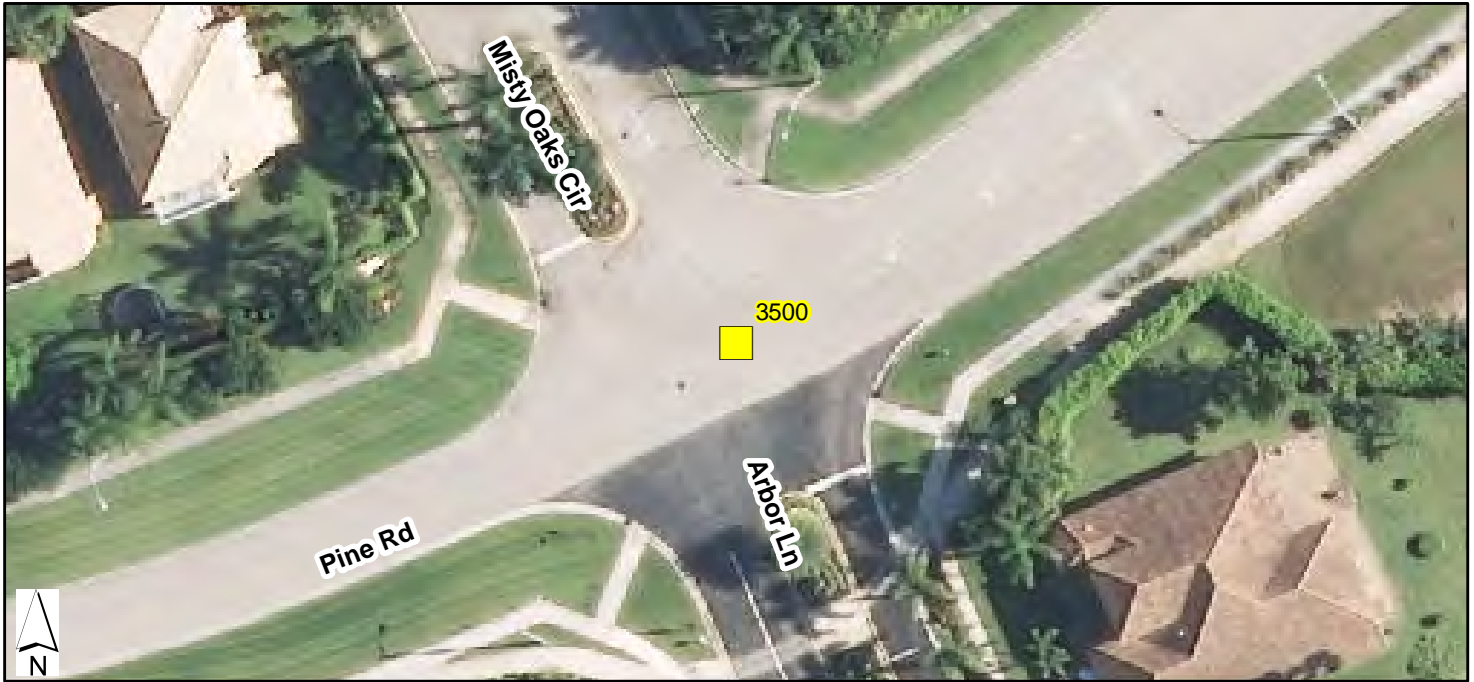

ID 3500		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Misty Oaks Cir		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Pine Rd		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT

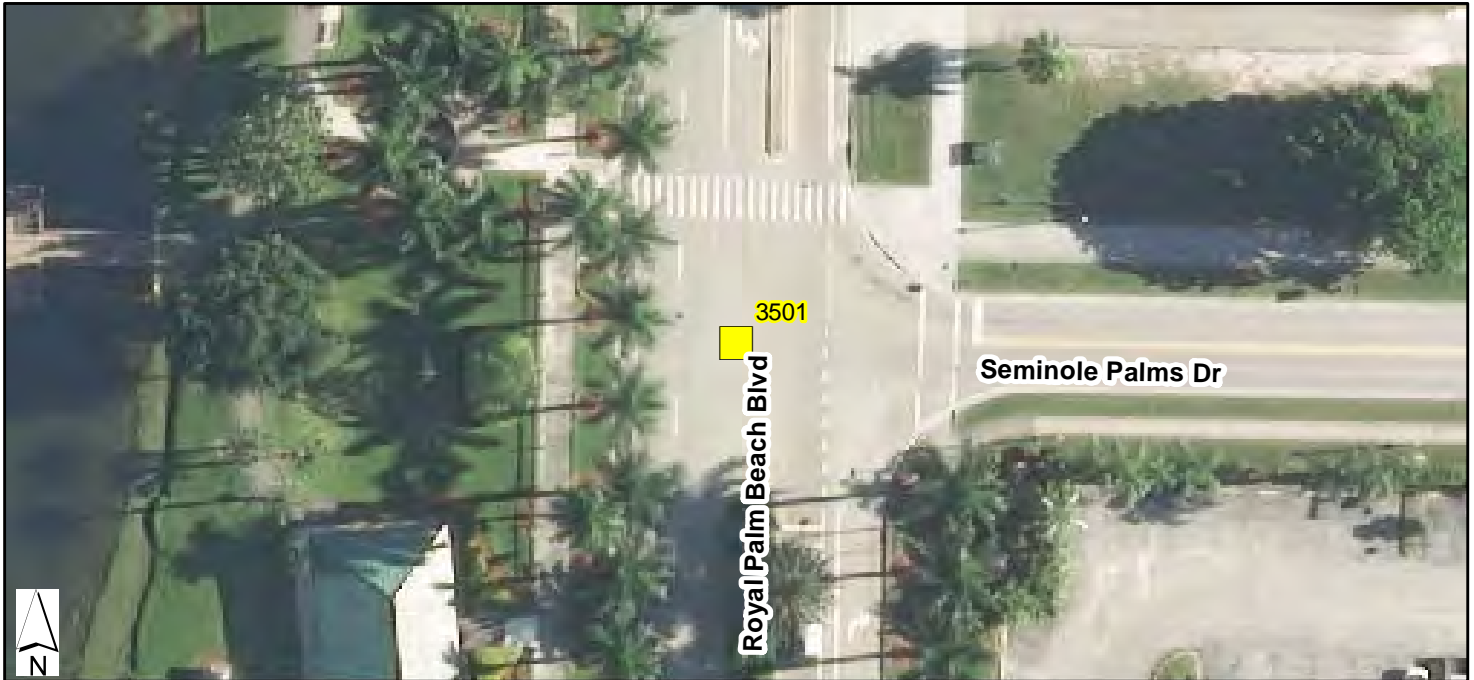

ID 3501		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Royal Palm Beach Blvd		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Seminole Palms Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN
CORRECTIVE MEASURES/COMMENTS: Add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3502		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Royal Plaza Rd		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Seminole Palms Dr		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3505		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Oleander Dr		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Royal Palm Beach Blvd		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT



ID 3515		RUNNING SLOPE 8.33% OR LESS? NONE		FLARED SIDES? NONE	
CROSSROAD 1 Dahlia Dr		CROSS SLOPE 2% OR LESS? NONE		FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Royal Palm Beach Blvd		GUTTER SLOPE 5% OR LESS? UNKNOWN		FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN		OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE		OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN		RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN		BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office	

CURB_RAMP

CURB RAMP REPORT



ID 3522		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Sycamore Dr		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Park Rd N		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP


CURB RAMP REPORT



ID 3525		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Salzedo St		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Rivera Ave		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Ramps & detectable warning need to be updated Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$4,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT

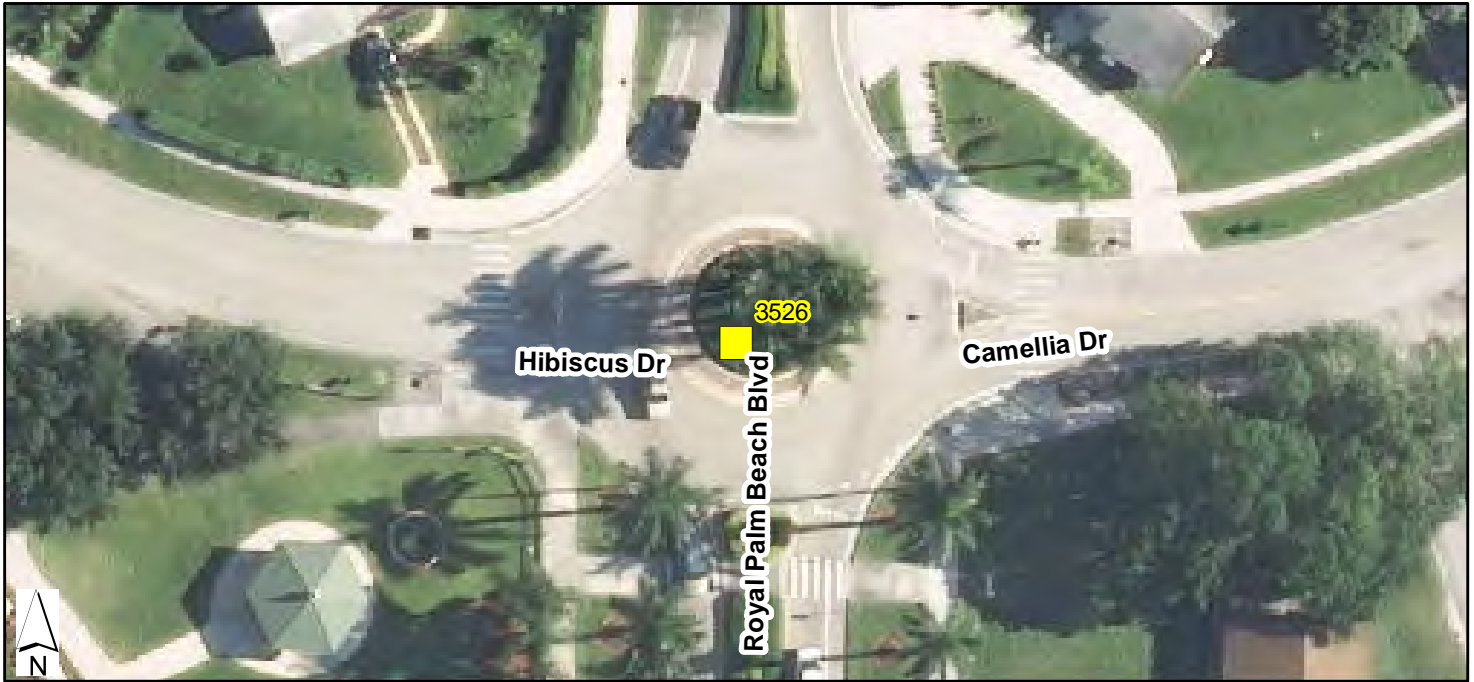


ID 3526		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Camellia Dr		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Royal Palm Beach Blvd		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP



CURB RAMP REPORT

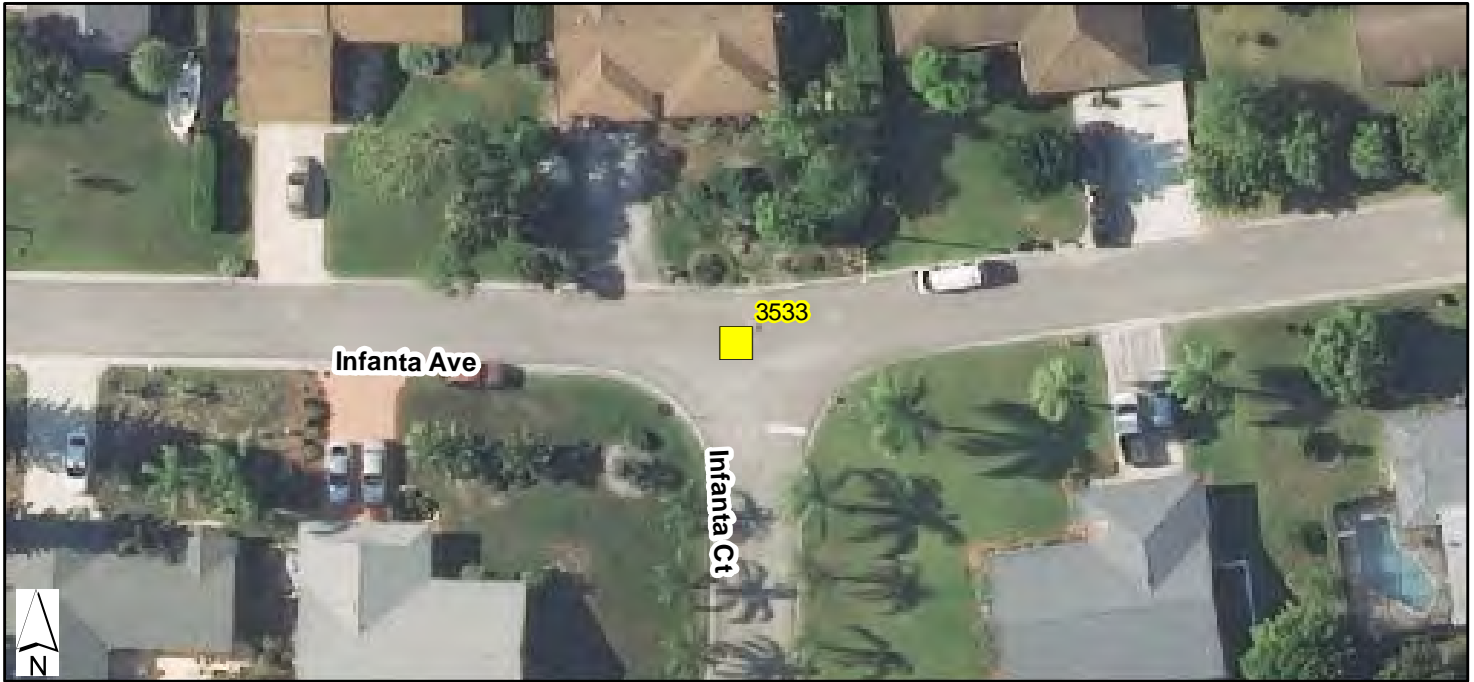


ID 3533		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Infanta Ct		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Infanta Ave		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Ramps & detectable warning need to be updated		COST(\$): \$4,000.00	ADA COMPLIANT? No	VERIFICATION Office

Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.

CURB_RAMP




CURB RAMP REPORT

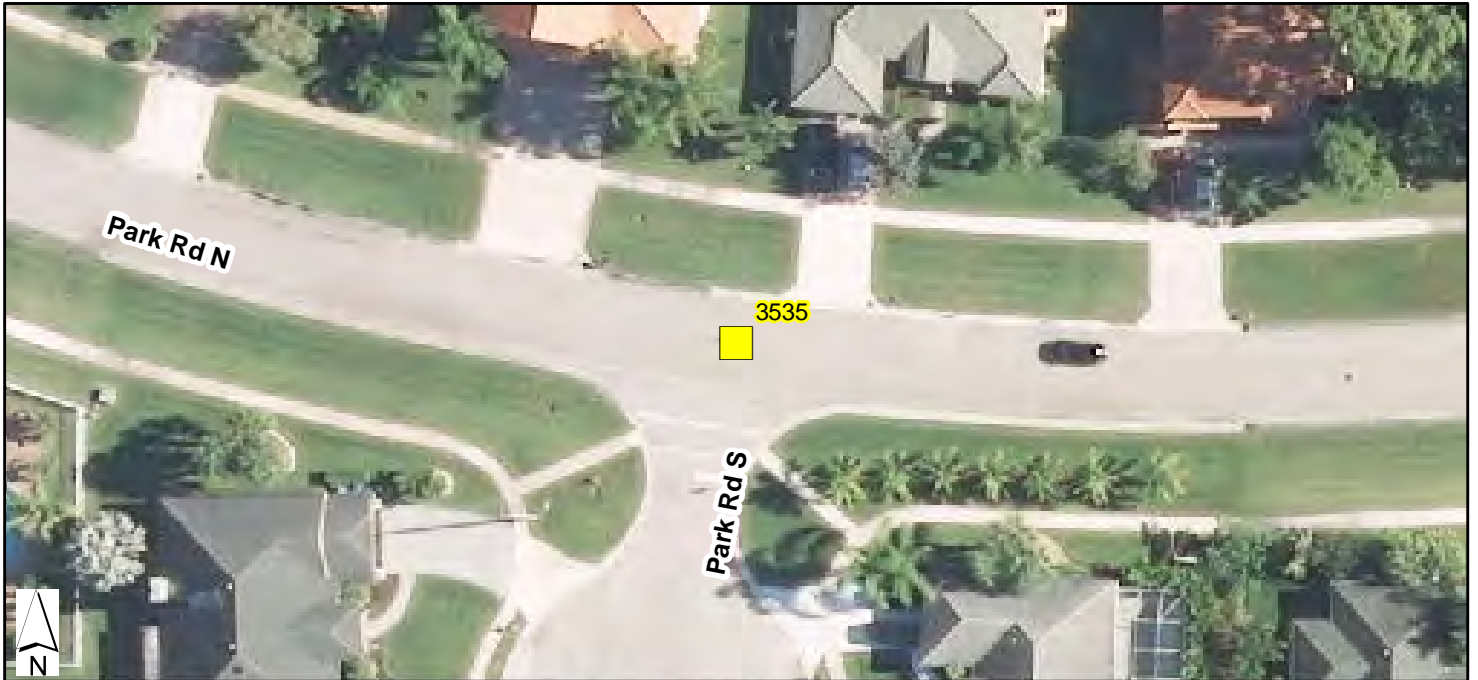

ID 3535		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Park Rd S		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Park Rd N		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

CURB RAMP REPORT

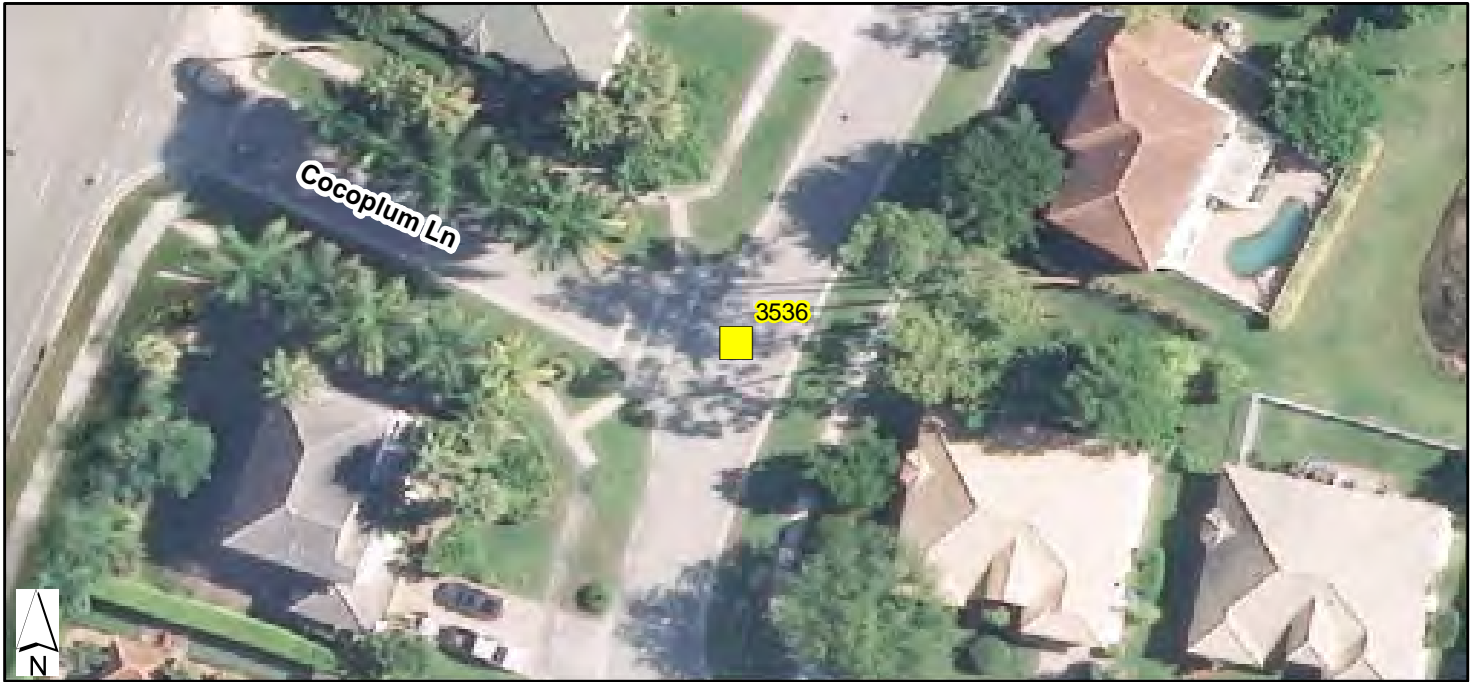

ID 3536		RUNNING SLOPE 8.33% OR LESS? NONE	FLARED SIDES? NONE	
CROSSROAD 1 Cocoplum Ln		CROSS SLOPE 2% OR LESS? NONE	FLARED SIDES SLOPE 10% OR LESS? NONE	
CROSSROAD 2 Cocoplum Ln		GUTTER SLOPE 5% OR LESS? UNKNOWN	FLARED SIDES SLOPE 8.33% OR LESS? UNKNOWN	
INSPECTION DATE 8/8/2017		TRANSITIONS FLUSH & FREE? UNKNOWN	OBSTRUCTION OR GRASS ON SIDE? UNKNOWN	
CURB TYPE UNKNOWN	EDGE TYPE NONE	DETECTABLE WARNINGS? NONE	OUTSIDE PATH OF CARS? NONE	
QUADRANT CENTER		BLOCKABLE BY CARS? UNKNOWN	RAMP CONTAINED IN MARKINGS? UNKNOWN	
RAMP 36" WIDE? UNKNOWN		SIDEWALK 36" WIDE? UNKNOWN	BOTTOM LANDING 48" LONG? UNKNOWN	
CORRECTIVE MEASURES/COMMENTS: Adjust ramp slope and add detectable warning Initial assesment was completed using aerial imagery; detailed assesment will be completed prior to the roadway being resurfaced.		COST(\$): \$2,000.00	ADA COMPLIANT? No	VERIFICATION Office

CURB_RAMP

ADA TRANSITION PLAN - PARKS

	Park	Deficiency Item	Object ID	Estimated Cost
2025	Bob Marcello			
		Detectable warnings	2404	\$500.00
		Detectable warnings	2405	\$500.00
		Detectable warnings	2407	\$500.00
		Detectable warnings	3601	\$500.00
		Rebuild Curb Ramp	4	\$1,200.00
		Sidewalk Repair (asphalt)	2406	\$2,400.00
		Sidewalk Replacement (asphalt)	4	\$22,160.00
		Sidewalk Replacement (asphalt)	5	\$26,400.00
		Sidewalk Replacement (asphalt)	2401	\$1,500.00
		Sidewalk Replacement (asphalt)	2403	\$800.00
	Bob Marcello Total			\$56,460.00
	Grandview Linear Park			
		Rebuild Curb Ramp	8430	\$1,200.00
	Grandview Linear Park Total			\$1,200.00
	Pine Road Park			
		Detectable warnings	8830	\$500.00
		Rebuild Curb Ramp	8830	\$1,200.00
		Sidewalk Repair (asphalt)	2005	\$320.00
		Sidewalk Repair (asphalt)	2006	\$104.00
		Sidewalk Repair (asphalt)	2007	\$144.00
	Pine Road Park Total			\$2,268.00
2025 Total				\$59,928.00
2028	Camellia Park			
		Detectable warnings	2801	\$500.00
		Detectable warnings	2802	\$500.00
		Rebuild Curb Ramp	2801	\$1,200.00
		Sidewalk Repair (asphalt)	3211	\$14,144.00
		Sidewalk Repair (asphalt)	3213	\$10,560.00
		Sidewalk Repair (concrete)	3214	\$12,350.00
	Camellia Park Total			\$39,254.00
	Challenger Linear Park			
		Detectable warnings	1202	\$500.00
		Rebuild Curb Ramp	1606	\$1,200.00
		Sidewalk Replacement (asphalt)	1607	\$8,000.00
		Sidewalk Replacement (concrete)	8030	\$7,800.00
	Challenger Linear Park Total			\$17,500.00
	Homeplace Park			
		Detectable warnings	1601	\$500.00
		Sidewalk Repair (concrete)	1602	\$156.00
		Sidewalk Replacement (concrete)	1602	\$3,000.00
		Sidewalk Replacement (concrete)	1603	\$48,000.00
	Homeplace Park Total			\$51,656.00

	Park	Deficiency Item	Object ID	Estimated Cost
2028	Veterans Park			
		Detectable Warning	2414	\$500.00
		Detectable Warning	2415	\$500.00
		Detectable Warning	2416	\$500.00
		Detectable Warning	4001	\$3,000.00
		Sidewalk Replacement (concrete)	3206	\$4,800.00
		Sidewalk Replacement (concrete)	3217	\$36,000.00
	Veterans Park Total			\$45,300.00
	Wetlands Park			
		Sidewalk Repair (concrete)	1201	\$5,200.00
	Wetlands Park Total			\$5,200.00
	Vivian A. Ferrin Park			
		Sidewalk Replacement (concrete)	4804	\$110,675.00
	Vivian A. Ferrin Park Total			\$110,675.00
2028 Total				\$269,585.00
2031	Bobbie Jo Lautner			
		Detectable warnings	1609	\$500.00
		Rebuild Curb Ramp	1609	\$1,200.00
		Sidewalk Repair (concrete)	1609	\$5,200.00
	Bobbie Jo Lautner Total			\$6,900.00
	Earthday Park			
		Detectable warnings	2402	\$500.00
		Sidewalk Repair (asphalt)	2001	\$96.00
		Sidewalk Repair (asphalt)	2003	\$96.00
		Sidewalk Replacement (asphalt)	2404	\$9,600.00
	Earthday Park Total			\$10,292.00
	Lindsey Ewing Park			
		Detectable warnings	1610	\$500.00
	Lindsey Ewing Park Total			\$500.00
	Moon Light Park			
		Detectable warnings	3603	\$500.00
	Moon Light Park Total			\$500.00
	Penzance Park			
		Detectable warnings	1609	\$500.00
		Sidewalk Replacement (concrete)	2008	\$14,400.00
	Penzance Park Total			\$14,900.00
	Preservation Park			
		Detectable warnings	2408	\$500.00
		Detectable warnings	2409	\$500.00
		Detectable warnings	2410	\$500.00
		Detectable warnings	2411	\$500.00
		Detectable warnings	2412	\$500.00
		Sidewalk Repair (concrete)	2805	\$741.00
		Sidewalk Replacement (concrete)	3202	\$51,600.00
	Preservation Park Total			\$54,841.00

	Park	Deficiency Item	Object ID	Estimated Cost
2031	Pippin Park			
		Detectable warnings	1605	\$500.00
		Detectable warnings	1610	\$500.00
		Sidewalk Replacement (concrete)	2005	\$37,350.00
	Pippin Park Total			\$38,350.00
2031 Total				\$126,283.00
Grand Total				\$455,796.00

BOB MARCELLO PARK REPORT



ID 4
RUNNING SLOPE<8.33% YES
CROSS SLOPE<2% NO
INSPECTION DATE UNKNOWN
MATERIAL NONE
ADA COMPLIANT NO
COMMENTS: NONE



— ADA PATHWAY

BOB MARCELLO PARK REPORT



ID 5
RUNNING SLOPE<8.33% YES
CROSS SLOPE<2% NO
INSPECTION DATE UNKNOWN
MATERIAL ASPHALT
ADA COMPLIANT NO
COMMENTS: Root intrusion, failed at concrete



— ADA PATHWAY

BOB MARCELLO PARK REPORT



<p>ID</p> <p>2401</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 4:00:00 AM</p>
<p>COMMENTS:</p> <p>Running slope failed</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK





BOB MARCELLO PARK REPORT




<p>ID</p> <p>2403</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 4:21:07 PM</p>
<p>COMMENTS:</p> <p>Running/cross slope fail</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK



BOB MARCELLO PARK REPORT



<p>ID</p> <p>2404</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 4:36:22 PM</p>
<p>COMMENTS:</p> <p>Detectable warning?</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK



BOB MARCELLO PARK REPORT



<p>ID</p> <p>2405</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 4:39:25 PM</p>
<p>COMMENTS:</p> <p>No detectable warning?</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK



BOB MARCELLO PARK REPORT



ID

2406

TYPE

OFFICE CHECK

INSPECTION DATE

3/18/2019 4:41:47 PM

COMMENTS:

Lifted asphalt



TYPE




FIELD CHECK



OFFICE CHECK



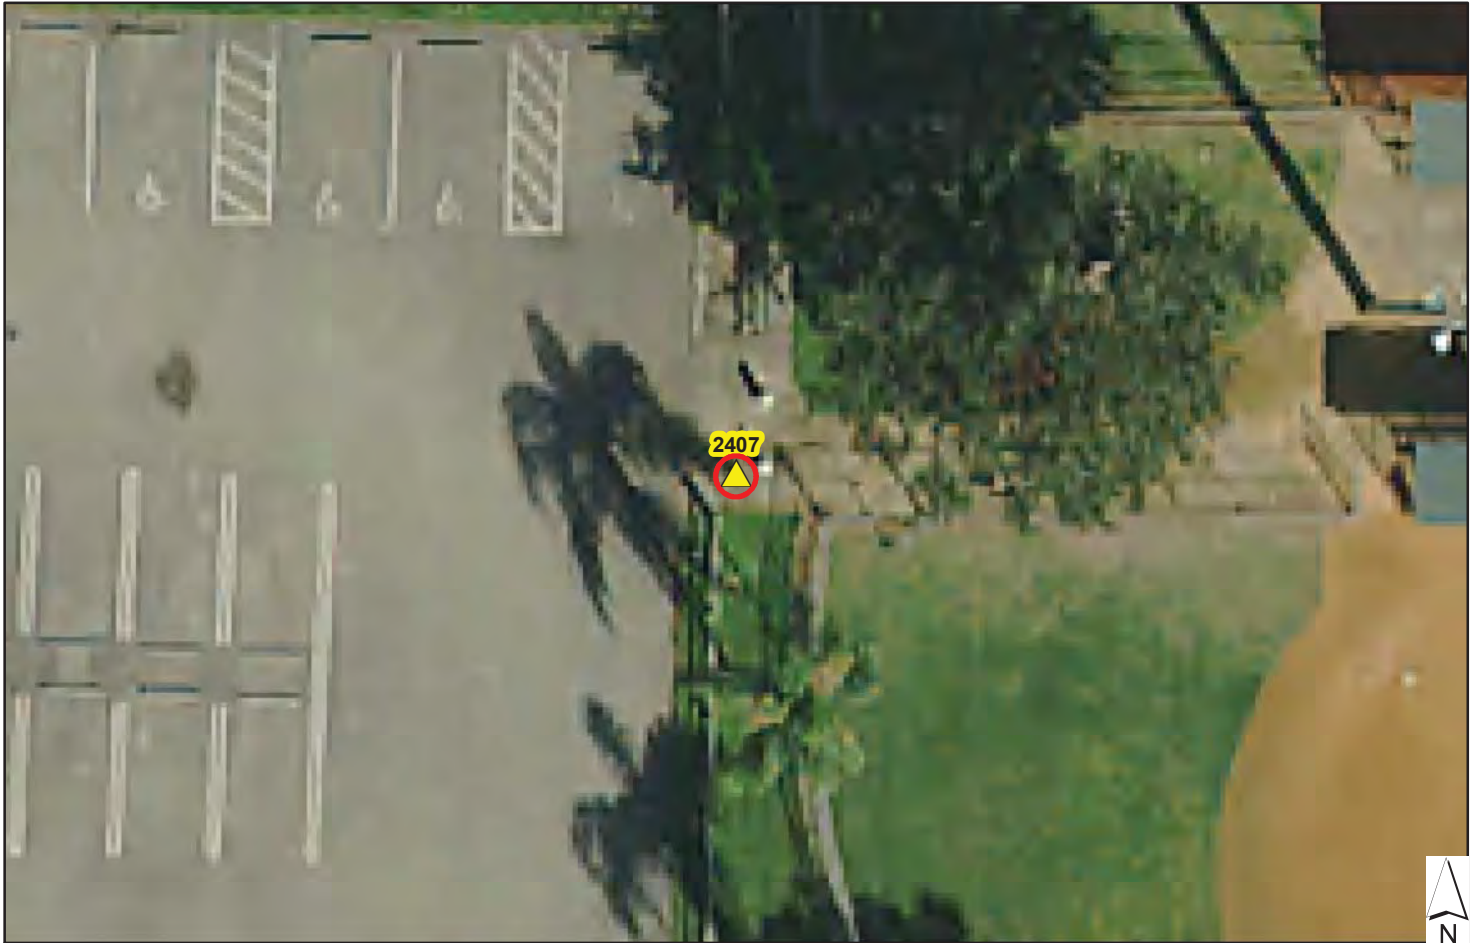

BOB MARCELLO PARK REPORT



<p>ID</p> <p>2407</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 4:50:10 PM</p>
<p>COMMENTS:</p> <p>Missing detectable warning?</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK





BOB MARCELLO PARK REPORT




<p>ID</p> <p>3601</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 4:00:00 AM</p>
<p>COMMENTS:</p> <p>Needs Detectable Warning</p>



- TYPE**
-  FIELD CHECK
 -  OFFICE CHECK



BOBBIE JO LAUTER PARK REPORT

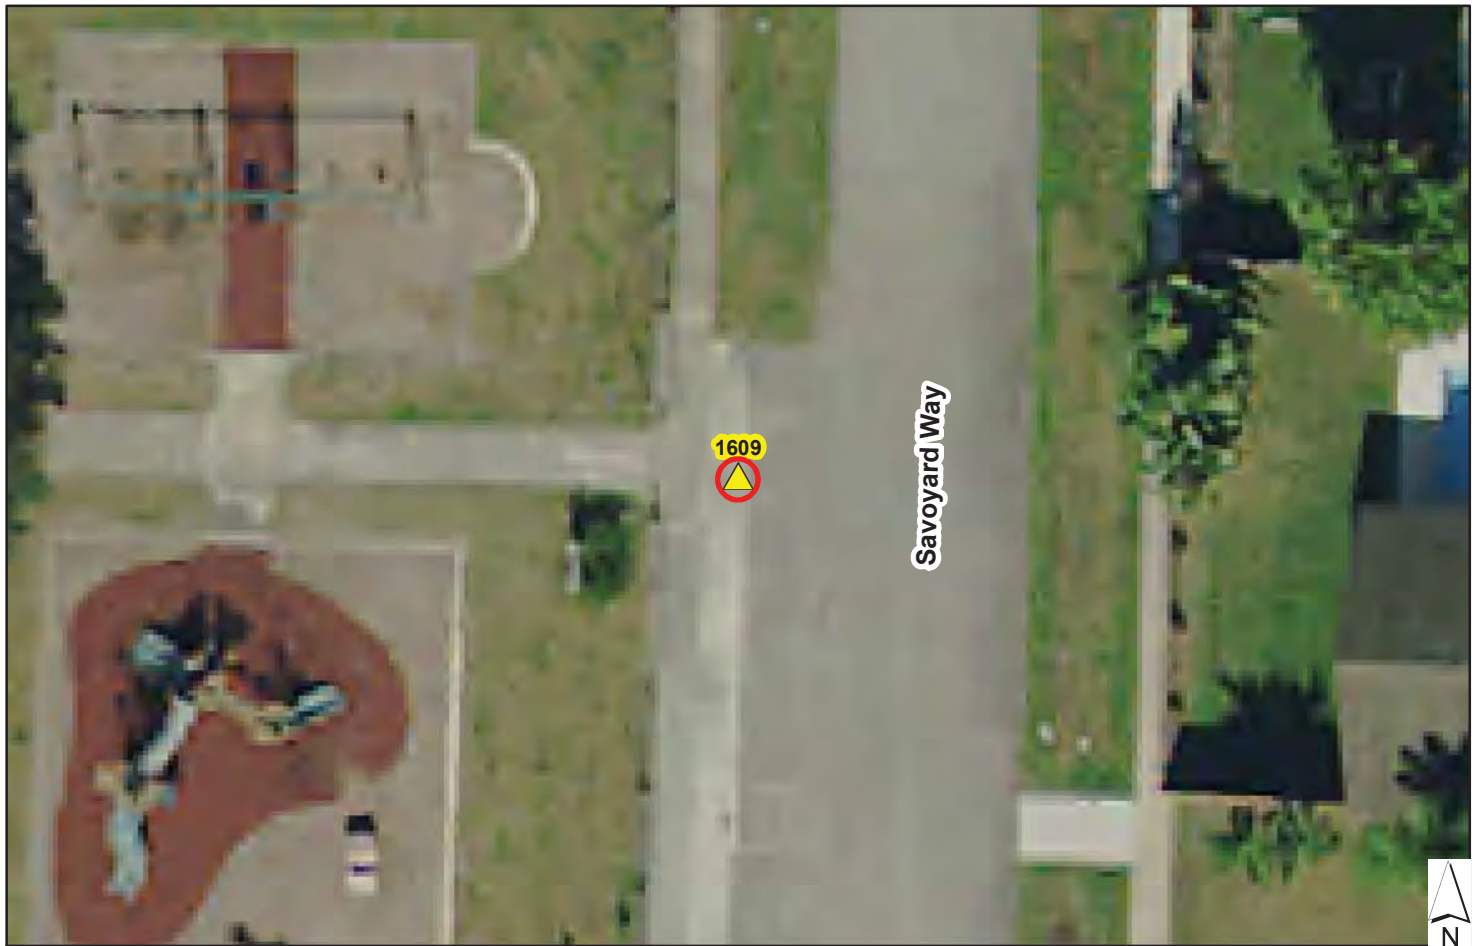

<p>ID</p> <p>1609</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/1/2019 9:25:45 PM</p>
<p>COMMENTS:</p> <p>Missing detectable warning</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK





ADA POINTS OF INTEREST REPORT



<p>ID</p> <p>2801</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 6:38:45 PM</p>
<p>COMMENTS:</p> <p>No detectable warning</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK



ADA POINTS OF INTEREST REPORT



<p>ID</p> <p>2802</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 6:38:45 PM</p>
<p>COMMENTS:</p> <p>No detectable warning, ADA Pass</p>




TYPE

-  FIELD CHECK
-  OFFICE CHECK



CAMELLIA PARK REPORT

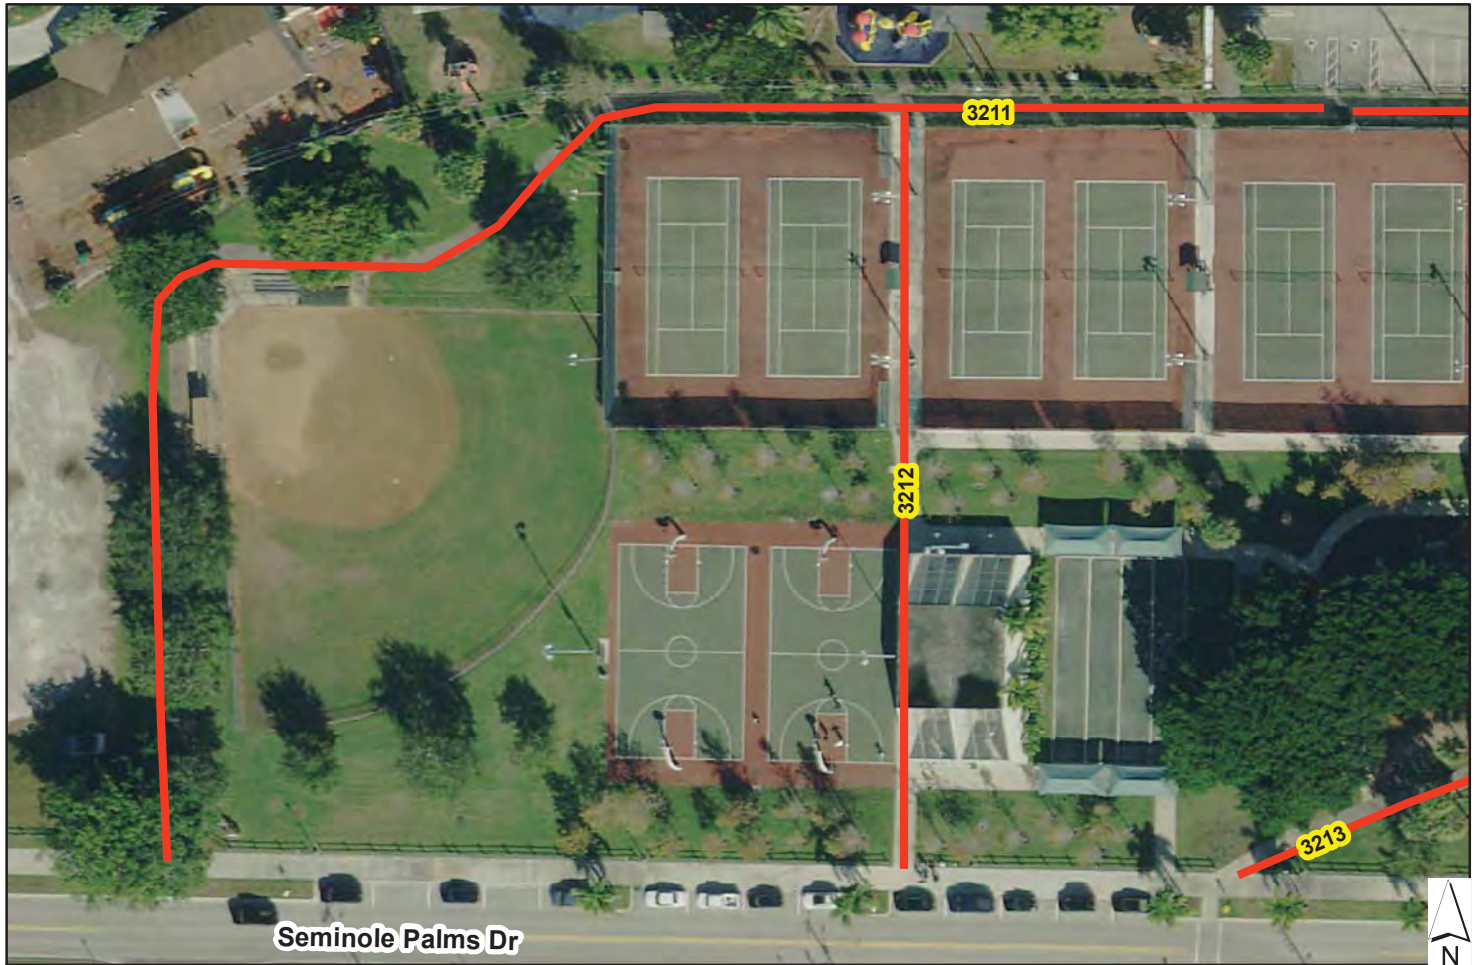

Seminole Palms Dr




ID 3211
RUNNING SLOPE <8.33% YES
CROSS SLOPE <2% NO
INSPECTION DATE UNKNOWN
MATERIAL ASPHALT
ADA COMPLIANT NO
COMMENTS: Uplift of asphalt along path



— ADA PATHWAY

CAMELLIA PARK REPORT

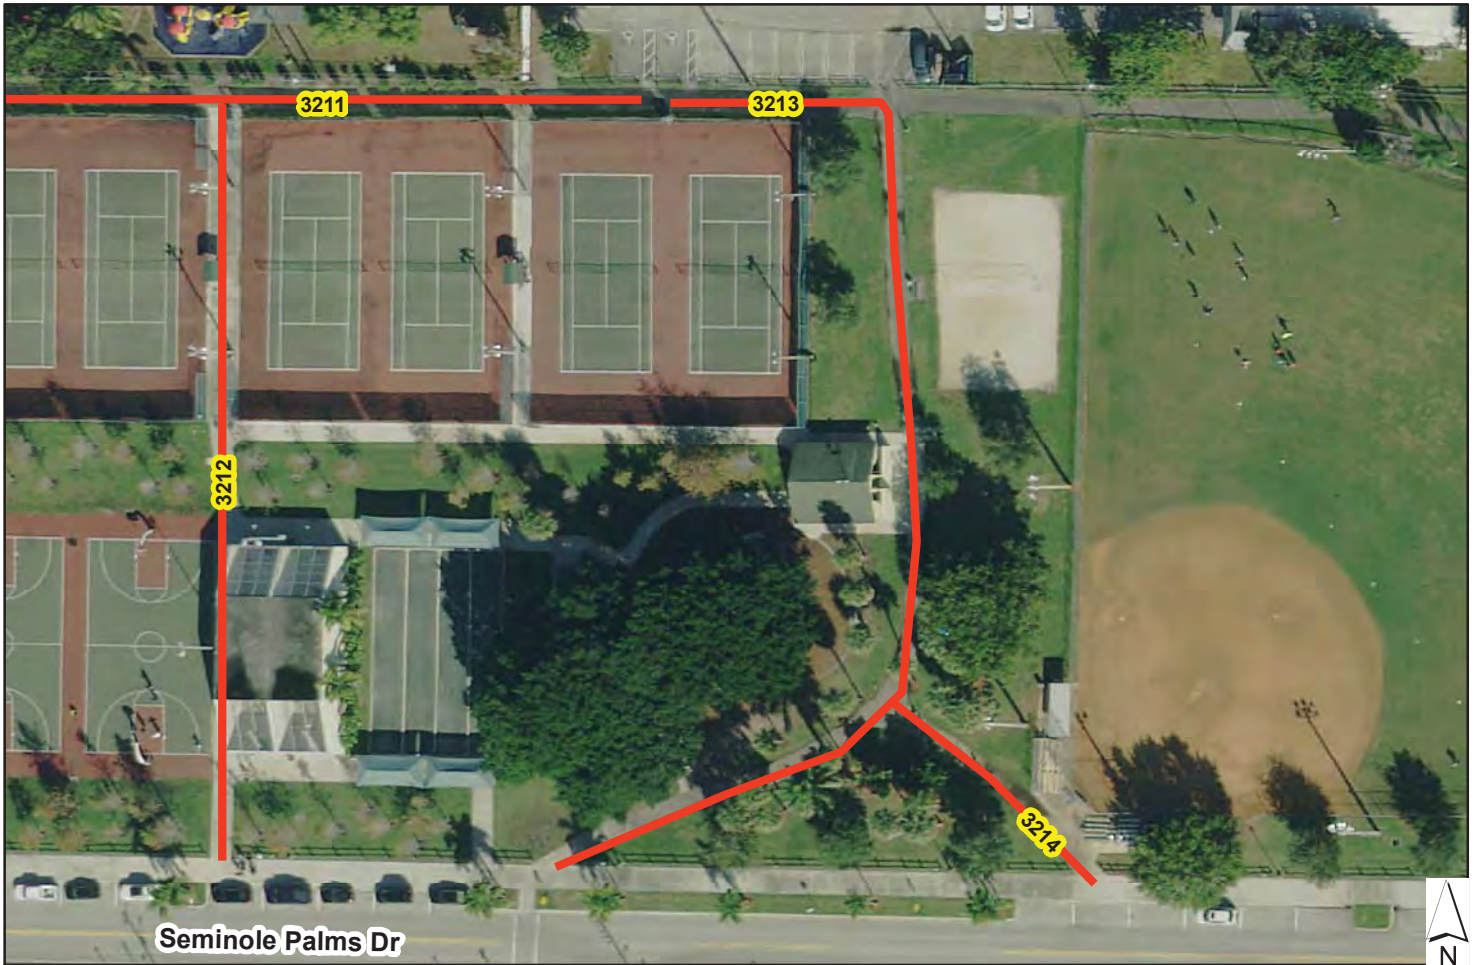

ID 3213
RUNNING SLOPE <8.33% YES
CROSS SLOPE <2% NO
INSPECTION DATE UNKNOWN
MATERIAL ASPHALT
ADA COMPLIANT NO
COMMENTS: By ADA cross slope fail



— ADA PATHWAY

CAMELLIA PARK REPORT



ID 3214
RUNNING SLOPE<8.33% YES
CROSS SLOPE<2% NO
INSPECTION DATE UNKNOWN
MATERIAL ASPHALT
ADA COMPLIANT NO
COMMENTS: Cracking on asphalt



— ADA PATHWAY

CHALLENGER LINEAR PARK REPORT



ID

1202

TYPE

OFFICE CHECK

INSPECTION DATE

2/4/2019 3:16:17 PM

COMMENTS:

Missing DW



TYPE



FIELD CHECK



OFFICE CHECK



CHALLENGER LINEAR PARK REPORT



ID 8030
RUNNING_SLOPE<8.33% NO
CROSS_SLOPE<2% NO
INSPECTION DATE UNKNOWN
DETECTABLE WARNINGS No
STATUS PROPOSED
COMMENTS: NONE



STATUS	
■	ACCESSIBLE
■	IN PROGRESS
■	PENDING
■	PROPOSED



EARTHDAY PARK REPORT



<p>ID</p> <p>2001</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/4/2019 3:48:29 PM</p>
<p>COMMENTS:</p> <p>Tree root</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK



EARTHDAY PARK REPORT



ID

2003

TYPE

OFFICE CHECK

INSPECTION DATE

3/4/2019 3:57:10 PM

COMMENTS:

Tree roots



TYPE

▲ FIELD CHECK

▲ OFFICE CHECK



EARTHDAY PARK REPORT




ID 2404
RUNNING SLOPE<8.33% YES
CROSS SLOPE<2% YES
INSPECTION DATE UNKNOWN
MATERIAL NONE
ADA COMPLIANT NO
COMMENTS: Missing DW



— ADA PATHWAY

GRANDVIEW LINEAR PARK REPORT

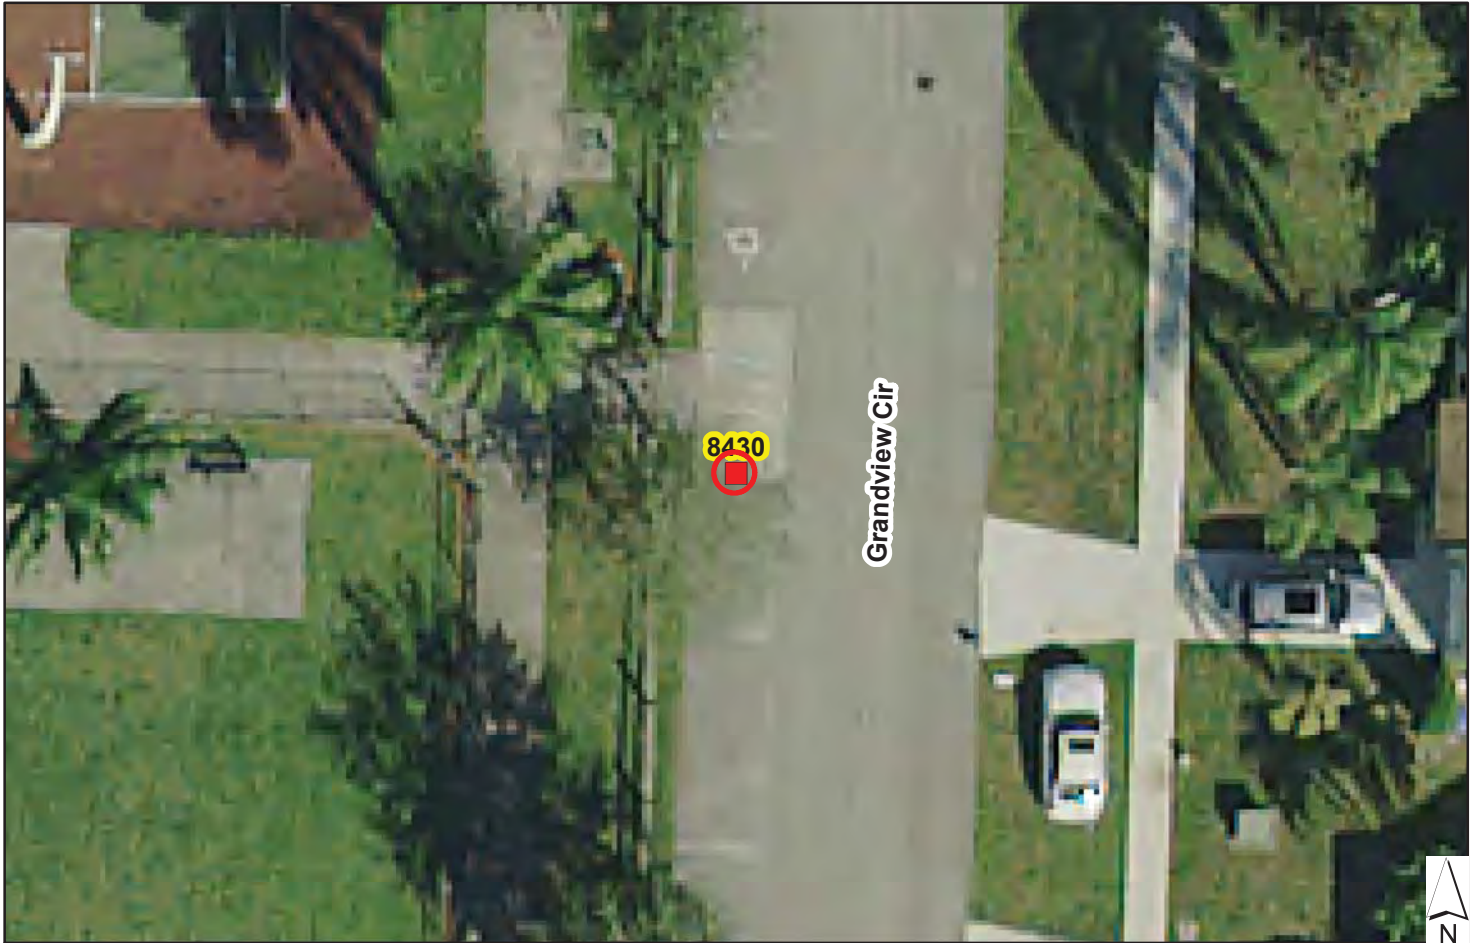

ID 8430
RUNNING_SLOPE<8.33% YES
CROSS_SLOPE<2% NO
INSPECTION DATE UNKNOWN
DETECTABLE WARNINGS No
STATUS PROPOSED
COMMENTS: NONE




STATUS

- ACCESSIBLE
- IN PROGRESS
- PENDING
- PROPOSED



HOMEPLACE PARK REPORT

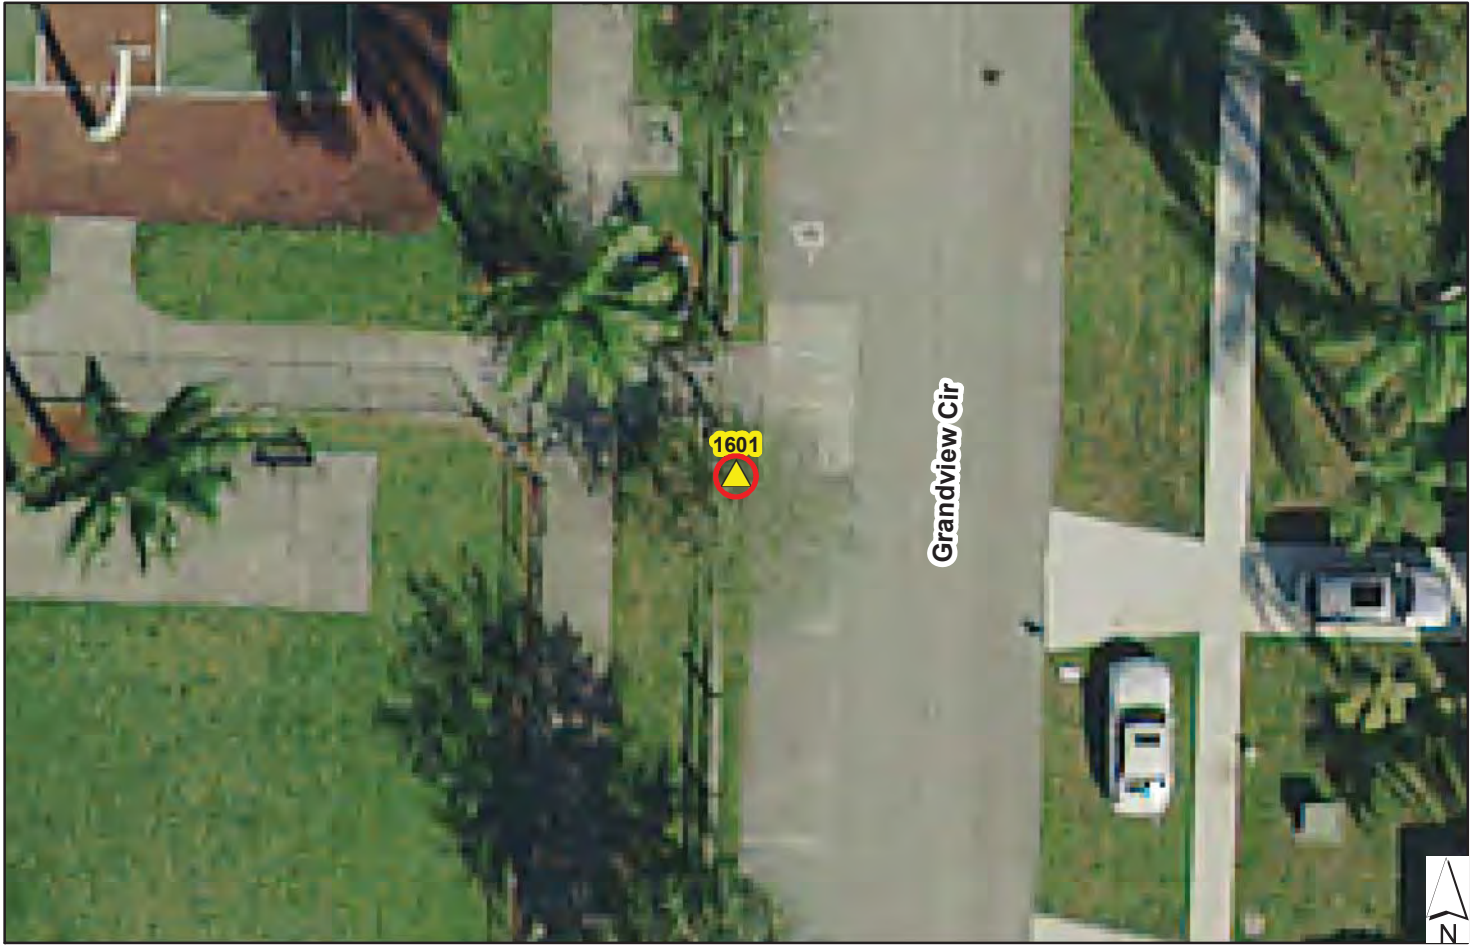

<p>ID</p> <p>1601</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/1/2019 8:30:07 PM</p>
<p>COMMENTS:</p> <p>Missing detectable warning</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK



HOMEPLACE PARK REPORT



<p>ID</p> <p>1602</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/1/2019 8:41:00 PM</p>
<p>COMMENTS:</p> <p>Fail ADA</p>



<p>TYPE</p> <p> FIELD CHECK</p> <p> OFFICE CHECK</p>	
---	---

HOMEPLACE PARK REPORT



<p>ID</p> <p>1603</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/1/2019 8:42:12 PM</p>
<p>COMMENTS:</p> <p>Fail ADA</p>



TYPE


-  FIELD CHECK
-  OFFICE CHECK



LINDSEY EWING PARK REPORT



 ID 1610
RUNNING SLOPE<8.33% YES
CROSS SLOPE<2% YES
INSPECTION DATE 2/4/2019 4:29:08 PM
MATERIAL NONE
ADA COMPLIANT NO
COMMENTS: Needs detachable warning






— ADA PATHWAY

 MOONLIGHT PARK REPORT




<p>ID</p> <p>3603</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/1/2019 5:00:00 AM</p>
<p>COMMENTS:</p> <p>No DW</p>



- TYPE**
-  FIELD CHECK
 -  OFFICE CHECK



PENZANCE PARK REPORT

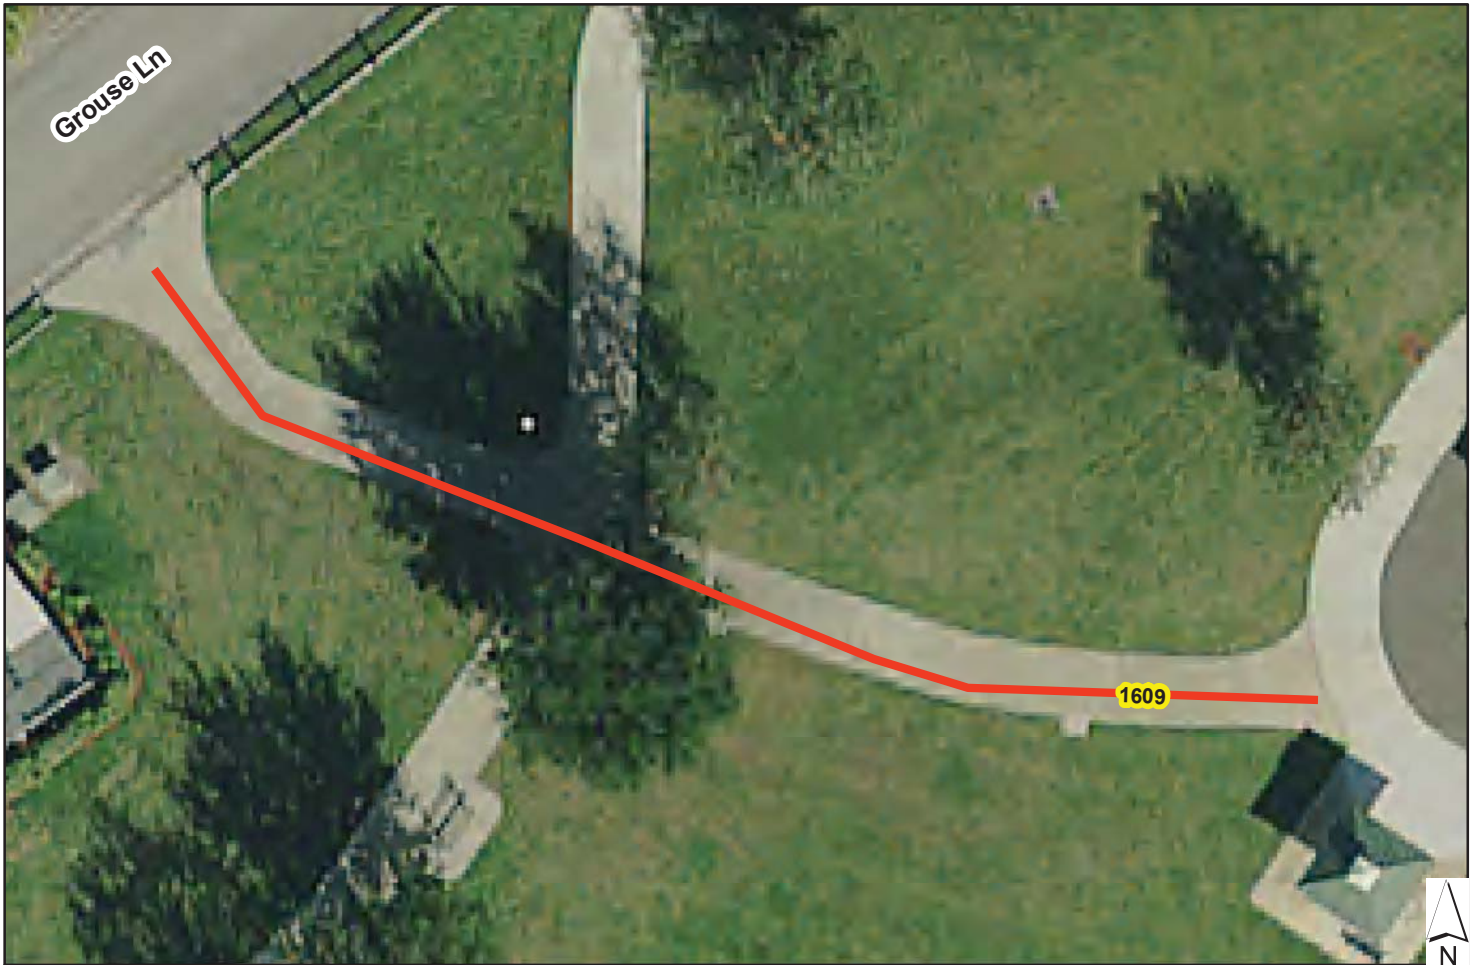

ID 1609
RUNNING SLOPE < 8.33% YES
CROSS SLOPE < 2% NO
INSPECTION DATE 2/4/2019 4:13:28 PM
MATERIAL NONE
ADA COMPLIANT NO
COMMENTS: NONE



— ADA PATHWAY

PENZANCE PARK REPORT



ID 2008
RUNNING SLOPE<8.33% YES
CROSS SLOPE<2% NO
INSPECTION DATE UNKNOWN
MATERIAL CONCRETE
ADA COMPLIANT NO
COMMENTS: NONE



— ADA PATHWAY

PINE ROAD PARK REPORT



<p>ID</p> <p>2005</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/4/2019 4:12:22 PM</p>
<p>COMMENTS:</p> <p>Missing concrete patch</p>



TYPE

- ▲ FIELD CHECK
- ▲ OFFICE CHECK




PINE ROAD PARK REPORT



<p>ID</p> <p>2006</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/4/2019 4:16:35 PM</p>
<p>COMMENTS:</p> <p>Needs to be patched</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK



PINE ROAD PARK REPORT



<p>ID</p> <p>2007</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/4/2019 4:18:13 PM</p>
<p>COMMENTS:</p> <p>Dip in pavement</p>




TYPE

-  FIELD CHECK
-  OFFICE CHECK



PINE ROAD PARK REPORT

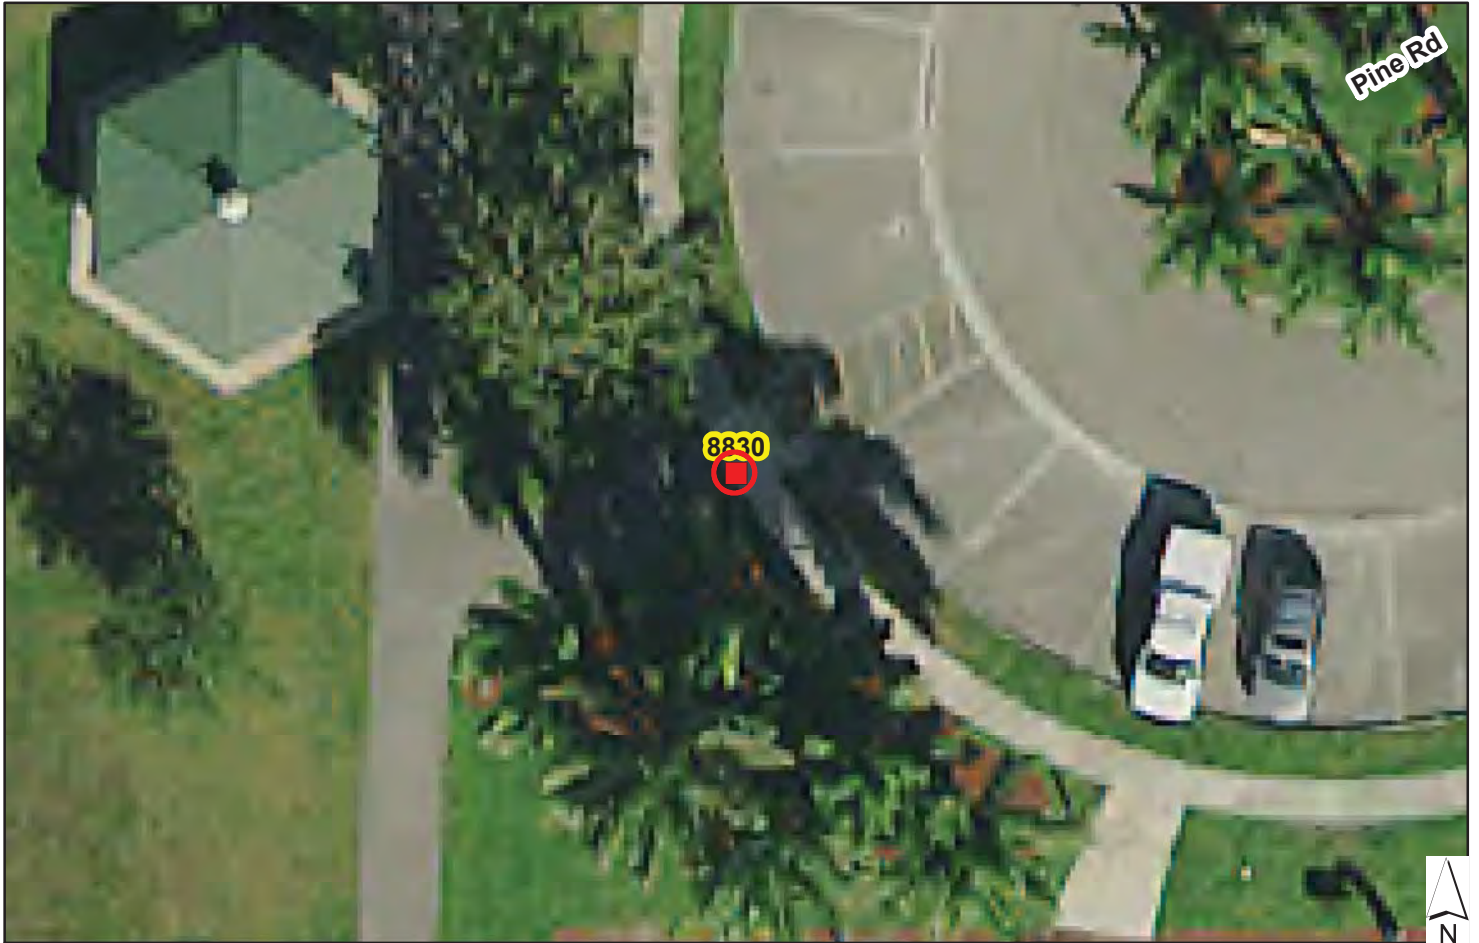


ID 8830
RUNNING_SLOPE<8.33% YES
CROSS_SLOPE<2% NO
INSPECTION DATE UNKNOWN
DETECTABLE WARNINGS NONE
STATUS PROPOSED
COMMENTS: Detectable warning mat needed



STATUS
<ul style="list-style-type: none"> ■ ACCESSIBLE ■ IN PROGRESS ■ PENDING ■ PROPOSED



PIPPIN PARK REPORT

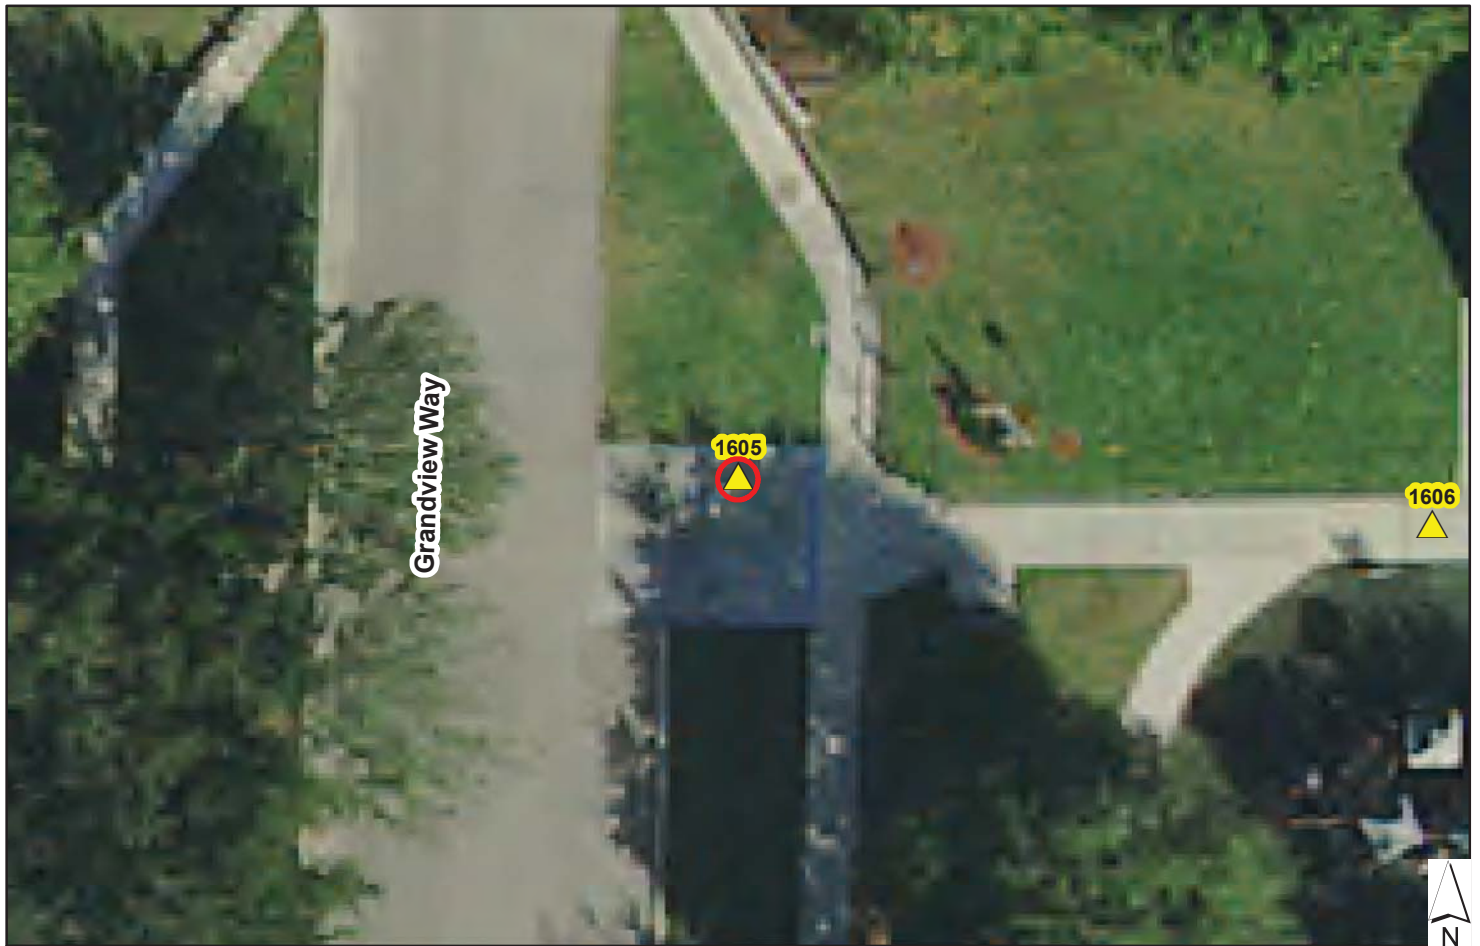

<p>ID</p> <p>1605</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/1/2019 8:51:52 PM</p>
<p>COMMENTS:</p> <p>MISSING DETECTABLE WARNING</p>




TYPE

-  FIELD CHECK
-  OFFICE CHECK



PIPPIN PARK REPORT

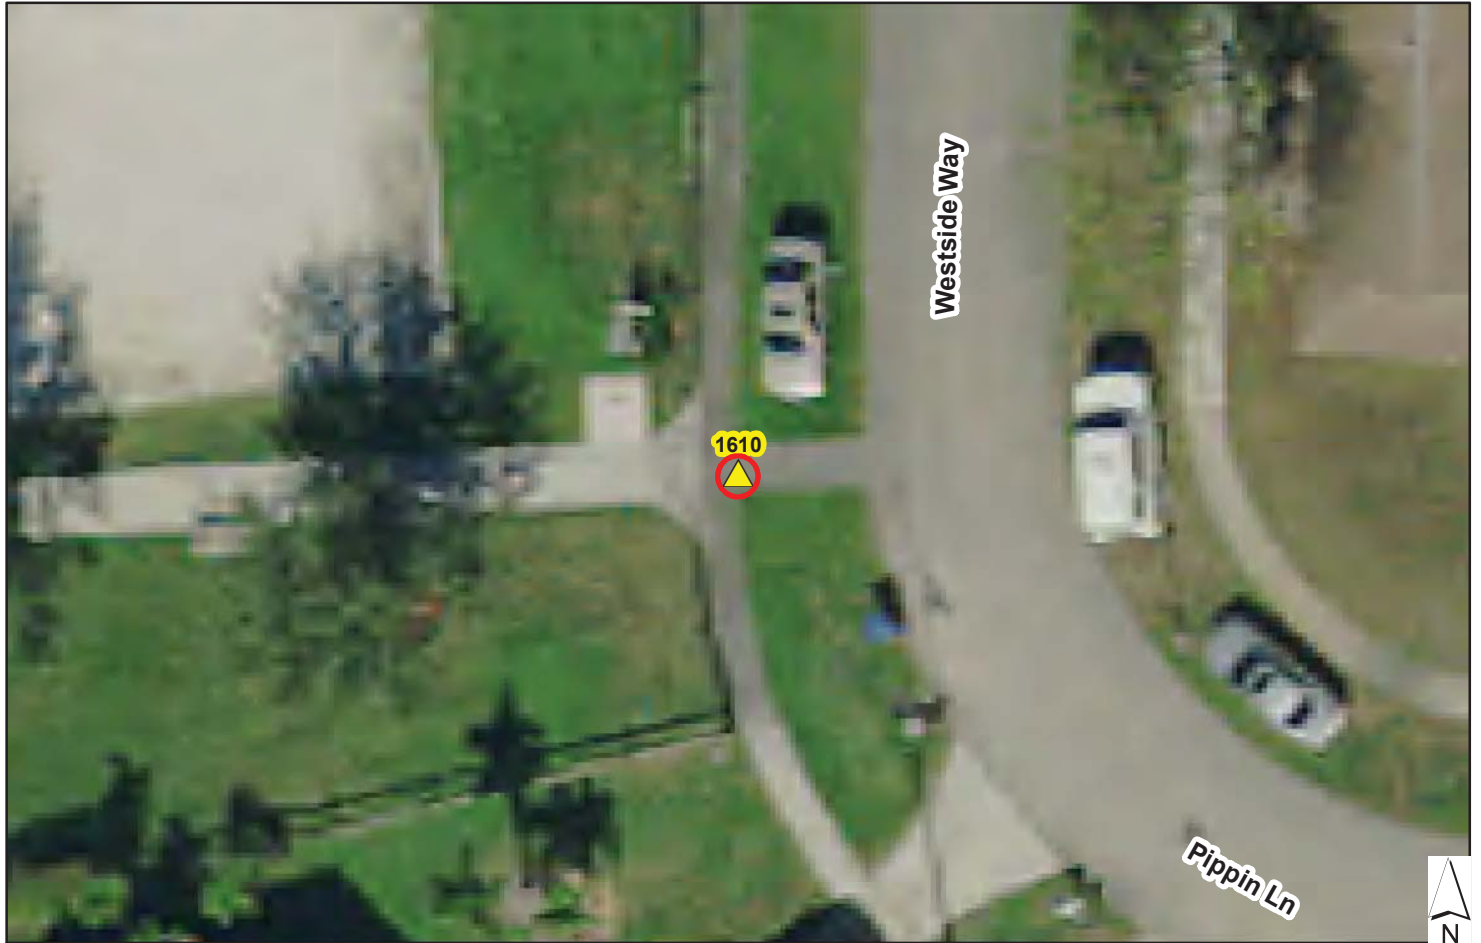

ID 1610
TYPE OFFICE CHECK
INSPECTION DATE 3/1/2019 9:38:26 PM
COMMENTS: No detectable warnings along path




- TYPE**
- ▲ FIELD CHECK
 - ▲ OFFICE CHECK



PIPPIN PARK REPORT




 ID 2005
RUNNING SLOPE<8.33% YES
CROSS SLOPE<2% NO
INSPECTION DATE UNKNOWN
MATERIAL CONCRETE
ADA COMPLIANT NO
COMMENTS: NONE



— ADA PATHWAY

PRESERVATION PARK REPORT

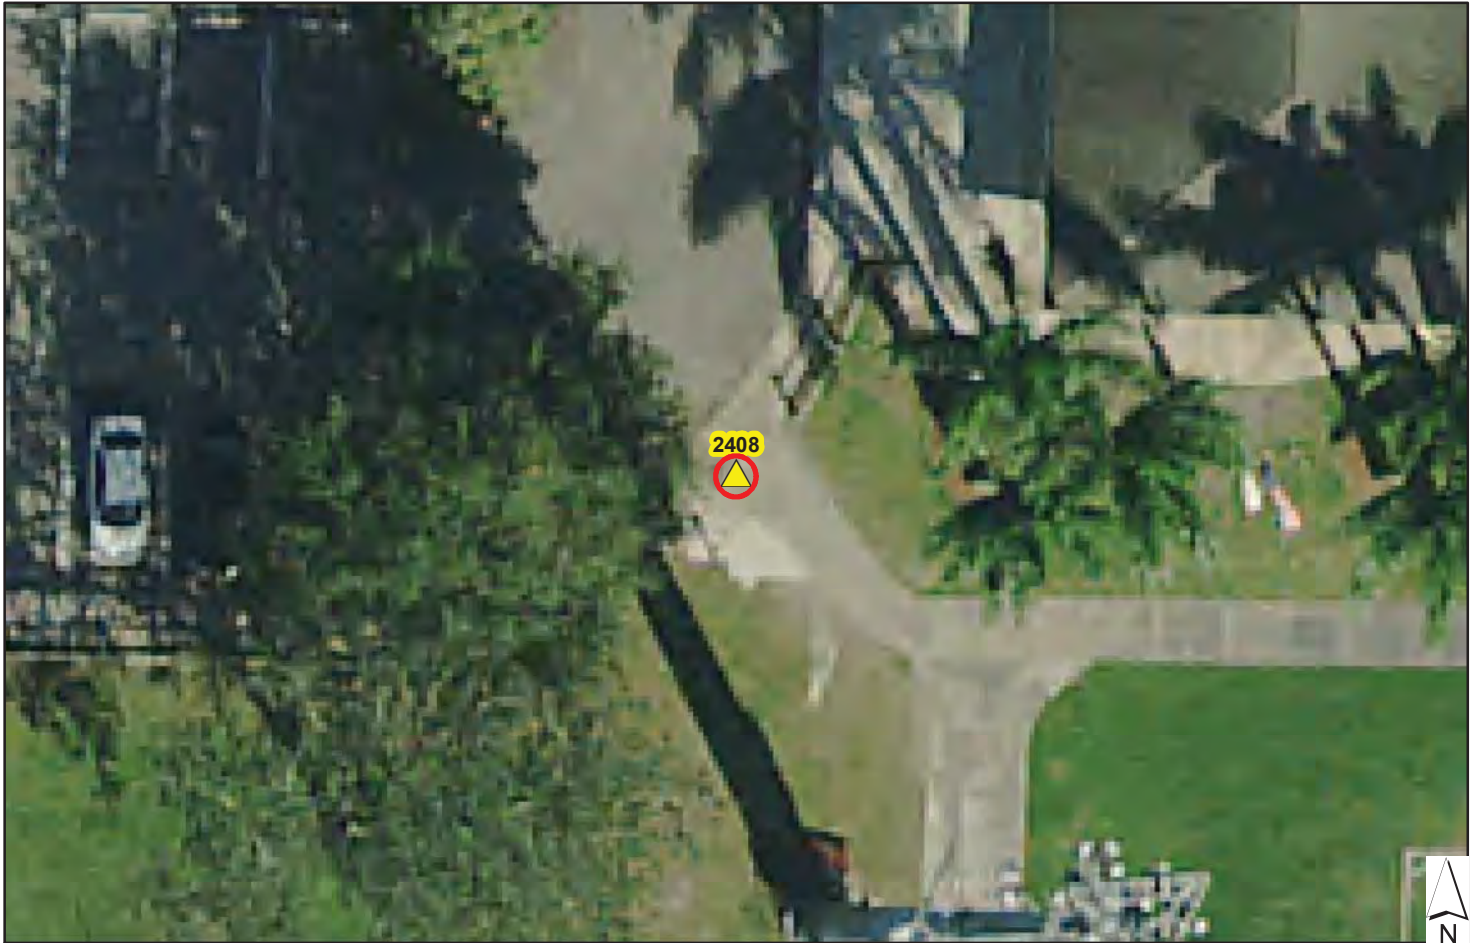

<p>ID</p> <p>2408</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 7:18:20 PM</p>
<p>COMMENTS:</p> <p>Potential ADA spot</p>




TYPE

-  FIELD CHECK
-  OFFICE CHECK



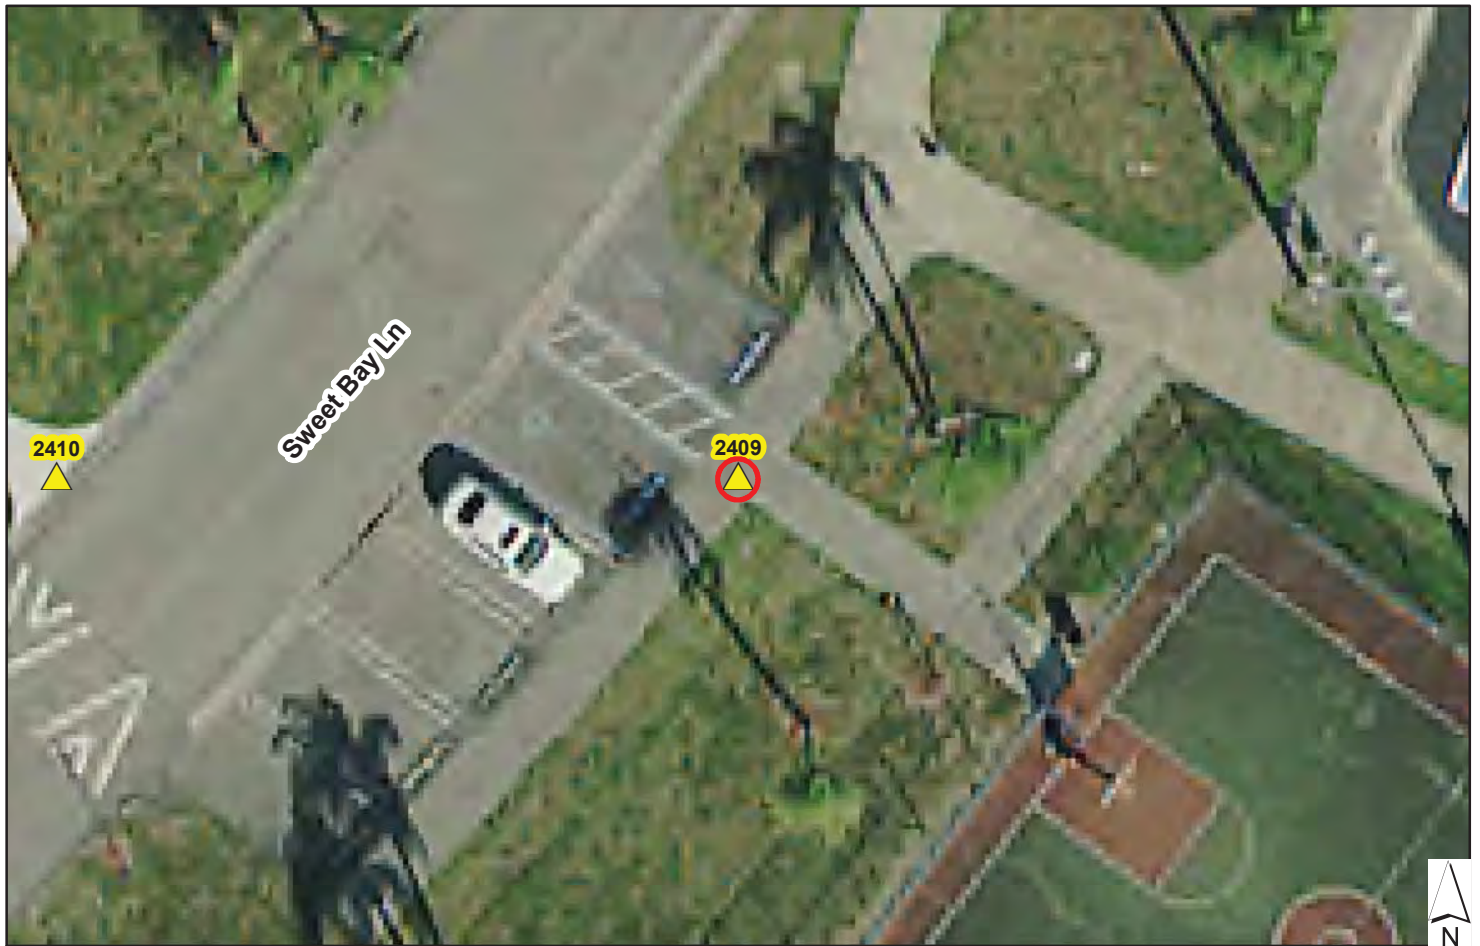

PRESERVATION PARK REPORT



<p>ID</p> <p>2409</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 7:35:00 PM</p>
<p>COMMENTS:</p> <p>No detectable warning</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK



PRESERVATION PARK REPORT



ID

2410

TYPE

OFFICE CHECK

INSPECTION DATE

3/18/2019 7:35:54 PM

COMMENTS:

No detectable warning



TYPE

▲ FIELD CHECK

▲ OFFICE CHECK




PRESERVATION PARK REPORT



<p>ID</p> <p>2411</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 7:38:53 PM</p>
<p>COMMENTS:</p> <p>No detectable warning</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK



PRESERVATION PARK REPORT



ID

2412

TYPE

OFFICE CHECK

INSPECTION DATE

3/18/2019 7:39:53 PM

COMMENTS:

No detectable warning



TYPE

 FIELD CHECK

 OFFICE CHECK



PRESERVATION PARK REPORT



ID 2805
RUNNING SLOPE<8.33% YES
CROSS SLOPE<2% NO
INSPECTION DATE UNKNOWN
MATERIAL CONCRETE
ADA COMPLIANT NO
COMMENTS: NONE

 


— ADA PATHWAY

PRESERVATION PARK REPORT



<p>ID</p> <p>3202</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/22/2019 7:21:19 PM</p>
<p>COMMENTS:</p> <p>Cross slopes fail</p>



TYPE

-  FIELD CHECK
-  OFFICE CHECK



VETERANS PARK REPORT



<p>ID</p> <p>2414</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 7:52:06 PM</p>
<p>COMMENTS:</p> <p>No detectable warning</p>



- TYPE**
- ▲ FIELD CHECK
 - ▲ OFFICE CHECK



VETERANS PARK REPORT



<p>ID</p> <p>2415</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 7:52:06 PM</p>
<p>COMMENTS:</p> <p>No detectable warning</p>



<p>TYPE</p> <ul style="list-style-type: none"> ▲ FIELD CHECK ▲ OFFICE CHECK 	
---	--

VETERANS PARK REPORT



<p>ID</p> <p>2416</p>
<p>TYPE</p> <p>OFFICE CHECK</p>
<p>INSPECTION DATE</p> <p>3/18/2019 7:52:06 PM</p>
<p>COMMENTS:</p> <p>No detectable warning</p>




TYPE

- ▲ FIELD CHECK
- ▲ OFFICE CHECK

VETERANS PARK REPORT



 ID 3206
RUNNING SLOPE<8.33% NO
CROSS SLOPE<2% NO
INSPECTION DATE UNKNOWN
MATERIAL CONCRETE
ADA COMPLIANT NO
COMMENTS: Fails toward the ramp



— ADA PATHWAY

VETERANS PARK REPORT



ID 3217
RUNNING SLOPE <8.33% NO
CROSS SLOPE <2% NO
INSPECTION DATE UNKNOWN
MATERIAL NONE
ADA COMPLIANT No
COMMENTS: Majority of sidewalk failed, no detectable warning at end of path



— ADA PATHWAY

VETERANS PARK REPORT



ID

4001

TYPE

OFFICE CHECK

INSPECTION DATE

4/8/2019 5:39:35 PM

COMMENTS:

Missing DW

TYPE



FIELD CHECK



OFFICE CHECK



ADA POINTS OF INTEREST REPORT



ID

4804

TYPE

Field Verification

INSPECTION DATE

7/8/2024 12:00:00 PM

COMMENTS:

Asphalt path has many cracks and needs replacement.



— ADA PATHWAY



WETLANDS PARK REPORT



ID

1201

TYPE

OFFICE CHECK



INSPECTION DATE

2/4/2019 2:52:54 PM

COMMENTS:

Small area with cross slope over 2%

TYPE

-  FIELD CHECK
-  OFFICE CHECK

